

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

| | | | | | |
|--------------------|------------------------|---------------|--------------|----------------------------------|----------------------|
| Building No. 26 | Street Parkside Ct. | City Chico | Zip 95928 | Date of Inspection 01/12/2017 | Number of Pages 4 |
|--------------------|------------------------|---------------|--------------|----------------------------------|----------------------|



HOUSE DETECTIVE TERMITE CONTROL INC
11 COMMERCE CT. SUITE 10
CHICO CA 95928
 (530) 894-7900 (530) 591-7079
 hdetective@att.net Fax (530) 894-7902

Report # : 11062
 Registration # : PR5960
 Escrow # :
☐ CORRECTED REPORT

Ordered by:
 Deb Sprague
 Deb Sprague Realtor
 28 Hanover Lane Suite C
 Chico 95973

Property Owner and/or Party of Interest:
 David Aust
 26 Parkside Ct.
 Chico 95928

Report sent to:

COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐


GENERAL DESCRIPTION:
 Two story wood frame single family dwelling.

Inspection Tag Posted:
 At the water heater
 Other Tags Posted:

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☐ Drywood Termites ☐ Fungus / Dryrot ☒ Other Findings ☐ Further Inspection ☒
 If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked

Diagram Not To Scale

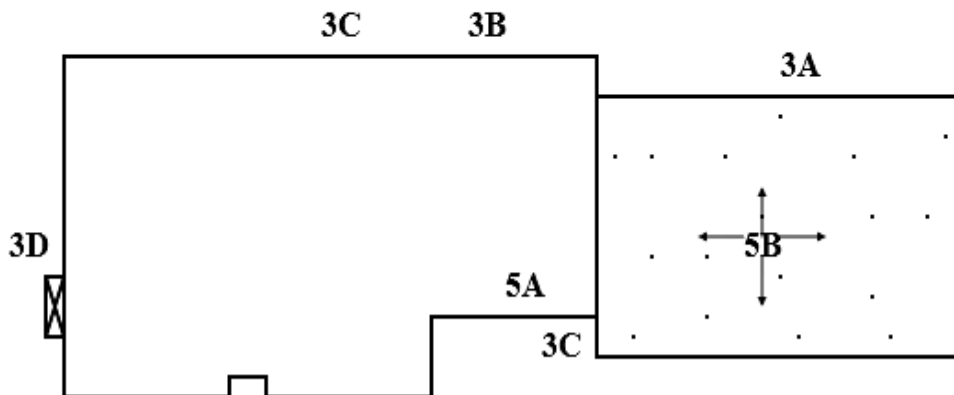

Inspected By: Gregory D Hosler State License No. OPR10012

Signature:

HOUSE DETECTIVE TERMITE CONTROL INC

Page 2 of 4 inspection report

| | | | | |
|-------------------------------|--------------|--------------------------|-------|------------|
| 26 | Parkside Ct. | Chico | CA | 95928 |
| Address of Property Inspected | | City | State | Zip |
| 01/12/2017 | | 11062 | | |
| Date of Inspection | | Corresponding Report No. | | Escrow No. |

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

HOUSE DETECTIVE TERMITE CONTROL INC

Page 3 of 4 inspection report
26 Parkside Ct.
Address of Property Inspected
01/12/2017

Chico
City
11062

CA
State

95928
Zip

Date of Inspection

Corresponding Report No.

Escrow No.

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestations or infections. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

SECTION III / FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

3. FUNGUS / DRYROT:

3A - Section I

FINDING: Fungus damage was found to the base of the side garage door and to the base of the door jambs.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3B - Section I

FINDING: Fungus damage was found to the base of the rear door jambs.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3C - Section I

FINDING: Fungus damage was found to roof eaves and fascia.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3D - Section I

FINDING: Fungus damage was found to upper wood window trim as viewed from ground. The siding below this area was bowed. This inspection is from the ground level only. We did not go on the roof. No opinion to areas which could not be probed from the ground.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

5. FURTHER INSPECTION:

5A - Section III

FINDING: A portion of the subarea is inaccessible due to heating ducts blocking access.

RECOMMENDATION: Further inspection will be performed upon request after proper access has been provided.

5B - Section III

FINDING: Portions of the interior of the garage are inaccessible for inspection due to storage.

RECOMMENDATION: Further inspection will be performed upon request after proper access has been provided.

HOUSE DETECTIVE TERMITE CONTROL INC

Page 4 of 4 inspection report

26 Parkside Ct.

Chico

CA

95928

Address of Property Inspected

City

State

Zip

01/12/2017

11062

Date of Inspection

Corresponding Report No.

Escrow No.

NOTES

Note A

NOTE: The subflooring was found to be inaccessible for physical inspection due to insulation. It is impractical to remove the insulation at this time. No visible signs of infestation or infection are visible. If interested parties are concerned, an inspection will be made upon removal of the insulation and a supplemental report will be issued listing any findings and recommendations along with estimates for repair and/or treatment, if within the scope of this companies operations.

Note B

Evidence of past termite treatments were noted in 2006 by others. No visible signs of any active termites were found in the accessible areas this date. We assume no liability for treatments done by others. If termites do ever occur prices for treatments will be offered.



Front of the structure.



3A - Damaged to the base of the door and door jambs.



3B - Damaged to the base of the rear door jambs.



3C - Damaged eaves and fascia.



3D - Damaged upper window trim.



INVOICE / STATEMENT HOUSE DETECTIVE TERMITE CONTROL INC

11 COMMERCE CT. SUITE 10
CHICO CA 95928
(530) 894-7900 (530) 591-7079
hdetective@att.net Fax (530) 894-7902

Date: 01/12/2017
Report Number: 11062
Invoice Number: 11062-1
Escrow Number:

Property Inspected: 26 Parkside Ct.
Chico, CA 95928

Bill To: David Aust
26 Parkside Ct.
Chico, CA 95928

| | |
|-----------------------|------------------|
| Inspection: | \$ 150.00 |
| Invoice Total: | \$ 150.00 |
| Payments: | \$ 150.00 |
| Additional Charge: | \$ 0.00 |
| Total Due: | \$ 0.00 |

Description of Service

Original inspection fee paid in full.

RETAIN THIS COPY FOR YOUR RECORDS

THANK YOU FOR YOUR BUSINESS

CUT HERE

CUT HERE

CUT HERE



INVOICE / STATEMENT HOUSE DETECTIVE TERMITE CONTROL INC

11 COMMERCE CT. SUITE 10
CHICO CA 95928
(530) 894-7900 (530) 591-7079
hdetective@att.net Fax (530) 894-7902

Date: 01/12/2017
Report Number: 11062
Invoice Number: 11062-1
Escrow Number:

Property Inspected: 26 Parkside Ct.
Chico, CA 95928

Bill To: David Aust
26 Parkside Ct.
Chico, CA 95928

| | |
|-----------------------|------------------|
| Inspection: | \$ 150.00 |
| Invoice Total: | \$ 150.00 |
| Payments: | \$ 150.00 |
| Additional Charge: | \$ 0.00 |
| Total Due: | \$ 0.00 |

Description of Service

Original inspection fee paid in full.

RETURN THIS COPY WITH REMITTANCE

THANK YOU FOR YOUR BUSINESS