
Building No.	Street		City		Zip	Date of Inspection	Number of Pages
2556	Nutmeg Ave		Morro Bay		93442-1736	08/19/2025	1 of 6
	PO Box 9	69, Atascadero	CONTROL CA 93423-0969 fax / 800-548-5599			ER FIELD. FIVE TO TH LD BE REF ER.	EXPERT IN QUESTIONS
Ordered by: Coast Rea Chris Bath 245 Morro Morro Bay	1	Coas 245	y Owner and Party of Interest: st Realty Morro Bay Blvd o Bay, CA 93442-2160		Report sent to:		
COMPLETE	E REPORT 🛚	LIMITED REPOR	RT SUPPLEMENT	AL REPORT	□ REINS	SPECTION REF	PORT 🗌
General Descrip Multi level;		nce; Stucco exterio	or; Composition shingle roof		Inspection Tag Posted: GARAGE		
					Other Tags Posted:		
	has been made of the stru y other structures not on th		liagram in accordance with the Stru pected.	ctural Pest Con	ntrol Act. Detached por	ches, detached s	teps, detached
	ean Termites 🔲 🏻 I bove boxes are checked, it ir	Drywood Termites	☑ Fungus/Dryrot ☑ sible problems in accessible areas. Re	Other Find	dings 🗵 Furth	ner Inspection	
Key: 1 = Subter	rranean Termites 2	2 = Drywood Termites	3 = Fungus/Dryrot	4 = Other Findi	ings 5 = Un	known Further Inspe	ection

Complete Inspection Report

Diagram not to scale Finding locations approximate

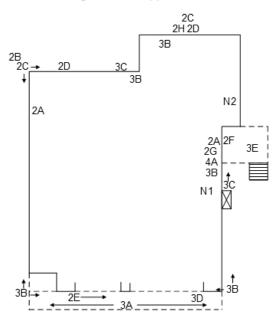

					Joil Wills
Inspected By:	David Wills	State License No.:	FR57710	Signature:	## 10 O
		-			

D 1000

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
2556	Nutmeg Ave	Morro Bay	93442-1736	08/19/2025	2 of 6

General Comments

THIS IS A COMPLETE INSPECTION and includes structure(s) of the property as described on page one of this report. The inspection is limited to visible and accessible areas of the structure(s) drawn in diagram space. Other structures of the property were not included in this report. See the statements on the final page of this report for further information as to the scope of this inspection.

NOTE: Prices quoted on this report reflect all work being completed at the same time. If individual items are requested the price for those items are subject to change to our minimum job price in order to account for the appropriate labor and materials cost. This applies to repair items only.

NOTE: All prices quoted quoted on this report reflect cash/check pricing, any credit or debit card payments made will incur a 3% processing fee.

NOTE: There was normal storage at the interior of the garage at the time of inspection. Areas covered by normal storage or furnishings were not accessible for visual inspection. Further inspection will be completed upon request after storage has been removed by others. There may be a fee charged for this reinspection.

NOTE: This structure was furnished and occupied at the time of this inspection. Areas covered by normal storage or furnishings were not accessible for visual inspection. Further inspection will be completed upon request after storage has been removed by others. There may be a fee charged for this reinspection.

NOTE: The subfloor of the structure was insulated. The subfloor, portions of the floor joists, and some areas of plumbing were not visible for inspection. If further inspection is desired, we will reinspect the substructure area after the insulation has been removed in areas of concern. Further findings will be issued on a supplemental report and there will be an inspection fee charged.

NOTE: Fresh paint was noted at the __ and may limit visual discovery of hidden conditions.

NOTE: The second and third level eaves and/or other portions of the structure which extend above 12 feet from the ground were inspected visually from the ground level only. Portions of the structure within 12 feet were visually inspected and then probed if indications of infestation, infection or adverse condition were found. Portions of the structure above 12 feet were visually inspected only. Accuracy above this point cannot be guaranteed. Visual inspection was limited in relation to height. If closer inspection of the these areas is desired, parties in interest should contact our office prior to the close of escrow to arrange for further inspection. There will be additional fees for this service.

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
2556	Nutmeg Ave	Morro Bay	93442-1736	08/19/2025	3 of 6

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section II.

Description of Findings

SECTION: I

DRYWOOD TERMITES

NOTE: DUE TO THE RISE IN COST OF MATERIALS, ALL PRICES FOR REPAIR ITEMS ARE SUBJECT TO CHANGE.

Finding: 2A Evidence of Drywood Termite infestation was found at the interior and appears to extend

into inaccessible areas of the structure.

Recommendation: Seal the structure and fumigate with a gas lethal to Drywood Termites (Sulfuryl Fluoride).

All occupants and pets must vacate the structure until the fumigation is complete. This company will exercise reasonable caution, but cannot be held responsible for damage to plants, TV antennas or roofing due to the fumigation. Further terms and instructions will be supplied upon request or upon scheduling of the fumigation. Information may also be

obtained from the fumigation page on our website at www.keytermite.com

Fumigations are guaranteed for 5 years from the date completed

Price: \$3,640.00

Finding: 2B Evidence of Drywood Termite infestation was found at the exterior.

Recommendation: Refer to item 2A for recommendation. Cost included in item 2A.

Price: Included as noted in recommendation.

Finding: 2C Drywood Termite damage was found at the fascia.

Recommendation: Remove and replace the damaged portion of the fascia as needed.

Price: \$306.00

Finding: 2D Evidence of Drywood Termite infestation was found at the exterior weep screed.

Recommendation: Refer to item 2A for recommendation. Cost included in item 2A.

Price: Included as noted in recommendation.

Finding: 2E Drywood termite damage was found at the garage trim.

Recommendation: Replace the Drywood termite damaged wood member.

Price: \$408.00

Finding: 2F Drywood Termite damage was found at the jamb.

Recommendation: Remove and replace the damaged portion of the jamb as needed.

Price: \$306.00

Finding: 2G Minor Drywood Termite damage was found at the interior door jamb.

Recommendation: Repair the minor damage of the wood member with a wood filler.

Price: \$51.00

Finding: 2H Drywood Termite damage was found at the sheathing.

Recommendation: Remove and replace the damaged portion of the sheathing as needed.

Price: \$357.00

FUNGUS/DRYROT

Finding: 3A Fungus damage was found at the second level cantilever balcony framing and handrail.

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
2556	Nutmeg Ave	Morro Bay	93442-1736	08/19/2025	4 of 6

Recommendation: Remove and replace the damaged portions of the second level cantilever balcony framing

and handrail as needed to eliminate the fungus infection and damage.

Price: Price on request

Finding: 3B Fungus damage was found at the second level fascia of the eave area.

Recommendation: Replace the fungus damaged portions of fascia as needed.

Price: \$1,428.00

Finding: 3C Fungus damage was found at the fascia of the eave area.

Recommendation: Replace the fungus damaged portions of fascia as needed.

Price: \$612.00

Finding: 3D Fungus damage was found at the exterior door frame and trim.

Recommendation: Replace the damaged portions of the door frame and trim as necessary.

Price: \$306.00

Finding: 3E Fungus infection and damage were found in the wood deck and steps throughout the

decking and framing.

Recommendation: Remove and replace the damaged wood members of the deck. This will most likely involve

complete replacement of the wood deck. In areas where a sound wood member is not replaced and VERY MINOR surface fungus growth is present but no detectable deterioration has occurred, scrape away the surface growth with a wire brush and chemically treat the wood member with disodium octaborate tetrahydrate or copper napthenate. Repair includes replacement with nailed con-common redwood decking and doug-fir framing. Additional costs for upgrades to deck screws, con-heart, deck-heart,

synthetic decking or pressure treated framing will be quoted upon request.

Price: \$7,600.00

SECTION: II OTHER FINDINGS

Finding: 4A The master toilet was found to be loosely bolted to the floor. This creates a potential

source of leakage.

Recommendation: Reset the toilet using a new wax seal and bolts. Additional costs may apply if the toilet

flange is found to be damaged or if existing supply line/valve cannot be reused.

Price: No Bid offered at this time. Owner should contact appropriate tradesman to complete

recommended corrections.

Section I Total: \$15,014.00 Section II Total: \$0.00

Grand Total: \$15.014.00 (totals include items priced above only)

Building No.	Street	City	Zip	Date of Inspection	Number of Pages	
2556	Nutmeg Ave	Morro Bay	93442-1736	08/19/2025	5 of 6	

Informational Items

INFORMATIONAL ITEMS listed below are items where the inspector wishes to inform parties in interest about questionable conditions or report exclusions. These disclosures may be of concern to parties in interest, but did not qualify as a required finding or correction as defined by the Structural Pest Control Act. All parties in interest should satisfy themselves as to these disclosures prior to the close of escrow.

INFORMATIONAL ITEM> N1: The third level stall shower located on the second story over the finished ceiling was not water tested. The ceiling below the shower was inspected for indications of leakage. No indications of leakage were found.

INFORMATIONAL ITEM> N2: A potential moisture condition exists due to a window at the stall shower. The owner should maintain an adequate seal at the window frame and tile to prevent leakage into the wall space.

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
2556	Nutmeg Ave	Morro Bay	93442-1736	08/19/2025	6 of 6

- 1. This inspection is limited to the visible and accessible portions of the structure as noted on the diagram only. Although a full diagram may be drawn for reference purposes, all areas may not have been inspected. Please read the entire report to determine the limitations of the inspection. All findings will pertain to infestation and/or infection by wood destroying pests and/or organisms and does not include reference to other structural pests such as, but not limited to; Rats, Mice, Bats, Fleas, Cockroaches, Ants, Etc.. This inspection does not include opinions as to the condition of plumbing, roofing, electrical, gas, heating, air conditioning, or other such structural elements. If such information is desired, we suggest that a qualified Home Inspector and Contractors be contacted. Inspection of fences is not included in this report unless otherwise stated. The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors' State License Board.
- 2.The following areas were not inspected, as indicated in Section #1990, paragraph (j) of the Structural Pest Control Act and Rules and Regulations: Portions of furnished interiors concealed by personal property, inaccessible attics, insulated attics, and portions thereof; the interior of hollow walls; spaces between a floor or porch deck and the ceiling or soffit below; stall showers over finished ceilings: such structural segments as porte-cocheres, enclosed bay windows, buttresses and similar areas to which there is no access without defacing or tearing out lumber, masonry and finished work; built-in cabinet work, floor beneath coverings; areas where storage conditions or locks makes inspection impractical; portions of the structure covered by plant growth. The inspector did not move storage or furnishings during inspection. NEITHER KEY TERMITE AND PEST CONTROL, INC. NOR IT'S EMPLOYEES OR SUBCONTRACTORS MAKES ANY GUARANTEE AGAINST FUTURE OR HIDDEN INFESTATION(S), INFECTION(S), OR ADVERSE CONDITION(S) PRESENT BUT NOT EVIDENT AT THE TIME OF INSPECTION(S). Routine inspection does not include opening windows, opening all exterior doors or inspecting interior of cabinets. Further inspection of these areas may be completed upon request and at additional expense.
- 3.CERTIFICATION applies to visible and accessible areas of the structure observed at the time of original inspection. This certification does not constitute a guarantee that parties in interest will not inherit hidden infestations, infections or adverse conditions. Key Termite and Pest Control, Inc. assumes no liability for such hidden conditions. If a problem is discovered that was not disclosed during our inspections, do not disturb the area. Contact our office immediately to inspect the problem area and allow proper determination.
- 4.REINSPECTIONS; "This Company will reinspect repairs done by others within 4 months of the Original inspection. A charge, if any can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs." Consultation appointments will be made upon request. On site appointments will be billed at a minimum of \$45.00 per appointment. Telephone calls to discuss the report findings are no charge.
- 5.The structure was inspected from the ground level only. Portions of the structure that extend more than 10 feet from the ground level were visually inspected only. Accuracy above this point cannot be guaranteed. Wood members showing visible signs of infestation or infection were pick-tested to determine the nature and extent of the finding. The inspector did not get up on the roof to inspect wood members accessible from the roof.
- 6.NOTICE: The structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary company to company. You have a right to seek a second opinion from another company.
- 7.NOTICE: The charge for service that this company subcontracts to another person or entity may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. YOU MAY ACCEPT KEY TERMITE & PEST CONTROL'S BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, KEY TERMITE & PEST CONTROL WILL NOT BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM.
- 8. This property WAS NOT inspected for the presence or absence of health related molds or fungi. By California Law, we are neither qualified, authorized nor licensed to inspect for health related molds. If you desire information about the presence or absence of health related molds, contact the California Department of Health Related Services. A link may be found in our web site at the following web address http://www.keytermite.com/Realtors/mold.html
- 9.Peticides are the products Key Termite & Pest Control uses to control the target pests listed in your Inspection Report. Pesticides are indespensable tools our industry uses to control disease carrying pests and wood destroying insects, thus protecting your health and property. When properly used, pesticides pose minimal risk to humans or the environment. Your Technician is a State certified applicator whose knowledge is constantly being upgraded through regularly scheduled training sessions. If you have any questions, please call us at: 805-466-2451 or write to: Key Termite & Pest Control, PO BOX 969, Atascadero, CA 93423. Key Termite & Pest Control will not apply any compound not authorized for use in California. Please refer to the Inspection Report above for proposed materials to be used.
- 10.CAUTION: PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operators are licensed and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following an application you experience symptoms similar to common seasonal illness, comparable to the flu, contact Key Termite & Pest Control (805-466-2451), your physician, and/or your Poison Control Center. For the Poison Control Center, contact the following: (1-800-876-4766). FURTHER INFORMATION: Contact any of the following: Your pest control operator is Key Termite & Pest Control, (805-466-2451); for Regulatory Information call the Structural Pest Control Board (916-561-8708), or write 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815. For answers to your health questions, call the County Health Department; Santa Barbara County Health Dept (805-681-5102); San Luis Obispo County Health Dept (805-781-5940).
- 11. Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.
- 12.To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. It's purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.
- 13.NOTICE: Invoices are due and payable within 30 days. 1.5% per month will be added to account balances beyond 30 days from the date of work completed. This is an annual percentage rate of 18%. (Interest charged persuant to the Robinson-Patman Act). Interest amounts for balances billed to an Escrow Company as a course of a Real Estate sale will be waived up to 4 months from the date of work completed so long as the property remains in escrow. Should an Escrow transaction cancel, the full account balance is due and payable upon the Escrow cancellation date.

WORK ORDER AGREEMENT (PAGE 1 OF 2)

		•	•	
Building No. S	Street	City	Zip	Date
2556 N	Nutmeg Ave	Morro Bay	93442-1736	08/21/25
	PO Box 969.	nd PEST CONTROL Atascadero, CA 93423-0969 05-466-8026 fax / 800-548-5599	A LICEN OPERATO HIS/HER I RELATIVI SHOULD HIM/HER.	R IS AN EXPERT IN FIELD. ANY QUESTIONS E TO THIS REPORT BE REFERRED TO
Ordered by:		Property Owner and/or Party of Interest:	Completion sent to:	
Coast Realty Chris Bath 245 Morro Bay Morro Bay, CA		Coast Realty 245 Morro Bay Blvd Morro Bay, CA 93442-2160		

COST FOR WORK RECOMMENDED FOR TERMITE REPORT #: 111443 (please circle desired item numbers)				
SECTION I	SECTION II	SECTION NOT DETERMINED OR FURTHER INSPECTION RECOMMENDED		
2A \$3,640.00 3C \$612.00 2B INCLUDED 3D \$306.00 2C \$306.00 3E \$7,600.00 2D INCLUDED 2E \$408.00 2F \$306.00 2G \$51.00 2H \$357.00 3A POR 3B \$1,428.00 Total Section I: \$15,014.00	4A NO BID			

I HEREBY AUTHORIZE KEY TERMITE & PEST CONTROL TO PERFORM THE FOLLOWING ITEMS: (please list item numbers below)

PLEASE INITIAL HERE _____ USE SPACE BELOW TO DESCRIBE FURTHER INSTRUCTIONS:

Thank you for choosing Key Termite and Pest Control for your pest control needs. Feel free to call our office to answer any questions you may have concerning the Inspection Report, the Work to be completed or the Terms of this Contract. PLEASE INITIAL THIS PAGE AND RETURN BOTH PAGES OF THIS AGREEMENT TO OUR OFFICE.

WORK ORDER AGREEMENT (PAGE 2 OF 2)

Building No.	Street	City	Zip	Date
2556	Nutmeg Ave	Morro Bay	93442-1736	08/21/25

*****State law requires that you be given the following information*****

CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation Agency and the United States Environmental Protection Agency. Registration is granted when the State finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or Poison Control Center and Key Termite and Pest Control, Inc. (805) 466-2451 immediately. For further information contact any of the following:

For health questions: The County Health Department (805) 781-5500 For application information: The County Agricultural Commissioner (805) 781-5910 For regulatory information: The Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815-3831, (916) 561-8700

Prices for structural repair include replacement of damaged wood members visible at the time of inspection only. Structural improvements necessary to upgrade the existing construction to current building code or corrections of hidden conditions exposed during repairs will be completed at additional expense. This company assumes no liability for improper or non compliant structure(s) on which we complete repairs. Parties in interest should contact the county building department and/or qualified home inspector concerning the structures' compliance with building code. The property owner is responsible to pay for all costs associated with building permits and engineering fees needed and is not included in the repair bid. There will also be additional costs if upgrades are required by the local building department prior to or during the course of repairs. These costs should be determined and appropriated by parties in interest prior to the close of escrow. Reasonable effort will be taken to match existing material being replaced with the same or similar type. However, Key Termite and Pest Control Inc. does not guarantee new material will match the existing material. Special order materials may delay the completion of recommended work and certification date. Painted wood members that are replaced by this company (except stained or varnished wood, and redwood decking) will be painted unless otherwise requested and will be billed as quoted in report recommendation. This company makes no guarantee of color match. The buyer or seller is responsible to choose paint color prior to commencement of repairs. Structural repair recommendations not priced above may be completed upon request and will be billed at \$85.00 per hour which will include basic construction materials (doors, windows and redwood deck materials would be additional). Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes no liability for distribution of molds, dusts or other allergens as a result of repairs performed to the property. Parties in interest should contact a Certified Industrial Hygienist for further information and advice prior to commencement of repairs. We will exercise reasonable caution with adjacent plant growth during the completion of repairs, however, neither Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes any liability for damages to adjacent plant growth as a result of the completion of repairs. Prices authorized after 30 days from the date of issuance of the inspection report are void and must be re-bid. Our minimum job fee is \$145.00 (to cover trip costs and completion notice paperwork). If repairs completed total less that \$145.00, we will bill the \$145.00 minimum fee.

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier, or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers, or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of person(s) who may have a right to file a lien against your property if they are not paid.

NOTICE: Invoices are due and payable within 30 days. 1.5% per month will be added to account balances beyond 30 days from the date of work completed. This is an annual percentage rate of 18%. (Interest charged pursuant to the Robinson-Patman Act). Interest amounts for balances billed to an Escrow Company as a course of a Real Estate sale will be waived up to 4 months from the date of work completed so long as the property remains in escrow. Should an Escrow transaction cancel, the full account balance is due and payable upon the Escrow cancellation date.

By executing this work authorization contract, customer acknowledges that he or she has been advised of the forgoing and has had the opportunity to consult with a qualified professional.

UNLESS OTHERWISE STATED IN THE INSPECTION REPORT OR THIS CONTRACT, ALL WORK COMPLETED BY KEY TERMITE AND PEST CONTROL IS GUARANTEED FOR TWO YEARS FROM THE DATE OF COMPLETION AGAINST DEFECTS IN MATERIALS AND/OR WORKMANSHIP. ELIMINATION OF REPORTED WOOD DESTROYING PESTS BY STRUCTURAL FUMIGATION AND "PERIMETER PLUS" SUBTERRANEAN TERMITE TREATMENT IS GUARANTEED FOR FIVE YEARS FROM THE DATE OF COMPLETION.

BY SIGNING BELOW, I ACKNOWLEDGE THAT I HAVE READ, UNDERSTAND AND AGREE TO THE TERMS OF THIS CONTRACT AND THE REPORT IT REFERS TO.

BY OWNER/AGENT/BUYER	Key Termite & Pest Control				
PHONE:	Ву:	David Wills			
SIGNATURE:	Signature:	Doil Wills			
PRINT NAME:	Lic. #:	FR57710			
NOTE: WORK WILL NOT COMMENCE UNTIL DELIVERY OF YOUR WOOD DESTROYING PESTS AND ORGANISMS REPORT. FOR DETAILS REGARDING THE ABOVE RECOMMENDATIONS PLEASE REFER TO YOUR INSPECTION REPORT.					