INVOICE

Go-To Plumbing, Inc. 1420 New Wine PI Templeton, CA 93465 gotoplumbing805@gmail.com +1 8054347096 www.gotoplumbing.net



Brian Thorndyke

Bill to

Brian Thorndyke 246 16th Street Paso Robles, CA 93446 Ship to

Brian Thorndyke 246 16th Street Paso Robles, CA 93446 Invoice details

Invoice no.: 2717

Invoice date: 03/28/2023

Terms: Net 30

Due date: 04/27/2023

Product or service Amount

. Camera 1 unit × \$820.00 \$820.00

Service date: 03/27/2023

Called out for a sewer lateral inspection. Located a 3" one way clean out on the back left corner of the house. Found the clean out to run toward the alley. Also found another 4" abs one way clean out approximately 30' closer to the alley than the first clean out. Ran the camera in the 3" clean out and found the line to have some roots in it. Ran the camera through the 4" clean out and under the back side of the garage. Found the line to be loaded full of roots. Found the line to be so full of roots that the camera could not go through. Found owner's representative to authorize clearing the line and removing as many roots as possible and recameraing the line. Ran the line from the 3" clean out and the 4" clean out as necessary multiple times pulling back roots. Worked through the line multiple times to clear the roots as much as possible using the camera in conjunction. Recameraed the line from the 3" clean out.

Found the sewer piping to be abs for the first few feet.

Found the piping to switch to clay at approximately 3'.

Found back graded sections from 4' to 30'.

Found the 4" clay clean out to be at approximately 30'. The sewer line is approximately 3'-5" deep at this location.

Found some slightly back graded clay piping 30'-45' out.

Found root intrusions at multiple clay joints.

Found the lateral to be approximately 85' long. Found the main line in the alley to be approximately 4'-9" deep.

Located and marked the line on the floor of the garage unit. The line makes a 45 degree turn in the garage and heads toward the main line in the alley.

Sewer lateral inspection charge plus 3.5 hours to clear roots

Ways to pay Total \$820.00

BANK

Pay invoice