

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1289	Street Palmetto Ave	City Chico	ZIP 95926	Date of Inspection 11/23/2022	Number of Pages 5
----------------------	------------------------	---------------	--------------	----------------------------------	----------------------

**Stone Ridge Termite and Pest**  
**P.O. Box 6927**  
 Chico CA 95927  
 (530) 228-1964 (530) 876-9271  
 stoneridge0790@sbcglobal.net  
 Fax (530) 876-9273

Report # : 40492  
 Registration # : PR3779  
 Escrow # :  
 CORRECTED REPORT

Ordered by: Suzy Mann Regency Realty Of Chico 140 Yellowstone Ct Ste 160 Chico CA 95973 suzymann@aol.com	Property Owner and/or Party of Interest: C/O Suzy Mann Regency Realty Of Chico 140 Yellowstone Ct Ste 160 Chico CA 95973 suzymann@aol.com	Report sent to: Suzy Mann Regency Realty Of Chico 140 Yellowstone Ct Ste 160 Chico CA 95973 suzymann@aol.com
---	--	---

COMPLETE REPORT      
 LIMITED REPORT      
 SUPPLEMENTAL REPORT      
 REINSPECTION REPORT


GENERAL DESCRIPTION: Single family residence; vacant, attached garage	Inspection Tag Posted: Subarea Other Tags Posted: None noted
--	---

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites      
 Drywood Termites      
 Fungus / Dryrot      
 Other Findings      
 Further Inspection

**If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.**

**Diagram Not To Scale**

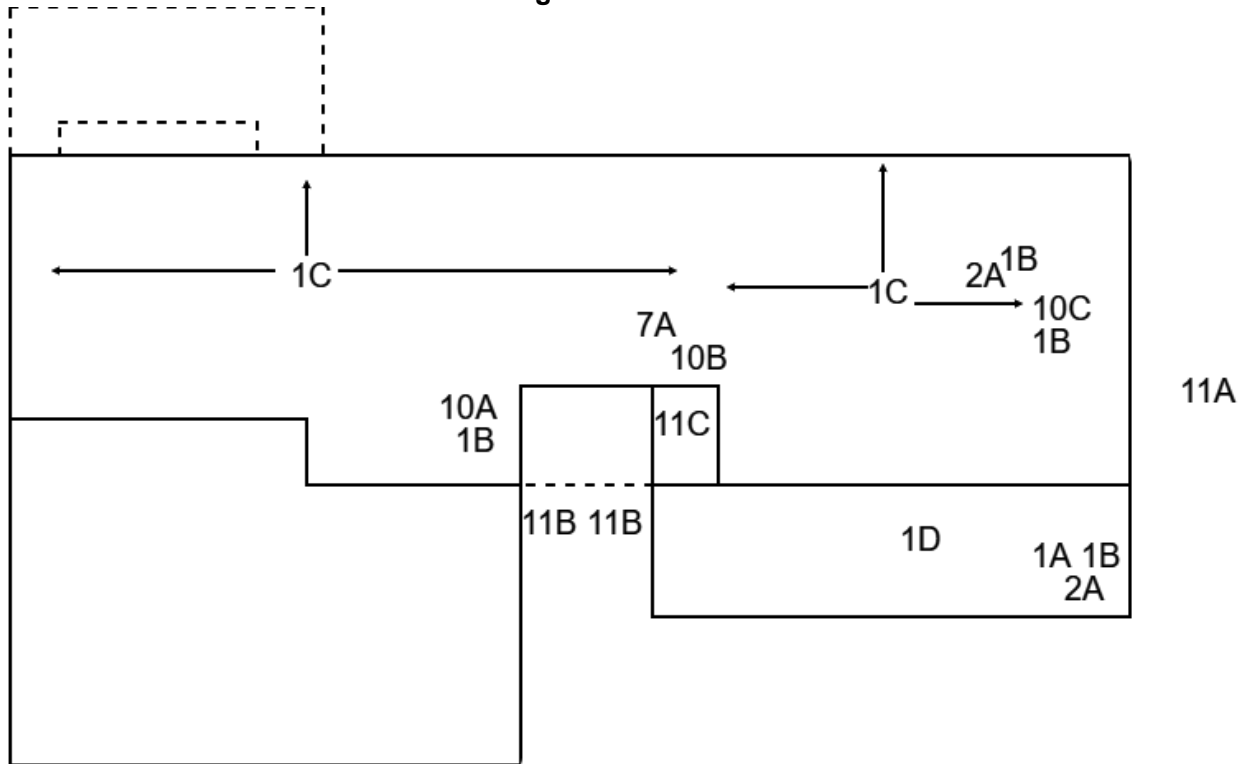

Inspected By: Kevin Erskine     
 State License No. FR28893     
 Signature: *Kevin Erskine*

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.  
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.      43M-41 (Rev. 04/2015)

# STONE RIDGE TERMITE AND PEST

Page 2 of 5 inspection report

1289	Palmetto Ave	Chico	CA	95926
Address of Property Inspected		City	State	ZIP
11/23/2022	40492			
Date of Inspection	Corresponding Report No.		Escrow No.	

**WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.**

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

**The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.**

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

# STONE RIDGE TERMITE AND PEST

Page 3 of 5 inspection report

1289	Palmetto Ave	Chico	CA	95926
Address of Property Inspected		City	State	ZIP
11/23/2022	40492			
Date of Inspection	Corresponding Report No.			Escrow No.

**SECTION I** CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

**SECTION II** ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

**FURTHER INSPECTION** ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

\*\*\*\* This is to certify that the above property was inspected on this date in accordance with the Structural Pest Control Act and the rules and regulations, adopted pursuant thereto, and no visible evidence of active infestation or infection was found in the visible and accessible areas. \*\*\*\*

## 1. SUBSTRUCTURE AREA:

### 1A - Section II

FINDING: Cellulose debris (wood, paper products) was noted in the subarea.

RECOMMENDATION: Remove and dispose of the cellulose debris of a rakeable size from the subarea

### 1B - Section II

FINDING: Stains were noted at the subfloor wood members beneath the kitchen and bathrooms.

RECOMMENDATION: Interested parties should engage the services of a licensed plumber to check for leaks and make repairs as needed.

### 1C - Other

FINDING: Stains were noted at the subfloor wood members adjacent to the foundation vents. Moisture appears to be the result of wind-driven rains. No moisture-related damage was noted.

RECOMMENDATION: Periodic inspection advised.

### 1D - Notes

NOTE: Portions of the subfloor wood members beneath the addition are concealed by subfloor insulation.

## 2. STALL SHOWER

### 2A - Section II

FINDING: Cracked tile grout was noted at both bathroom stall shower enclosures.

RECOMMENDATION: Seal the stall shower tile grout as needed to help prevent moisture related problems in this area.

## 7. ATTIC SPACES

### 7A - Further Inspection

FINDING: The attic area is inaccessible for inspection due to insulation and/or inadequate clearance between the top of the

# STONE RIDGE TERMITE AND PEST

Page 4 of 5 inspection report

1289	Palmetto Ave	Chico	CA	95926
Address of Property Inspected		City	State	ZIP
11/23/2022	40492			
Date of Inspection	Corresponding Report No.		Escrow No.	

ceiling joists and the bottoms of the rafters. A "visual" inspection from the access opening was made.

RECOMMENDATION: It is impractical to make the area accessible, however, it may be subject to attack by wood destroying pest and organisms. No opinion is rendered concerning the conditions in the attic area at this time.

## 10. OTHER - INTERIOR

### 10A - Section II

FINDING: Stains (dry) were noted at the kitchen sink cabinet bottom.

RECOMMENDATION: Interested parties should engage the services of a licensed plumber to check for leaks and make repairs as needed.

### 10B - Section II

FINDING: Stains were noted at the base of the entryway closet walls and floor. Unable to determine if stains are active or passive.

RECOMMENDATION: Interested parties should engage the services of a licensed contractor to check for leaks and to perform any corrective work needed.

### 10C - Section II

FINDING: Cracked tiles and grout was noted at the hall bathroom bathtub/shower enclosure walls.

RECOMMENDATION: Seal/repair the bathtub surround tiles and grout as needed to help prevent moisture related problems in this area.

## 11. OTHER - EXTERIOR

### 11A - Section II

FINDING: Stains were noted at the stucco walls beneath the windows. Unable to determine if stains are active or passive.

RECOMMENDATION: Interested parties should engage the services of a licensed contractor to check for leaks and to perform any corrective work needed.

### 11B - Section II

FINDING: Stains were noted at the gutter and downspout seams.

RECOMMENDATION: Seal the gutter and downspout seams as needed to help prevent moisture-related problems in this area.

### 11C - Section II

FINDING: Stains were noted at the water heater closet walls and floor.

RECOMMENDATION: Interested parties should engage the services of a licensed contractor to check for leaks and to perform any corrective work needed.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural

# STONE RIDGE TERMITE AND PEST

Page 5 of 5 inspection report

1289	Palmetto Ave	Chico	CA	95926
Address of Property Inspected		City	State	ZIP
11/23/2022	40492			
Date of Inspection	Corresponding Report No.		Escrow No.	

pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

**CAUTION - PESTICIDES ARE TOXIC CHEMICALS.** Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:


Poison Control Center	(800) 222-1222
Agricultural Department	(530) 538-7381
Health Department	(530) 538-7581
Structural Pest Control Board	(916) 561-8700
2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815	



2A



2A

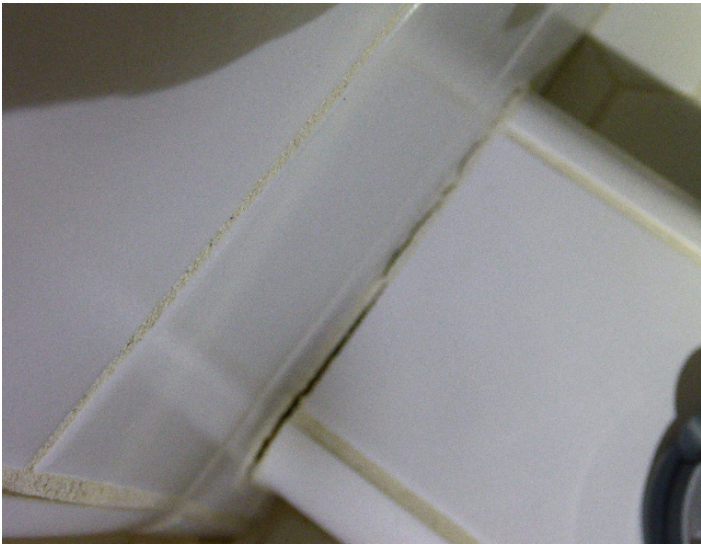

2A



2A



10A



10B



10C



10C



11A



11A



11A



11B

1289 Palmetto Ave  
Address of Property Inspected

Chico  
City

CA  
State

95926  
ZIP



11B



11C



# INVOICE / STATEMENT

## Stone Ridge Termite and Pest

P.O. Box 6927

Chico CA 95927

(530) 228-1964 (530) 876-9271

stoneridge0790@sbcglobal.net

Fax (530) 876-9273

Date: 11/27/2022

Report Number: 40492

Invoice Number: 40492-1

Escrow Number:

Property 1289 Palmetto Ave

Inspected: Chico, CA 95926

Bill To: C/O Suzy Mann  
Regency Realty Of Chico  
140 Yellowstone Ct Ste 160  
Chico, CA 95973

suzymann@aol.com

Inspection Fee: \$	210.00
<b>Invoice Total: \$</b>	<b>210.00</b>
Payments: \$	0.00
<b>Total Due: \$</b>	<b>210.00</b>

Description of Service

RETAIN THIS COPY FOR YOUR RECORDS

**THANK YOU FOR YOUR BUSINESS**

CUT HERE

CUT HERE

CUT HERE

# INVOICE / STATEMENT

## Stone Ridge Termite and Pest

P.O. Box 6927

Chico CA 95927

(530) 228-1964 (530) 876-9271

stoneridge0790@sbcglobal.net

Fax (530) 876-9273

Date: 11/27/2022

Report Number: 40492

Invoice Number: 40492-1

Escrow Number:

Property 1289 Palmetto Ave

Inspected: Chico, CA 95926

Bill To: C/O Suzy Mann  
Regency Realty Of Chico  
140 Yellowstone Ct Ste 160  
Chico, CA 95973

suzymann@aol.com

Inspection Fee: \$	210.00
<b>Invoice Total: \$</b>	<b>210.00</b>
Payments: \$	0.00
<b>Total Due: \$</b>	<b>210.00</b>

Description of Service

RETURN THIS COPY WITH REMITTANCE

**THANK YOU FOR YOUR BUSINESS**