

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 3003	Street Crag Ave.	City Oroville	ZIP 95966	Date of Inspection 03/10/2022	Number of Pages 4
----------------------	---------------------	------------------	--------------	----------------------------------	----------------------



HOUSE DETECTIVE TERMITE CONTROL INC
11 COMMERCE CT. SUITE 10
 CHICO CA 95928
 (530) 894-7900 (530) 591-7079
 hdetective@att.net Fax (530) 894-7902

Report # : 14525
 Registration # : PR5960
 Escrow # :
 CORRECTED REPORT

Ordered by: Chris Ingram	Property Owner and/or Party of Interest:	Report sent to:
-----------------------------	--	-----------------


COMPLETE REPORT LIMITED REPORT SUPPLEMENTAL REPORT REINSPECTION REPORT

GENERAL DESCRIPTION: Three story wood frame single family dwelling.	Inspection Tag Posted: Basement
	Other Tags Posted:

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites Drywood Termites Fungus / Dryrot Other Findings Further Inspection
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

Diagram Not To Scale

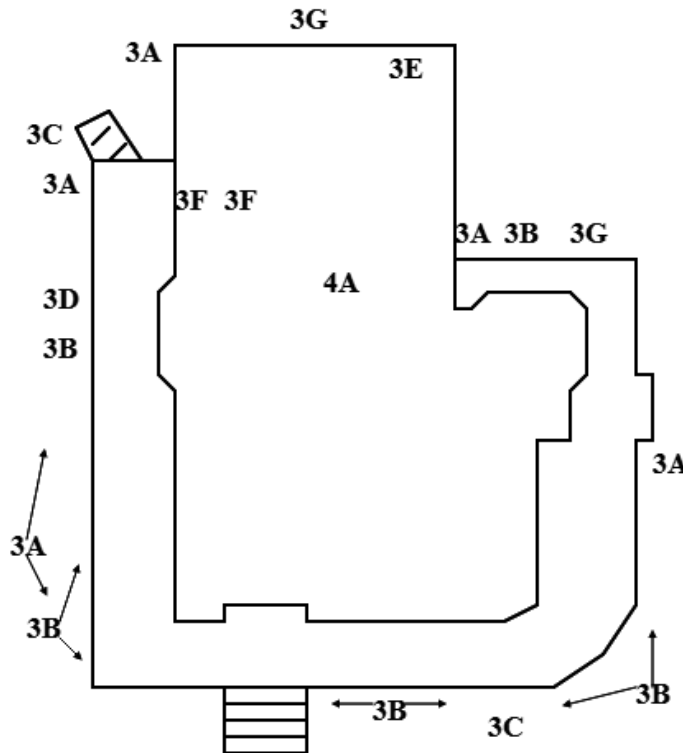

Inspected By: Gregory D Hosler State License No. OPR10012 Signature:

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 04/2015)

HOUSE DETECTIVE TERMITE CONTROL INC

Page 2 of 4 inspection report

3003	Crag Ave.	Oroville	CA	95966
Address of Property Inspected		City	State	ZIP
03/10/2022	14525			
Date of Inspection	Corresponding Report No.		Escrow No.	

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

HOUSE DETECTIVE TERMITE CONTROL INC

Page 3 of 4 inspection report

3003	Crag Ave.	Oroville	CA	95966
Address of Property Inspected		City	State	ZIP
03/10/2022	14525			
Date of Inspection	Corresponding Report No.	Escrow No.		

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestations or infections. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

SECTION III / FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

3. FUNGUS / DRYROT:

3A - Section I

FINDING: Fungus damage was found to wood trim members around the structure,

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3B - Section I

FINDING: Fungus damage was found to ends of decking and deck trim boards on the wood deck.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3C - Section I

FINDING: Fungus damage was found to roof soffit members.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3D - Section I

FINDING: Fungus damage was found to door jambs and door trim.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3E - Section I

FINDING: Fungus damage was found to the basement door.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

3F - Section I

FINDING: Fungus damage was found to floor joist and framing plate.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged

HOUSE DETECTIVE TERMITE CONTROL INC

Page 4 of 4 inspection report

3003	Crag Ave.	Oroville	CA	95966
Address of Property Inspected		City	State	ZIP
03/10/2022	14525			
Date of Inspection	Corresponding Report No.		Escrow No.	

members and to replace with new appropriate material.

3G - Section I

FINDING: Fungus damage was found to wood siding members.

RECOMMENDATION: We recommend the owner/agent engage the services of a licensed contractor to remove all damaged members and to replace with new appropriate material.

4. OTHER FINDINGS:

4A - Section II

FINDING: Water stains were noted in the attic from apparent past roof leaks.

RECOMMENDATION: The owner should employ a licensed roofing contractor to inspect and/or to repair the roof. This firm declines to submit a bid or an estimate for this recommendation.

NOTES:

Note A

Portions of the lower level have limited access due to personal storage.

Note B

This inspection is from ground level only. We do not go on the roof. No opinion to areas which could not be probed from the ground.

3003 Crag Ave.
Address of Property Inspected

Oroville
City

CA
State

95966
ZIP



- Front of the structure.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.




3A - Damaged trim members.



3A - Damaged trim members.



3A - Damaged trim members.

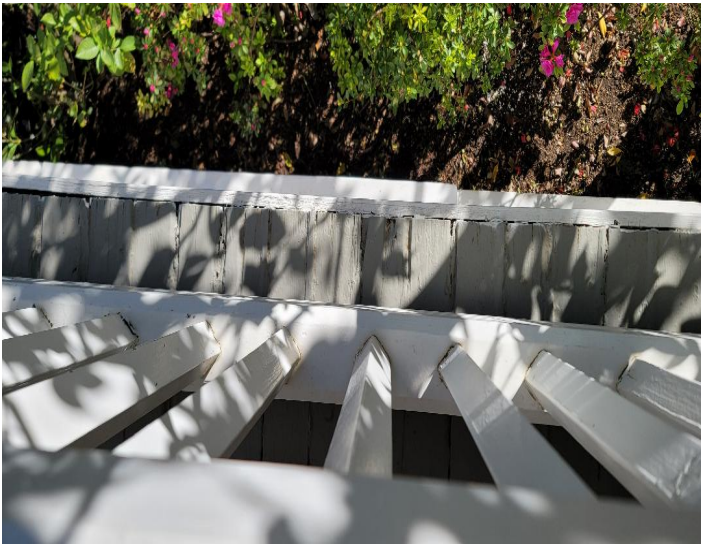

3B - Damaged deck trim.



3B - Damaged decking.



3B - Damaged deck trim.



3B - Damaged deck trim.



3B - Damaged decking.



3C - Damaged roof soffit.



3C - Damaged roof soffit.



3D - Damaged door jambs.



3D - Damaged door jambs.



3D - Damaged door jambs.



3E - Damaged basement door.




3F - Damaged floor joist.



3F - Damaged framing plate.



3G - Damaged siding.

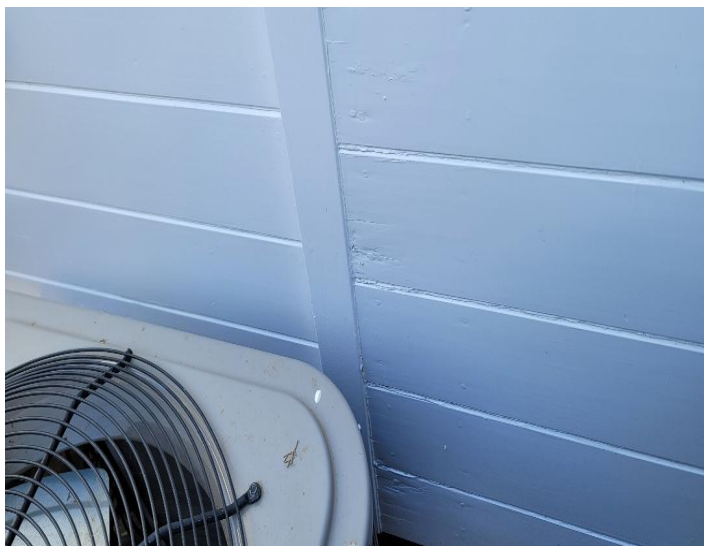

3G - Damaged siding.