## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 836	Street Nord Ave	City Bakersfield	ZIP 93314		of Inspection /07/2025	Number of Pages 6
. 3/T/D D	A .	Silverback	Termite & Pest	Contro	<b>.</b>	+ # . 15010
SILVERA	AC.		P.O. Box 12830	. 0011110	• Repor	rt # : 15213
マ (	પ		cersfield CA 93389		Regist	tration # : PR8011
			6-5641 (661) 340-4	1/01	Escro	w # ·
			• •			
TERMITE & PEST O	ONTROL	ricns	stane@outlook.com	1	⊔со	RRECTED REPORT
Ordered by:		Property Owner ar	nd Party of Interest:		Report sent to:	
Belinda Estrada			,,		Belinda Estrada	
Agent Cor					Agent Cor	
5016 California Ave					5016 California Ave	e
Bakersfield CA 93309					Bakersfield CA 933	309
United States					United States	
COMPLETE REPORT	LIMITED F	REPORT 🔲	SUPPLEMENT	AL REPOR	T REINSF	PECTION REPORT
GENERAL DESCRIPT	TION:				Inspection Tag	Posted:
One story, wood sidi	ng, attached two car	garage, detached	l one car garage, fu	ırnished a	nd Water heater	
occupied residence of	n a concrete slab				Other Tags Po	sted:
An inspection has been	made of the etructure(e)	shown on the diagra	am in accordance with	the Structu	ral Pest Control Ac	t Detached parches
detached steps, detache					iai i est control Ac	i. Detacried porcries,
Subterranean Termites	Drywood Terr	nites 🔀 Fun	gus / Dryrot 🔀	Other F	indings 🔀	Further Inspection
If any of the above boxe	s are checked, it indicat	es that there were vis	sible problems in acce	essible area	s. Read the report f	for details on checked items.
		Diagra	am Not To Scale			
	2B	2A 2B 2B				
	2B 2A 3E	P <sup>2</sup> A				
	2A 2B	' '				
	2A		2C 2A			
	2B \		ZA			
	2A 3A	`	!      ←—	DECK		
	_ 3A_ 3A	3C 3C				
	!	2B 3B 2A	2A			
	;	2A	2C			
	<u>i</u>	2B 4D				
	;	40		ļ		
	<u> </u>		L.			
	; ;	2B 2B 2A 2A	2A           2C		/ 2A	
	:		] ВА     2C ВА 2A	⇒ 2C 2A		
	;	\ 2B	2¢	2C		
	: 1	\	2A			
	40		2C 2A			
2B 2B 2A 2A	4B 4C		ZA ŽĈ			
2B 2A					_	2B 2A 3A
ZA						34
	\					2A
	\					2A
	•					2B 5A
3D 4C						4A
30	2A	3D				.   \ 4A
	2B	i				4A
						4A
					1	715
					Utt	Un Han
Inspected By:	stin T Stane St	ata Licansa No	FR54558	Signature:		12110

Page 2 of 6 inspection	on report					
836	Nord Ave		Bakersfield	CA	93314	
Address of Property	Inspected		City	State	ZIP	
, , ,		15213				
Date of Inspection Corres		Corresponding Re	eport No.		Escrow No.	

# WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

Page 3 of 6 inspection	n report					
836	Nord Ave		Bakersfield	CA	93314	
Address of Property I	nspected		City	State	ZIP	
		15213				
Date of Inspection Corresp		Corresponding Re	port No.		Escrow No.	

# THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

**SECTION I** CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

**SECTION II** ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

**FURTHER INSPECTION** ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(s) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

#### **NOTES:**

#### Note A

Silverback Termite & Pest Control will finish work ready for painting. Painting is not included in our estimate.

#### Note B

Silverback Termite & Pest Control cannot certify the roof nor do we offer any opinion as to its quality.

#### 2. DRYWOOD TERMITES:

#### 2A - Section I

FINDING- Evidence of drywood termite infestation noted at the exterior fascia boards, support beams, wood siding, siding trim, door jambs, interior door casing, form board, exposed interior wall framing and in various areas throughout the deck structure. Infestation appears to extend into inaccessible areas.

RECOMMENDATION - Vacate and seal the main structure, detached garage, and the entire deck structure. Fumigate with the registered fumigant Vikane (Sulfuryl Fluoride). Chloropicrin to be used as the warning agent. Remove the seals and aerate the structure ready for occupancy.

Prior to the fumigation process certain preparations must be made. Please refer to our "Occupants' Fumigation Notice and Instruction Sheet" for specific guidelines. Preparation per these instructions is not the responsibility of Silverback Termite & Pest Control.

The fumigation cannot be done in strong winds or rain and will be rescheduled if there is inclement weather.

The fumigation process requires that work crews walk on the roof. Many roofs are brittle and suffer some damage when walked upon . The Company will not be responsible for damage resulting from walking or working on the roof, or any damage to any of the following items: any roofing surface; radio and television antennas; plants which are clinging or very close to the structure; awnings; gutters; patio covers; solar heating panels; plumbing fixtures; or any other items on, or connected to the roof, including chimneys.

Silverback Termite & Pest Control does not provide on-site security and does not assume any responsibility for the care and custody of the property in the event of vandalism or breaking and entering. Silverback Termite & Pest Control requests that all valuables such as jewelry, coins, collections. cash, art objects and other items of value be removed prior to fumigation.

Your health and safety is our major concern. Please note effects of over-exposure from the fumigants can include the following: shortness of breathy, double vision, unusual drowsiness, and weakness and tremors. If you experience the symptoms as outlined here, leave the structure immediately and call our office.

In the event that the owner /agent cancels the fumigation for any reason, same day or within 24 hours, there will be a

Page 4 of 6 inspection report

r ago i oi o mopoone	711 TOP 011				
836	Nord Ave	Bakersfield	CA	93314	
Address of Property	Inspected	City	State	ZIP	
03/07/2025		15213			
Date of Inspection	Co	rresponding Report No.		Escrow No.	

\$300 cancelation fee.

All foliage and tree branches must be cut back 12 inches minimum away from the structure prior to the fumigation.

All ground cover (rock, mulch, bark) must be racked back a minimum of 18" from the structure to allow the tent to seal to the ground. There will be an additional charge of \$180 if our crew has to complete this.

#### 2B - Section I

FINDING - Drywood termite damage noted at the exterior fascia board, ends of support beams, wood siding, siding trim, door jambs, interior door casing, and the exposed wall framing.

RECOMMENDATION - Remove and replace or reinforce this wood.

#### 2C - Section I

FINDING - Drywood termite damage, & dry rot damage, noted at the exterior deck boards, support beams, joists, and stair stringers. **Damage extends into inaccessible areas.** 

RECOMMENDATION - Remove deck boards, treads, and skirting in various areas throughout the structure to make area accessible for inspection.

A Supplemental inspection will be made and Report issued outlining our findings, recommendations and any additional costs.

Reinstalling, and/or replacing of deck boards will be included in the supplemental report. Silverback Termite & Pest Control will not be responsible for damage that may occur during the course of opening up deck structure.

Refer to recommendation item 2A in regards to the fumigation.

#### 3. FUNGUS / DRYROT:

#### 3A - Section I

FINDING - Fungus infection and damage noted at the exterior fascia boards, rafter tails, and roof sheathing. Moisture appears to be caused by seasonal conditions.

RECOMMENDATION - Remove and replace or reinforce this wood.

Treat area with the registered material Timbor, as necessary.

#### 3B - Section I

FINDING - Fungus infection and damage noted at the exterior wood siding & siding trim. Moisture appears to be caused by seasonal conditions.

RECOMMENDATION - Remove and replace or reinforce this wood.

Treat area with the registered material Timbor, as necessary.

#### 3C - Section I

FINDING - Fungus infection and damage noted at the pedestrian garage door jamb. Moisture appears to be caused by seasonal conditions.

RECOMMENDATION - Remove and replace or reinforce this wood.

Treat area with the registered material Timbor, as necessary.

#### 3D - Section I

FINDING - Fungus infection and damage noted at the ends of the exterior support beams. Moisture appears to be caused by seasonal conditions.

RECOMMENDATION - Remove and replace or reinforce this wood.

Treat area with the registered material Timbor, as necessary.

Page 5 of 6 inspection report

r ago o or o mopoone	n repen				
836	Nord Ave	Bakersfield	CA	93314	
Address of Property	Inspected	City	State	ZIP	
03/07/2025 15213		15213			
Date of Inspection	Corre	sponding Report No.		Escrow No.	

#### 4. OTHER FINDINGS:

#### 4A - Section II

FINDING - Faulty grade level and earth-wood contact noted at the base of the garage siding.

RECOMMENDATION - Lower the soil to a proper grade level.

#### 4B - Section II

FINDING - The guest bathroom stall shower was tested and leak noted at the shower pan.

RECOMMENDATION - Remove tile from shower floor and base of walls. Install new water-proof pan and re-tile with blending colors.

If damage is found in framing after removal of tile, or plumbing requiring repair is disclosed, a Supplemental Inspection will be made and a report issued outlining our findings, recommendations and any additional cost.

#### 4C - Section II

FINDING - Toilet at all three bathrooms noted to be loose.

RECOMMENDATION - Remove toilets. Install new seals and reset toilets.

#### 4D - Section II

FINDING - Plumbing leak noted at the kitchen sink.

RECOMMENDATION - Owner to consult a proper tradesman to make necessary repairs.

#### NOTES:

#### Note C

Due to the age of the structure, replacement material may not be available in the same dimension or quality and substitute material may be used.

#### Note D

If damage extends into inaccessible areas, a Supplemental Inspection will be made and Report issued outlining our findings, recommendations and any additional costs.

#### Note E

Silverback Termite & Pest Control guarantees we have eliminated drywood termites within the space fumigated for a period of Two years from the date of completion.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

**CAUTION - PESTICIDES ARE TOXIC CHEMICALS.** Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

Page 6 of 6 inspection r	eport					
836	Nord Ave		Bakersfield	CA	93314	
Address of Property Ins	pected		City	State	ZIP	
03/07/2025		15213				
Date of Inspection Cor		Corresponding Re	port No.		Escrow No.	

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center (800) 222-1222
Agricultural Department (661) 868-6300
Health Department (661) 868-0300
Structural Pest Control Board (916) 561-8700

2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815

# SILVERBACY

Owner's Agent:

## **Silverback Termite & Pest Control**

P.O. Box 12830 Bakersfield CA 93389 (661) 836-5641 (661) 340-4481 richstane@outlook.com

# **WORK AUTHORIZATION**

Report #: 15213

No work will be performe	ed until a signed copy of this	agreement has been received	d.	
Address of Property:	836 Nord Ave			
City:	Bakersfield			
The company is authorized to \$ This total amount To guarantee all repair complininety (90) days. We assum	s due and payable within 30 days eted by this company for one year e no responsibility for work perform reasonable care in the performan	the items circled below from the T from completion repair work and/o THE COMPANY AGREES from date of completion except for ned by others, to be bound to per	Termite Inspection Report for the prope	ch is guaranteed for a period of ur cost breakdown for a period
	THE	OWNER OR OWNER'S AGENT	AGREES	
month, or portion of any mont Company a security interest i	in any additional services reques h, annual interest rate of eighteen	ted upon completion of work to pa percent (18%) on accounts excee sum for work and inspection fee co	ay a service charge of one and one-hading the ten (10) day full payment scheompleted. In case of non-payment by T	edule. The Owner grants to The
		ALL PARTIES AGREE		
•		•	pe performed without additional autho e items you wish performed by The Co	
other person who helps to im after a court hearing, your propaid your structural pest contraction. To preserve their right to file document entitled "Prelimina	prove your property, but is not pa operty could be sold by a court of ol company in full if the subcontra- a claim or lien against your prope	id for his or her work or supplies, ficer and the proceeds of the sale ctor, laborers or suppliers remain userty, certain claimants such as sulaborers for wages do not have the	bcontractors or material suppliers are to provide this notice. A Preliminary N	your property. This means that is can happen even if you have required to provide you with a
		ITEMS		
Prefix	Section I	Section II	Further Inspection	Other
2A	2,615.00	0.00	0.00	0.00
2B	1,895.00	0.00	0.00	0.00
2C	400.00	0.00	0.00	0.00
3A	1,450.00	0.00	0.00	0.00
3B	See 3A.	0.00	0.00	0.00
3C	See 3A.	0.00	0.00	0.00
3D	See 3A.	0.00	0.00	0.00
4A	0.00	Other Trade	0.00	0.00
4B	0.00	Other Trade	0.00	0.00
4C	0.00	Other Trade	0.00	0.00
4D	0.00	Other Trade	0.00	0.00
Total:	6,360.00	0.00	0.00	0.00
GRAND TOTAL:	6,360.00			
Property Owner:		Date: Inspec	cted By:	Date:

Date: