

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>705</b>	Street <b>DEWANE DR</b>	City <b>EL CAJON</b>	Zip <b>92020</b>	Date of Inspection <b>03/31/23</b>	Number of Pages <b>1 of 6</b>
----------------------------	----------------------------	-------------------------	---------------------	---------------------------------------	----------------------------------



**Precision Termite & Carpentry**  
 PO Box 762  
 Lemon Grove, CA 91946  
 Phone: 619-403-8223 Email: precision@precisiontermite.net



**Registration # PR8412**

**Report # 10070**

Ordered by: <b>EXP REALTY</b> <b>JENNIFER ST. CLAIR</b> <b>5530 LA JOLLA BLVD</b> <b>LA JOLLA, CA 92037</b> jennifer@homesbystclair.com W: 858-405-8525	Property Owner and/or Party of Interest: <b>ROBYN TOMS</b> <b>705 DEWANE DR</b> <b>EL CAJON, CA 92020</b> H: 619-438-1458	Report sent to: <b>EXP REALTY</b> <b>JENNIFER ST. CLAIR</b> <b>5530 LA JOLLA BLVD</b> <b>LA JOLLA, CA 92037</b> jennifer@homesbystclair.com W: 858-405-8525
---	---	---

COMPLETE REPORT 
 LIMITED REPORT 
 SUPPLEMENTAL REPORT 
 REINSPECTION REPORT


General Description: <b>One story occupied home, slab foundation, tile roof, attached garage and patio</b>	Inspection Tag Posted: <b>Garage</b> Other Tags Posted:
---	---

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites 
 Drywood Termites 
 Fungus / Dryrot 
 Other Findings 
 Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

DIAGRAM NOT TO SCALE

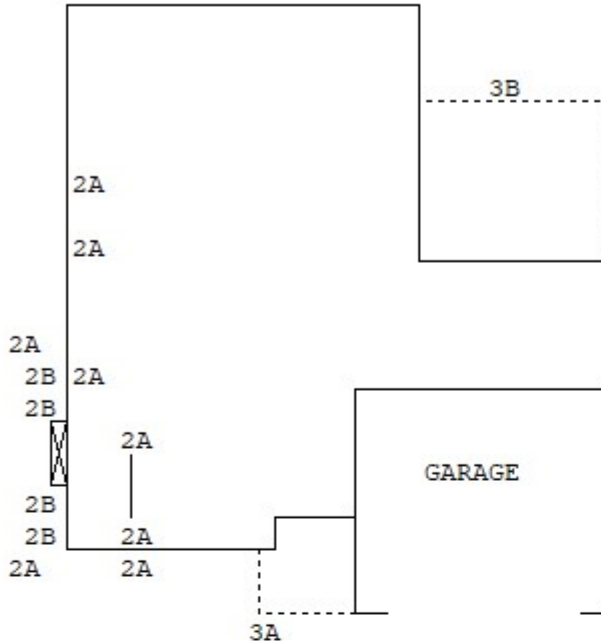

FRONT

Inspected by: Eric Thompson State License No. OPR11568 Signature Eric Thompson  
 You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815.  
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov).

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 705	Street DEWANE DR	City EL CAJON	Zip 92020	Date of Inspection 03/31/23	Report # 10070	Page 2 of 6
---------------------	---------------------	------------------	--------------	--------------------------------	-------------------	----------------

**THIS IS A SEPERATED REPORT WHICH ID DEFINED AS SECTION 1 AND SECTION 2 CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.**

**SECTION 1 CONTAINS ITEMS WHERE THERE IS VISABLE EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OF INFECTION.**

**SECTION 2 ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.**

**FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.**

## **SECTION I:**

### **(2) DRYWOOD TERMITES**

2A.

**FINDING:** Evidence of drywood termites noted in ATTIC AND EAVES marked 2A on diagram.

**RECOMMENDATION:** Vacate the entire structure and fumigate with Vikane(Sulfuryl Fluoride)for the elimination of drywood termites. Chloropicrin(tear gas) will be used as the warning agent. Remove or mask termite evidence in accessible areas. In most cases the property will be required to be vacated for two nights and then cleared on the third day. An Occupants Fumigation Notice, provided by Precision Termite, will need to be signed prior to the fumigation.

**NOTE:** It is the responsibility of the owner to make sure all plants are cut back a minimum of 12" inches around the structure.

**NOTE:** Precision Termite will schedule with SDG&E to have the gas TURNED OFF. It is the OWNER'S RESPONSIBILITY to schedule with SDG&E to have the gas TURNED BACK ON. Please make arrangements with SDG&E a head of time to assure the gas is restored on time.

**NOTE:** It is imperative that the ELECTRICITY IS ON during the fumigation process. If the electriciy is off when the fumigation crew arrives, then the fumigation will be rescheduled.

**NOTE:TILE INSURANCE: A tile insurance is included in the fumigation estimate. This insurance only covers the REPAIR and NOT REPLACEMENT of any roof tiles that are damaged during the fumigation process. If a roof tile is damaged, then the damaged tile will be repaired by GLUING it back together only. Damaged roof tiles will not be replaced. We recommend that the owner or an individual representing the owner be present at the job sight on the day of the fumigation to verify the tile count(the number of damaged tiles counted prior to performing the fumigation).**

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>705</b>	Street <b>DEWANE DR</b>	City <b>EL CAJON</b>	Zip <b>92020</b>	Date of Inspection <b>03/31/23</b>	Report # <b>10070</b>	Page <b>3 of 6</b>
----------------------------	----------------------------	-------------------------	---------------------	---------------------------------------	--------------------------	-----------------------

### **(2) DRYWOOD TERMITES**

2B.

FINDING: Superficial drywood termite damage noted in EAVE BLOCKING AND FASCIA BOARD marked 2B on diagram.

RECOMMENDATION: Repair damage as deemed necessary with a wood filler. Estimate includes painting. No guarantee on matching paint color.

### **(3) FUNGUS/DRYROT**

3A.

FINDING: Fungus damaged wood noted in BEAM END marked 3A on diagram.

RECOMMENDATION: Cut off and remove approximately 4" inche(s) of the end of the beam to remove damaged material. After damaged material has been removed; repair exposed surface with a wood filler, if necessary. Painting is included in the estimate. No guarantee on matching the paint color.

3B.

FINDING: Fungus damaged wood noted in BOTTOM OF PATIO POST marked 3B on diagram. Damage appears to be minor.

RECOMMENDATION: Remove fungus damaged material, treat area with a fungicide and repair as deemed necessary. Painting is included in the estimate. There is no paint match guarantee.

### **SECTION II:**

#### **(4) OTHER FINDINGS**

4A.

FINDING: Weathering noted at PEDESTRIAN GARAGE DOOR due to outdoor elements. No fungus noted at time of inspection.

RECOMMENDATION: Repair DOOR as deemed necessary.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 705	Street DEWANE DR	City EL CAJON	Zip 92020	Date of Inspection 03/31/23	Report # 10070	Page 4 of 6
---------------------	---------------------	------------------	--------------	--------------------------------	-------------------	----------------

**WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.**

THIS IS NOT A STRUCTURAL DAMAGE REPORT or a BUILDING INSPECTION REPORT. No opinion is being rendered regarding the structural integrity of the building. A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests or organisms and adverse conditions which lead to the same in VISIBLE AND ACCESSIBLE AREAS on the date of the inspection. The report will also contain our recommendations for correcting any infestations or adverse conditions found. The contents of Wood Destroying Pest & Organism Reports are governed by the Structural Pest Control Act and their rules and regulations. Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report DOES NOT contain information on such defects, if any, as they are not within the scope of the licenses of either this company or its employees.

The Structural Pest Control Act requires inspection of only areas which are VISIBLE and ACCESSIBLE at the time of inspection. Some areas of the structure are recognized by the industry as inaccessible and/or for other reasons NOT inspected. These areas include but are not limited to: Inaccessible and/or insulated attics or portions thereof; attics with less than 18" clear crawl space; subareas where there is less than 12 inches of clear space between the bottom of the floor joists or girders and the unimproved ground area; the interior of hollow walls; spaces between a floor or porch deck and the ceiling or soffit below; Stall showers over finished ceilings; Such structural segments as porte cocheres, enclosed bay windows, buttresses and similar areas to which there is no access without defacing or tearing out lumber, masonry or finished work; areas concealed by carpeting, furniture, built-in appliances or cabinet work; floors beneath coverings; areas where storage conditions or locks make inspection impracticable; areas beneath wood floors over concrete; second story eaves or patio covers that would require the use of an extension ladder; areas concealed by heavy vegetation.

NOTICE: Floor coverings, furniture, appliances and storage items are not moved during the inspection and windows are not opened. Infestations or infections may be present in these areas without visible and accessible evidence. Precision Termite will recommend further inspection if there is any question about the above noted areas.

NOTICE: No present or future guarantees, implied or expressed, regarding any infestation or infection or adverse condition which may exist in these inaccessible areas and/or become evident at a later date.

NOTICE: This company will reinspect work done by others within four months of the original inspection. Upon request, the reinspection shall be performed within (10)working days. A charge, if any, can be no greater than the original inspection fee for each inspection. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary.

NOTICE: Precision Termite does NOT guarantee work done by others, recommended or not. Any guarantees must be received from parties performing repairs.

**THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A LICENSED ROOFING CONTRACTOR.**

NOTICE: The second story eaves are inaccessible at the time of the inspection due to the heights of the structure and are only inspected from the ground level. No opinion can be given as to the conditions in these areas.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>705</b>	Street <b>DEWANE DR</b>	City <b>EL CAJON</b>	Zip <b>92020</b>	Date of Inspection <b>03/31/23</b>	Report # <b>10070</b>	Page <b>5 of 6</b>
----------------------------	----------------------------	-------------------------	---------------------	---------------------------------------	--------------------------	-----------------------

NOTICE: Second story stall showers are inspected but are not water tested. If water stains are evident on the ceiling, recommendations shall be made for further inspection and testing. Ref: Structural Pest Control Rules and Regulations, Sec.8516G. Sunken or below grade showers are not tested due to their construction.

NOTICE: If further damage and/or infestation is found during the course of repairs in previously concealed areas, a supplemental report will be issued with further findings, recommendations and costs, if any.

NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Precision Termite's bid or you may contract directly with another registered company. This company will not be responsible for any act or omission in the performance of work that you directly contract with another company to perform.

**The Structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure are prepared by various registered companies and should list the same findings. However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.**

NOTICE: Molds, sometimes called mildew, are NOT wood destroying organisms. Branch 3 licensees (Termite Inspectors) do not have a duty under the Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. Our company does not take any responsibility for mold issues. Interested parties desiring more information should contact an appropriate mold professional or industrial hygienist.

NOTICE: This inspection will not include the presence or non-presence of asbestos. This company will not include any findings or render any opinions regarding the presence or non-presence of asbestos in, upon or about the premises.

NOTICE: Newly painted surfaces or repairs in some instances can conceal evidence of damage. This company does not assume any responsibility for hidden defects if a structure has recently been painted or any repair work has been done deliberately or inadvertently that conceals adverse conditions or infections.

GUARANTEE INFORMATION: Unless otherwise stated in this report or on the work authorization contract, we provide the following guarantees on completed work:

- Fumigation: 2 years
- Thermal Heat Treatment: 1 year
- Subterranean Termites: 2 years in areas treated only
- Drywood Termite Local Treatment: 1 year in area treated only
- Repairs: 1 year
- Caulking, grout and sealing of toilets: 90 days

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>705</b>	Street <b>DEWANE DR</b>	City <b>EL CAJON</b>	Zip <b>92020</b>	Date of Inspection <b>03/31/23</b>	Report # <b>10070</b>	Page <b>6 of 6</b>
----------------------------	----------------------------	-------------------------	---------------------	---------------------------------------	--------------------------	-----------------------

## OCCUPANTS CHEMICAL NOTICE

Precision Termite may use one or more of the following chemical(s) for the control of wood destroying pests or organisms in locations identified in the Structural Pest Control report as indicated above.

VIKANE(Sulfuryl Fluoride), CHLOROPICRIN(Tear Gas), TIMBOR(Sodium Borates 98%)  
TERMIDOR SC(Fipronil), EVERCIDE(Esfenvalerate), PREMISE 75(Imidacloprid)

"State law requires that you be given the following information: CAUTION, PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, headache, dizziness, nausea, tearing, coughing, nose and throat irritation, or develop shortness of breath, double vision, unusual drowsiness and weakness, or tremors, contact your physician or poison control center and your pest control company immediately.

FOR FURTHER INFORMATION CONTACT ANY ONE OF THE FOLLOWING:

PRECISION TERMITE    HEALTH DEPT.    AGRICULTURE DEPT.    POISON CONTROL  
(858)442-2764            (619)338-2222            (858)694-2739            (800)876-4766

\*\*\*STRUCTURAL PEST CONTROL BOARD\*\*\*

2005 EVERGREEN STREET STE, 1500 SACRAMENTO CA 95815 (916)561-8704

Persons with respiratory or allergic conditions, or others who may be concerned about their health relative to this chemical treatment should contact their physician concerning occupancy during and after chemical treatment.

## **THE CALIFORNIA MECHANICS LIEN LAW**

To the owner under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can even happen even if you have paid your structural pest control company in full if the subcontractor, laborers, or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A preliminary notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.