



Dear HomeGuard Customer,

Thank You for choosing HomeGuard Incorporated to inspect your home. Enclosed is your inspection report, which includes our findings, recommendations, and repair prices. Please review the enclosed report and repair proposals and feel free to call me with any comments or questions.

Sincerely Yours,

Curtis Reese  
Vice President  
General Manager

## **Schedule your repairs today...**



**We get the work done  
when you need it!**




**We will expedite all  
required paperwork!**



**HomeGuard stands  
behind its repairs!**

**Contact the HomeGuard Repair Team at 855-331-1900 or  
email us [HGRepairs@HomeGuard.com](mailto:HGRepairs@HomeGuard.com)**

## WOOD DESTROYING PESTS AND ORGANISM INSPECTION REPORT

Building No. <b>1177</b>	Street <b>Muirlands Vista Way</b>	City <b>La Jolla</b>	ZIP <b>92037</b>	Date of Inspection <b>10/8/2025</b>	Number of Pages <b>Page 1 of 10</b>
 <b>125 Business Center Drive, Suite G Corona, CA, 92880 (855) 331-1900 • Fax (925) 294-1818</b>					
Registration #: <b>PR1452</b>		HomeGuard #: <b>665525</b>		Escrow #:	
Ordered By: <b>Romina Spinelli Berkshire Hathaway 1299 Prospect Street #218 La Jolla, CA 92037</b>		Property Owner/Party in Interest: <b>Romina Spinelli Berkshire Hathaway 1299 Prospect Street #218 La Jolla, CA 92037</b>		Report Sent to:	
COMPLETE REPORT <input checked="" type="checkbox"/> LIMITED REPORT <input type="checkbox"/> SUPPLEMENTAL REPORT <input type="checkbox"/> REINSPECTION REPORT <input type="checkbox"/>					
General Description: <b>This is a one story single family dwelling with wood, stucco and brick exterior.</b>				Inspection Tag Posted: <b>Garage</b>	
				Other Tags Posted: <b>None noted</b>	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites <input type="checkbox"/> Drywood Termites <input checked="" type="checkbox"/> Fungus / DryRot <input checked="" type="checkbox"/> Other Findings <input checked="" type="checkbox"/> Further Inspection <input checked="" type="checkbox"/> If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					
Key to Items on diagram: [1] Section 1 Items [2] Section 2 Items [3] Unknown Further Inspection Items					

**SEE DIAGRAM ON PAGE  
2 OF THIS REPORT**

Inspected by: **Bryan Torices**

License#: **FR59988**

Signature: 

You are entitled to obtain copies of all reports and completion notices on this property filed with the board during the preceeding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916)561-8700, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov).



Building No.	Street	City	ZIP	Date of Inspection	Number of Pages
1177	Muirlands Vista Way	La Jolla	92037	10/8/2025	Page 3 of 10

### **AREAS NOT INSPECTED PLEASE READ**

This report is an inspection for wood destroying pests and organisms to a furnished, occupied structure. Some areas of the structure were inaccessible for inspection due to furnishings, appliances, floor covering, and/or stored personal property. We did not inspect areas immediately under furnishings or appliances, nor did we inspect inside finished walls or ceilings. Our inspection does not include any electrical, heating, air conditioning, structural adequacy, pest other than wood destroying pest or mechanical systems of the structure and will not detect building code violations. The plumbing was inspected and only the leaks outlined in our report were found at this time. However, we assume no responsibility for leaks that occur after the date of this inspection. There may be health related issues associated with the findings reflected in this report. We are not qualified to and do not render an opinion concerning any such health issues. The inspection report was limited to the visible and accessible areas only. Questions concerning health related issues, which may be associated with the findings or recommendations reflected in this report, the presence of mold, the release of mold spores or concerning indoor air quality should be directed to a Certified Industrial Hygienist. The subfloor is insulated below the structure. There is no evidence of any infestation in this area however, insulation could conceal infestations or infections. We assume no responsibility for any infestations or infections concealed by this insulation. The area inside the soffited eaves was not inspected. The inaccessible areas listed above which were not inspected will be inspected upon the owner's request and will be conditional to additional inspection fees.

**WE GUARANTEE ALL REPAIRS DONE BY THIS COMPANY FOR ONE (1) YEAR DRYWOOD FUMIGATIONS FOR A PERIOD OF THREE (3) YEARS AND BEETLE FUMES FOR A PERIOD OF ONE(1) YEAR FROM THE DATE OF COMPLETION WITH THE EXCEPTION OF PLUMBING, GROUTING, CAULKING, RAIN GUTTERS AND RE-SETTING OF TOILETS WHICH ARE GUARANTEED FOR 30 DAYS FROM THE DATE OF COMPLETION. WE CANNOT GUARANTEE WORK PERFORMED BY OTHERS. WE MAKE NO GUARANTEE AGAINST FUTURE INFECTIONS, ADVERSE CONDITIONS, OR CONDITIONS PRESENT BUT NOT EVIDENT AT THE TIME OF OUR INSPECTION.**

**THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS STATE LICENSE BOARD.**

**NOTICE:** Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may differ from company to company. You have the right to seek a second opinion from another company.

"This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work while in progress will be necessary. Any guarantees must be received from parties performing repairs." Work performed by others will be reinspected for a fee of \$75.00 for each trip out to the property. Open wall and open floor inspections are desirable if certification is required.

Building No. <b>1177</b>	Street <b>Muirlands Vista Way</b>	City <b>La Jolla</b>	ZIP <b>92037</b>	Date of Inspection <b>10/8/2025</b>	Number of Pages <b>Page 4 of 10</b>
-----------------------------	--------------------------------------	-------------------------	---------------------	--	--

**THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I AND SECTION II CONDITIONS EVIDENT ON THE DATE OF INSPECTION. SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION, OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR SECTION II.**

### **Section 1 Items**

- 1A.** FINDING: The fascia has been damaged by drywood termites and fungus where indicated on the diagram. The contributing moisture source appears to have been caused by a failure of the roof covering and/or exposure to weather. (See Photo 1) (See Photo 2) (See Photo 3)

RECOMMENDATION: Remove and replace the damaged fascia to correct this condition. This bid *Estimated Cost* includes repair of the roof covering if disturbed by our repairs. If existing gutters need to be removed to perform the repairs then our bid also includes reinstallation of original gutters. If it becomes necessary or desirable to install new gutters this will be done only if authorized and at an additional cost. The guarantees on the roof covering are limited to the areas where the repairs were performed.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

- 1B.** FINDING: The fascia and post has been damaged by drywood termites and fungus at the rear of the structure and carport. This damage appears to be minor. The contributing moisture source appears to be exposure to the weather. (See Photo 4) (See Photo 9)

RECOMMENDATION: Hollow out this area and fill the void with an appropriate wood filler.

*Estimated Cost*

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

- 1C.** FINDING: The roof sheathing has been damaged by fungus at the rear of the structure. The contributing moisture source appears to have been caused by a failure of the roof covering. (See Photo 5)

RECOMMENDATION: Remove and replace the damaged sheathing to correct this condition. This bid *Estimated Cost* includes repair of the roof covering if disturbed by our repairs. If existing gutters need to be removed to perform the repairs then our bid also includes reinstallation of original gutters. If it becomes necessary or desirable to install new gutters this will be done only if authorized and at an additional expense. The guarantees on the roof covering are limited to the areas where the repairs were performed.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

- 1D.** FINDING: The beams and fascia have been damaged by fungus at the rear overhang adjacent to the carport. The contributing moisture source appears to be exposure to the weather. (See Photo 6) (See Photo 7) (See Photo 8)

RECOMMENDATION: Remove and replace the damaged wood members. If damage is found to extend *Estimated Cost* into inaccessible areas, a supplemental report will be issued with any findings, recommendations, and/or bids.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

NOTE: This bid includes any necessary stucco repair to the area adjacent to the beams if disturbed during the course of our repairs to the wood members.

Building No. <b>1177</b>	Street <b>Muirlands Vista Way</b>	City <b>La Jolla</b>	ZIP <b>92037</b>	Date of Inspection <b>10/8/2025</b>	Number of Pages <b>Page 5 of 10</b>
-----------------------------	--------------------------------------	-------------------------	---------------------	--	--

- 1E.** FINDING: The brick molding has been damaged by fungus at the garage man door and shower room door. The contributing moisture source appears to be exposure to the weather. (See Photo 10)

RECOMMENDATION: Remove and replace all the damaged wood members. If any damage is found to  
*Estimated Cost* extend into any enclosed areas a supplemental report and bid will be issued.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

- 1F.** FINDING: Infestation by Drywood Termites was noted at the fascia throughout the exterior and attic. (See Photo 1) (See Photo 4) (See Photo 11)

RECOMMENDATION: Due to the nature of these infestations, it will be necessary to seal the entire  
*Estimated Cost* structure and fumigate it with Vikane (sulfuryl fluoride), using Chloropicrin as a warning agent. The entire structure must be vacant for this process. It is the owners responsibility to make any preparations required by the fumigators or to have someone to do so at a separate expense and to have the gas turned back on when the fumigation is complete. "NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept HomeGuard Incorporated's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, HomeGuard Incorporated will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform." HomeGuard Incorporated guarantees all fumigations for a period of three years from the date of completion.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

- 1G.** FINDING: Drywood termite pellets were evident as noted in the above recommendation. (See Photo 1) (See Photo 4) (See Photo 11)

RECOMMENDATION: Remove and/or mask over all accessible termite pellets. It is possible for the  
*Estimated Cost* drywood termite pellets to sift down or reappear in these areas where they have been masked over.

\*\*\*\*\* (SECTION 1 ITEM) \*\*\*\*\*

## **Section 2 Items**

- 2A.** FINDING: The support post at the rear overhang adjacent to the carport was found to be in earth to wood contact.

RECOMMENDATION: Cut off the base of this post and install a concrete base to correct this condition.  
*Estimated Cost*

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

- 2B.** FINDING: Minor water damage was noted to the sheetrock at garage shower room.

RECOMMENDATION: Scrape out damage and fill this area. HomeGuard will apply one coat of primer  
*Estimated Cost* paint to the repaired area.

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

- 2C.** FINDING: Some of the grout is loose or missing around the ceramic tile at the garage shower room shower stall and curb, and cracked tiles were noted.

RECOMMENDATION: Reseal the area in the most practical way. Owner to maintain in a water tight  
*Estimated Cost* condition.

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

Building No.	Street	City	ZIP	Date of Inspection	Number of Pages
1177	Muirlands Vista Way	La Jolla	92037	10/8/2025	Page 6 of 10

**2D.** FINDING: There is cellulose debris in earth contact in the substructure area. (See Photo 12)  
(See Photo 13) (See Photo 14)

RECOMMENDATION: Remove cellulose debris of a size that can be raked from the substructure area.

*Estimated Cost*

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

**2E.** FINDING: There is earth contact in the substructure area at the wood blocking under the ducting. (See Photo 15)

RECOMMENDATION: Remove the wood blocking and strap the ducting in place as needed.

*Estimated Cost*

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

**2F.** FINDING: There is one wooden support post under the structure in contact with the earth.  
(See Photo 16)

RECOMMENDATION: Cut off the bottom of the post and install a raised concrete base under it.

*Estimated Cost*

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

**2G.** FINDING: There is a plumbing leak at the drains under the master and hall bathroom in the subarea.

RECOMMENDATION: The owner should have a licensed plumber repair the leakage. All guarantees desired should be secured from the persons or firm that performed the repairs.

*Estimated Cost*

\*\*\*\*\* (SECTION 2 ITEM) \*\*\*\*\*

### **Further Inspection Items**

**3A.** FINDING: The storage room was locked and inaccessible for inspection. (See Photo 17)

RECOMMENDATION: The owner is to provide access to the storage room for further inspection. Upon further inspection, a supplemental report will be issued listing all findings, recommendations and bids.

*Estimated Cost*

\*\*\*\*\* (FURTHER INSPECTION ITEM) \*\*\*\*\*

NOTE: Please be aware that current law dictates that homes constructed prior to 1978 require a company performing the repairs be a Lead Certified Renovation Firm with Certified Renovators. HomeGuard Incorporated is a Lead Certified Renovation Firm, certification number NAT-64235-2 and when required will follow all lead safe work practices as prescribed by the United States Environmental Protection Agency.

NOTE: In our opinion, item(s) listed in this report may require a building permit. If it becomes necessary to install smoke detectors and/or carbon monoxide detectors, this will be performed and charged at \$150.00 per detector. Should the local building department require additional changes or repairs not outlined in this report, there will be an additional charge.

NOTE: HomeGuard Incorporated assumes no liability for, nor do we guarantee work performed by others. All guarantees, warranties, and permits if required should be obtained from the parties performing the repairs.

NOTE: If any of the wood repairs outlined in the above report are done by others, an open inspection must be performed by this company if a certification is desired.

Building No.	Street	City	ZIP	Date of Inspection	Number of Pages
<b>1177</b>	<b>Muirlands Vista Way</b>	<b>La Jolla</b>	<b>92037</b>	<b>10/8/2025</b>	<b>Page 7 of 10</b>

NOTE: If damage is found to extend into any inaccessible areas a supplemental report will be issued listing additional findings, recommendations and bids.

NOTE: Unless stated otherwise, HomeGuard Incorporated bids include texturing and priming repaired areas. We will cover repaired sheetrock and wood with one coat of primer for the contracted amount. The repaired area can be painted in a finished color at an additional charge if the owner supplies the paint. Please inquire about this service when scheduling the work. Any texturing will vary from the original texture however we will match as close as possible. All painting will be on the area repaired only. On exterior surfaces texturing and painting will only be done when the weather permits.

NOTE: Due to the building materials used on this structure, it may be difficult to match the existing mill patterns and materials used in the original construction. HomeGuard Incorporated will replace damaged wood members with material that resembles the existing wood members with standard grade readily available wood members. IF MATCHING THE EXISTING WOOD MEMBERS IS DESIRED IT IS THE OWNERS RESPONSIBILITY TO NOTIFY HOMEGUARD INCORPORATED SO THAT ADDITIONAL COST ASSOCIATED WITH MATCHING CAN BE CALCULATED INTO OUR BID.

NOTE: The attic was insulated; therefore, our inspection is limited to the visible and accessible wood members only.

NOTE: Should the further inspection items noted in this report not be performed, HomeGuard Incorporated will assume no liability for any infestations or infection which may be concealed in these areas.

NOTE: Thank you for choosing HomeGuard Incorporated to perform your inspections. If you have any questions regarding this report, please e-mail [btorices@homeguard.com](mailto:btorices@homeguard.com).



Building No. <b>1177</b>	Street <b>Muirlands Vista Way</b>	City <b>La Jolla</b>	ZIP <b>92037</b>	Date of Inspection <b>10/8/2025</b>	Number of Pages <b>Page 8 of 10</b>
-----------------------------	--------------------------------------	-------------------------	---------------------	--	--

## Report Pictures:

Pictures are provided to assist in clarifying some of the findings made in this report. No relative importance should be placed on these pictures. There are likely to be significant comments that do not have pictures associated with them. The pictures in this report do not illustrate all of the damage associated with a particular item. Please read the report thoroughly and contact the inspector if you have any specific questions.



*Photo 01*




*Photo 02*



*Photo 03*



*Photo 04*

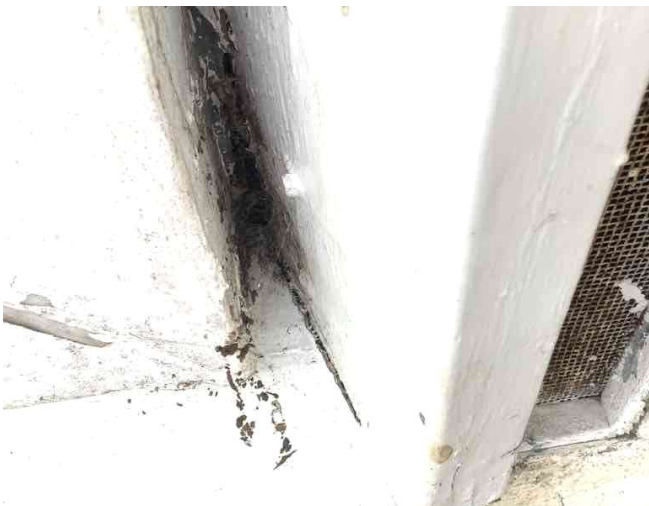

*Photo 05*



*Photo 06*





Photo 07



Photo 08



Photo 09



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



---

# Fact Sheet for Vikane\* (Sulfuryl Fluoride)

---

In the interest of Dow AgroScience's commitment to product stewardship, this fact sheet is intended to provide basic information about the product and how it is used. If you have specific questions about your fumigation, refer to documents provided by the fumigator or call the fumigator listed on the warning signs posted on your structure. If you have questions about Vikane gas fumigant (the fumigant used) or the procedures described, call the Dow AgroSciences Customer Information Center at 1-800-352-6776.

## **WHY BUILDINGS ARE FUMIGATED**

Insects that feed or tunnel into wood can seriously damage houses, apartments, and other dwellings or structures. Each year termites or other wood destroying insects damage more than 5 million homes. Other pests, such as bed bugs, may be dispersed throughout rooms and can be difficult to locate and control quickly and completely. Depending on the extent or location of the infestation, fumigation is the only total control method proven to eliminate certain infestations of wood destroying insects, bed bugs, and other structure-infesting pests.

## **HOW BUILDINGS ARE FUMIGATED**

Because Vikane is a gas, prior to fumigation the structure is completely sealed. This serves to contain Vikane in the building so it can penetrate wood and building contents to thoroughly eliminate the pests. Depending on the construction of the building, the doors and windows may be sealed with tape and a plastic sheet, or the structure may be covered with a tarp. The building will remain sealed for 2 to 72 hours depending on the specifics of the job. Warning signs are posted around the building notifying people to keep out.

After the fumigation period is completed, a professional fumigator will aerate the structure using fans for a prescribed aeration period. Once the dwelling has been thoroughly aerated, the fumigator is required to measure the level of any fumigant remaining in the living space to ensure it is below the EPA approved concentration for re-entry by the occupants. Extremely low levels of fumigant can remain for a short period of time in dead air spaces between walls and inside cabinets as well as porous materials such as furniture. The small amount of fumigant in these areas will continue to dissipate for a few hours after the fumigation but at levels well below the established safe re-entry concentration. Your building will not be cleared for re-occupancy until it is safe to enter. The fumigator will post a notice on your building indicating the day and time for re-entry. Structures can be occupied only when the concentration is 1 part per million or less (this represents a margin of safety – laboratory animals have been exposed to 100 parts per million for 2 weeks with no adverse effects). Because Vikane is a true gas and not a vapor, aeration is rapid. Recent studies demonstrated that in most structures levels are less than 1 part per million after the aeration period and have no detectable levels of vikane within 24 hours after the start of the aeration.

Sulfuryl Fluoride is a colorless, odorless gas, so a warning agent is added to the building, which causes watery eyes and a scratchy throat. If you experience these symptoms in a structure that has been recently fumigated, you should leave immediately and call the pest control company to have your building re-tested.

## **SULFURYL FLUORIDE (POTENTIAL HEALTH RISK FROM OVEREXPOSURE)**

Sulfuryl fluoride is a gas and can potentially enter your body only through inhalation. Because it is a gas, it does not stay on dry surfaces; therefore, there is no exposure from touching treated surfaces.

### **Nervous system and respiratory irritation:**

Overexposure to high levels of Sulfuryl Fluoride can result in nose and throat irritation and nausea. At high concentrations (such as those used during the fumigation) it can cause excess fluid in the lungs, sleepiness, pneumonia, and convulsions. These symptoms would be expected to appear within 8 hours after such an exposure. In the unlikely event you experience these symptoms in the building that has been recently fumigated, you should leave immediately. Consult your physician and call the pest control company to have your building re-tested.

### **Additional studies:**

Sulfuryl fluoride has not been shown to cause birth defects in pregnant animals exposed under experimental conditions. In addition, current studies have demonstrated there are not mutagenic or genotoxic effects caused by exposure to sulfuryl fluoride.

## **Safety Precautions and Homeowner Preparation**

- Discuss the treatment program in advance with your pest control company so you fully understand what will be done and what you need to do.
- Carefully follow the instructions you are given about what items you are to remove from your building.
- Stay out of the treated building until it is cleared by your pest control company for re-entry.
- If you are interested or concerned, you should ask your pest control company to show the records of how your building was aerated before it was cleared for re-entry.
- You may wish to increase ventilation by opening doors and windows.

If you have specific questions about your fumigation, refer to documents provided by the fumigator or call the fumigator listed on the warning signs posted on your structure. Call the Dow AgroSciences Customer Information Center at 1-800-352-6776 if you need additional information or have questions concerning this product.

\*Trademark of Dow AgroSciences

---



**AUTHORIZATION AGREEMENT**  
**WOOD DESTROYING PESTS AND ORGANISIMS CONTRACT**  
**1177 Muirlands Vista Way, La Jolla - Report No. 665525**

**To schedule work, email or fax this signed Authorization Agreement, or call directly:**

**email: HGrepairs@HomeGuard.com**

**Fax: (925) 294-1818**

**Direct: (855) 331-1900**

**Items to be performed:** \_\_\_\_\_

**Total Price \$ \_\_\_\_\_ (plus permit costs if any)**

For the total sum listed above, HomeGuard Incorporated is authorized to proceed with the work described in the above listed item(s) of their termite report no. 665525 for the property located at 1177 Muirlands Vista Way, La Jolla. This amount will be due and payable upon completion of work. It is understood that the contract price does not include the charge of the structural pest control inspection report or re-inspection fees.

**HOMEGUARD INCORPORATED AGREES:**

1. To guarantee all repairs completed by this company for one year from the date of completion except for plumbing, grouting, caulking, and resetting of toilets, which will be guaranteed for 30 days, and fumigations, which will be guaranteed for 3 years.
2. To be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days.
3. To use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any, plant life, rain gutters, roofs; nor for damage or dirtying of stucco, plaster, paint, wall paper or other "finish-work" adjacent to areas where work is performed.
4. To replace damaged wood members with material which resembles, as closely as possible, the existing wood members with builders grade, readily available wood members.

**OWNER OR OWNER'S AGENT AGREES:**

1. To pay for services rendered upon completion of work. This contract may be canceled at any time by the customer. In the event of such action, customer agrees to pay HomeGuard Incorporated in full for all items already completed, and completed percentages of all items only partially completed. The customer also agrees that in the case of cancelation of the contract, to pay all fees for necessary permits and any associated cost for obtaining permits. In the case of non-payment by owner, reasonable attorney fees and costs of collection shall be paid by the owner whether suit be filed or not.
2. To pay for service charge of 1.5 percent per month or portion of any month beyond 30 days after completion.
3. Owner grants HomeGuard Incorporated, a security interest in the above described real property to secure payment of the sum for work and inspeciton fee completed.
4. If additional damage is discovered by HomeGuard Incorporated, during the performance of work, company agrees to notify owner or agent of the amount of the damage and the cost of additional work to be done. This work will not be performed unless owner agrees.
5. All plumbing repairs bid in this report are for only the specific repair that is identified. Many times when performing plumbing repairs it becomes necessary to repair or replace adjacent plumbing because of the age or fragility of these components. When this happens the owner or agent will be notified and said repairs will require additional cost and authorization.
6. **Prices provided in this report do not include the costs associated with obtaining permits. Some of these costs may include plan check fees, site plans, engineering plans and time spent at the building department and waiting for building inspections. Permits will be obtained at an additional cost based on the sum total of these costs.**



**AUTHORIZATION AGREEMENT**  
**WOOD DESTROYING PESTS AND ORGANISIMS CONTRACT**  
**1177 Muirlands Vista Way, La Jolla - Report No. 665525**

**To schedule work, email or fax this signed Authorization Agreement, or call directly:**

**email: HGREpairs@HomeGuard.com**

**Fax: (925) 294-1818**

**Direct: (855) 331-1900**

**NOTICE TO OWNER**

"Under the California Mechanics Lien law, any structural pest control operator who contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim of lien against your property, certain claimants such as subcontractors and material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid. You can protect yourself from such claim by requiring your contractor to supply you with a payment and performance bond prior to commencing any work of improvement and/or requiring your contractor to provide you with an unconditional lien release signed by each material supplier, subcontractor, and laborer involved in that project phase before making payment on the completed phase of the project."

**NOTICE**

"The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept HomeGuard Incorporated's bid or you may contract directly with another registered company licensed to perform the work.

If you choose to contract directly with another registered company, HomeGuard Incorporated will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform."

**BINDING ARBITRATION PROVISION**

Any dispute, claim, or controversy arising out of or relating to this agreement or the breach, termination, enforcement, interpretation, or validity thereof including the determination of the scope or applicability of this agreement to arbitrate, shall be determined by arbitration in the county of the property mentioned in this contract before one arbitrator. The arbitration shall be administered by JAMS pursuant to its comprehensive arbitration rules and procedures. Judgement on the award may be entered in any court having jurisdiction. This clause shall not preclude parties from seeking provisional remedies in aid of arbitration from a court of appropriate jurisdiction. The parties agree that the arbitrator shall be a retired judge from the county in which the arbitration takes place.

**NOTICE OF THREE-DAY RIGHT TO CANCEL**

You, the purchaser of services, have the right to cancel this contract within 3 business days. You may cancel by emailing, mailing, faxing or delivering a written notice to the HomeGuard Incorporated at 58 Wright Brothers Avenue, Livermore, CA 94551 by midnight of the third business day after you received a signed and dated copy of the contract that includes this notice. Include your name, your address, and the date you received a signed copy of the contract and this notice.

If you cancel, HomeGuard Incorporated must return to you anything you paid within 10 days of receiving the notice of cancelation. For your part, you must make available to HomeGuard Incorporated at your residence, in substantially as good condition as you received it, any goods delivered to you under this contract or sale. Or, you may, if you wish, comply with HomeGuard Incorporated's instructions on how to return the goods at the contractor's expense and risk. If you do make the goods available to HomeGuard Incorporated and HomeGuard Incorporated does not pick them up within 20 days of the date of your notice of cancelation, you may keep them without any further obligation. If you fail to make the goods available to HomeGuard Incorporated, or if you agree to return the goods to the HomeGuard Incorporated or fail to do so, then you remain liable for performance of all obligations under the contract.

Signature: \_\_\_\_\_ Date: \_\_\_\_\_



**AUTHORIZATION AGREEMENT**  
**WOOD DESTROYING PESTS AND ORGANISIMS CONTRACT**  
**1177 Muirlands Vista Way, La Jolla - Report No. 665525**

**To schedule work, email or fax this signed Authorization Agreement, or call directly:**

**email: HGregairs@HomeGuard.com**

**Fax: (925) 294-1818**

**Direct: (855) 331-1900**

This job has been bid as if all section one items are being performed. If the owner would like to select individual items, it may require HomeGuard Incorporated to provide a new price for these items. The minimum service charge is \$275 regardless of the price on the individual item.

**Section 1:**

1A    \$2,943    1B    \$150    1C    \$688    1D    \$1,294    1E    \$462    1F    \$3,698    1G    \$198

**Section 1    \$9,433**

plus permit fees

**Section 2:**

2A    \$323    2B    \$237    2C    \$150    2D    \$296    2E    \$315    2F    \$403    2G    OthTrd

**Section 2    \$1,724**

plus non-bid items

plus permit fees

**Further Insp.:**

3A    Owner    F.I.    \$0  
plus non-bid items  
plus permit fees

**OWNER OR OWNERS AGENT**

**DATE**

**BY: \_\_\_\_\_, HomeGuard Incorporated**

**X** \_\_\_\_\_

**ESCROW OFFICER:** \_\_\_\_\_

**Print Name** \_\_\_\_\_

**ESCROW PHONE NO:** \_\_\_\_\_

**Phone No** \_\_\_\_\_

**ESCROW CO/NO:** \_\_\_\_\_

**email** \_\_\_\_\_

Name of person providing access \_\_\_\_\_ Phone Number \_\_\_\_\_

IS UPGRADING OR CHOICE OF LINOLEUM OR TILE DESIRED?    Yes\_\_\_    No\_\_\_

\*\*\*If there is no choice, neutral colors will be installed there may be additional charges for special materials chosen\*\*

Upgrades (if requested) List each upgrade separately:

\_\_\_\_\_ estimated cost: \_\_\_\_\_ initials: \_\_\_\_\_

\_\_\_\_\_ estimated cost: \_\_\_\_\_ initials: \_\_\_\_\_

I authorize HomeGuard, Incorporated to complete the above listed upgrades. I also agree to pay for these upgrades upon completion of the repairs.

**NOTICE OF DELAYED PAYMENT ACCOMMODATION FEE**

The charges listed in this contract are due upon the completion of work, however HomeGuard Incorporated can accommodate the escrow process/ delayed payment option and bill directly to escrow if so desired. The fee structure for any delayed billing, is as follows: total work under \$500.00 is \$65.00; total work between \$500.00 and \$2000.00 is \$95.00; total work between \$2000.00 and \$5000.00 is \$135.00; total work above \$5000.00 is \$225.00. The delayed payment accommodation fee will be waived when payment is received by HomeGuard Incorporated within five (5) days of issuance of the Notice of Completion.

**PLEASE BE SURE TO SIGN AND SEND ALL PAGES**



**AUTHORIZATION AGREEMENT**  
**WOOD DESTROYING PESTS AND ORGANISIMS CONTRACT**  
**1177 Muirlands Vista Way, La Jolla - Report No. 665525**

**To schedule work, email or fax this signed Authorization Agreement, or call directly:**

**email: HGrepairst@HomeGuard.com**

**Fax: (925) 294-1818**

**Direct: (855) 331-1900**

---

**NOTICE OF CANCELLATION**

\_\_\_\_\_  
(ENTER DATE OF TRANSACTION)

You may cancel this transaction, without any penalty or obligation, within 3 business days from the above date.

If you cancel, any property traded in, any payments made by you under the contract or sale, and any negotiable instrument executed by you will be returned within 10 days following receipt by the seller of your cancellation notice, and any security interest arising out of the transaction will be cancelled.

If you cancel, you must make available to the seller at your residence, in substantially as good condition as when received, any goods delivered to you under this contract or sale, or you may, if you wish, comply with the instructions of the seller regarding the return shipment of the goods at the seller's expense and risk.

If you do make the goods available to the seller and the seller does not pick them up within 20 days of the date of your notice of cancellation, you may retain or dispose of the goods without any further obligation.

If you fail to make the goods available to the seller, or if you agree to return the goods to the seller and fail to do so, then you remain liable for performance of all obligations under the contract.

To cancel this transaction, mail, emailing, faxing or deliver a signed and dated copy of this cancellation notice, or any other written notice to: HomeGuard Incorporated, 58 Wright Brothers Avenue, Livermore, CA 94551 not later than midnight of \_\_\_\_\_ (date).

I hereby cancel this transaction \_\_\_\_\_ (date)

\_\_\_\_\_  
(Owners Signature)





## Invoice

Invoice Date: 10/8/2025

Invoice No: 1160499T

### Bill To:

Romina Spinelli  
Berkshire Hathaway  
1299 Prospect Street #218  
La Jolla, CA 92037

### Property Information:

Address: 1177 Muirlands Vista Way  
La Jolla, CA 92037  
Report No: 665525TPR  
Escrow#:

**PAID**  
**DO NOT REMIT**

### Billing Information

10/8/2025 WDO Inspection

\$95.00

Pay-At-Time Discount

(\$40.00)

Total Due:

\$55.00

**DUE UPON RECEIPT**

Please remit to: 510 Madera Ave., San Jose, CA 95112

*There is a \$25 fee for all returned checks*