


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1837	Street Avenida Sevilla	City Oceanside	ZIP 92056	Date of Inspection 04/22/2025	Number of Pages 6
		Pest Patrol, Inc. 9920 Scripps Lake Drive Suite 107 San Diego CA 92131 (760) 789-5889 office@pestpatrol.com		Report # : 20173 Registration # : PR1612 Escrow # : <input type="checkbox"/> CORRECTED REPORT	
Ordered by: Chris Jensen	Property Owner and Party of Interest: 1837 Avenida Sevilla Oceanside CA 92056 United States			Report sent to: Chris Jensen	
COMPLETE REPORT <input type="checkbox"/> LIMITED REPORT <input type="checkbox"/> SUPPLEMENTAL REPORT <input checked="" type="checkbox"/> REINSPECTION REPORT <input type="checkbox"/>					
GENERAL DESCRIPTION: 2 story, slab foundation, single family residence, stucco siding, concrete tile roof, and attached garage.				Inspection Tag Posted: Garage	
This supplemental report was created to add tile insurance.				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites <input type="checkbox"/> Drywood Termites <input checked="" type="checkbox"/> Fungus / Dryrot <input checked="" type="checkbox"/> Other Findings <input checked="" type="checkbox"/> Further Inspection <input type="checkbox"/>					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Diagram Not To Scale

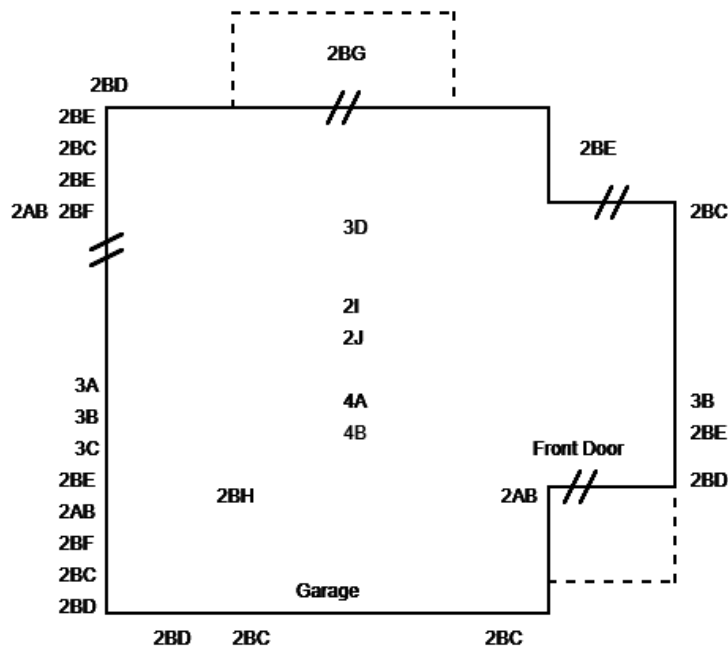

Inspected By: Chris Mumford State License No. FR61714 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 04/2015)

PEST PATROL, INC.

Page 2 of 6 inspection report

1837	Avenida Sevilla	Oceanside	CA	92056
Address of Property Inspected		City	State	ZIP
04/22/2025	20173			
Date of Inspection	Corresponding Report No.		Escrow No.	

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. **OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.**

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report **DOES NOT INCLUDE MOLD** or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

This inspection report does not include findings for rats, mice, bats, other rodents or non-wood destroying pest.

PEST PATROL, INC.

Page 3 of 6 inspection report

1837	Avenida Sevilla	Oceanside	CA	92056
Address of Property Inspected		City	State	ZIP
04/22/2025	20173			
Date of Inspection		Corresponding Report No.		Escrow No.

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(s) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

2. DRYWOOD TERMITES:

2A - Section I

FINDING - Evidence of drywood termite infestations at second story fascia as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: \$400

2B - Section I

FINDING - Evidence of termite damaged wood members noted at time of inspection at first and second story fascia, rafter tail, out looker, shiplap, second story rafter tail, pergola trim, slats, joist, balcony trim, and handrail as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

2C - Section I

FINDING - Evidence of drywood termite infestations at rafter tail and out looker as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2D - Section I

FINDING - Evidence of drywood termite infestations at first story fascia as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2E - Section I

PEST PATROL, INC.

Page 4 of 6 inspection report

1837	Avenida Sevilla	Oceanside	CA	92056
Address of Property Inspected		City	State	ZIP
04/22/2025	20173			
Date of Inspection		Corresponding Report No.		Escrow No.

FINDING - Evidence of drywood termite infestations at shiplap as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2F - Section I

FINDING - Evidence of drywood termite infestations at second story rafter tail as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2G - Section I

FINDING - Evidence of drywood termite infestations at pergola trim, slats, and joist as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2H - Section I

FINDING - Evidence of drywood termite infestations at balcony trim and handrail as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2I - Section I

FINDING - Evidence of drywood termite infestations at attic as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: See 2A

2J - Section I

FINDING- Evidence of swarmers noted at time of inspection at attic as indicated on the diagram.

RECOMMENDATION - Fumigate the structure for the control of drywood termites. Remove or cover drywood termite fecal pellets in accessible areas. Owner/agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until released for re-entry by the licensed fumigator. See fumigation notice for terms and liabilities.

Tile and roof repair service is not included in this price but may be available upon request.

PEST PATROL, INC.

Page 5 of 6 inspection report

1837	Avenida Sevilla	Oceanside	CA	92056
Address of Property Inspected		City	State	ZIP
04/22/2025	20173			
Date of Inspection		Corresponding Report No.		Escrow No.

Cost of Tile Insurance: See 2A

3. FUNGUS / DRYROT:

3A - Section I

FINDING - Dry-rot wood members found at time of inspection at fascia as indicated on the diagram.

RECOMMENDATION - Replace the damaged wood member(s) as necessary. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the replaced area only.

3B - Section I

FINDING - Dry-rot wood members found at time of inspection at shiplap as indicated on the diagram.

RECOMMENDATION - Replace the damaged wood member(s) as necessary. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the replaced area only.

3C - Section I

FINDING - Surface fungus condition visible at time of inspection at fascia and shiplap as indicated on the diagram.

RECOMMENDATION - Replace the damaged wood member(s) as necessary. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the replaced area only.

3D - Section I

FINDING - Dry-rot wood members found at time of inspection at roof ply as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

4. OTHER FINDINGS:

4A - Notes

FINDING - Areas in garage and interior of home partially inspected due to storage & furnishings.

RECOMMENDATION - Remove or relocate storage & furnishings which are impeding the inspection. Schedule further inspection with Pest Patrol.

4B - Other

FINDING - Optional Tile Insurance to cover any tiles that may break during the fumigation process.

Tile and roof repair service is not included in this price but may be available upon request.

Cost of Tile Insurance: \$400

This is a supplemental report to original report dated 04/10/2025, report #20118.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

PEST PATROL, INC.

Page 6 of 6 inspection report

1837	Avenida Sevilla	Oceanside	CA	92056
Address of Property Inspected		City	State	ZIP
04/22/2025	20173			
Date of Inspection	Corresponding Report No.		Escrow No.	

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(858) 694-2739
Health Department	(866) 358-2966
Structural Pest Control Board	(916) 561-8700



Pest Patrol, Inc.
9920 Scripps Lake Drive Suite 107
San Diego CA 92131
(760) 789-5889
office@pestpatrol.com

Page 1 of 2

WORK AUTHORIZATION

Report #: 20173

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 1837 Avenida Sevilla

City: Oceanside

State/ZIP: CA 92056

The inspection report of the company dated, 04/22/2025 is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ ____.

This total amount is due and payable within 30 days from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of ninety (90) days. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof. The quoted price is for all work being performed together. Should only a portion of the work be authorized, rather than the full recommended work, the price may change in cost.

THE OWNER OR OWNER'S AGENT AGREES

All services rendered and any additional services requested upon the completion of the work will be paid within thirty (30) days of their completion. For all properties that will be paid outside of escrow: 1) 30% of the invoice must be paid as a deposit before the work is performed. Any credit card transaction will be subject to a 2% service charge. 2) a card will be put on file, 3) should the invoice not be paid within thirty (30) days after the completion of the work, the card on file will be charged, 4) if the charge does not go through, an interest of one and one-half percent (1.5%) will be added to the invoice for each month it is not paid. In the case of non-payment by the owner, reasonable attorney fees and costs of collection shall be paid by the owner, whether the suit is filed or not.

In order for a property to be paid through escrow: 1) the property must be in escrow when the work is performed, 2) the buyer(s) must release contingencies before the work is performed, 3) escrow information must be provided including the escrow officer's name and email address. If all three of these conditions are not met, work must be paid for outside of escrow from the person who authorizes the work.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

ITEMS

Prefix	Section I	Section II	Further Inspection	Other
2A	3,060.00	0.00	0.00	0.00
2B	8,110.00	0.00	0.00	0.00
2C	See 2A	0.00	0.00	0.00
2D	See 2A	0.00	0.00	0.00
2E	See 2A	0.00	0.00	0.00
2F	See 2A	0.00	0.00	0.00
2G	See 2A	0.00	0.00	0.00
2H	See 2A	0.00	0.00	0.00
2I	See 2A	0.00	0.00	0.00
2J	See 2A	0.00	0.00	0.00
3A	See 2B	0.00	0.00	0.00
3B	See 2B	0.00	0.00	0.00
3C	See 2B	0.00	0.00	0.00

Property Owner:

Date:

Inspected By:

Date:

Owner's Agent:

Date:



Pest Patrol, Inc.
9920 Scripps Lake Drive Suite 107
San Diego CA 92131
(760) 789-5889
office@pestpatrol.com

Page 2 of 2

WORK AUTHORIZATION

Report #: 20173

Prefix	Section I	Section II	Further Inspection	Other
3D	See 2B	0.00	0.00	0.00
4B	0.00	0.00	0.00	400.00
Total:	11,170.00	0.00	0.00	400.00
GRAND TOTAL:	11,570.00			

Property Owner: _____ Date: _____ Inspected By: _____ Date: _____

Owner's Agent: _____ Date: _____