

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
5522	Bloch St	San Diego	92122-4012	04/23/2025	1 of 6

	<b>Aftermath Exterminating Inc.</b> <b>P.O. Box 1204</b> <b>Alpine, CA 91903</b> Tel 619-722-6522 Fax Registration #: PR 9071	A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.  <b>Report #: 4248</b>
---	---	---

Ordered by: Patrick Russel Park Place Realty & Mortgage 760-443-3102	Property Owner and Party of Interest: Patrick Russel Park Place Realty & Mortgage 760-443-3102	Report sent to: Patrick Russel Park Place Realty & Mortgage 760-443-3102
---	---	---

COMPLETE REPORT <input checked="" type="checkbox"/>	LIMITED REPORT <input type="checkbox"/>	SUPPLEMENTAL REPORT <input type="checkbox"/>	REINSPECTION REPORT <input type="checkbox"/>
---	---	--	--

General Description: One and Two Story, Single Family Residence, Composition Roof, Stucco Siding, Attached Two Car Garage Covered in Drywall, Slab Foundation	Inspection Tag Posted: ATTIC
Other Tags Posted:	


An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites <input type="checkbox"/>	Drywood Termites <input checked="" type="checkbox"/>	Fungus/Dryrot <input type="checkbox"/>	Other Findings <input type="checkbox"/>	Further Inspection <input type="checkbox"/>
--	--	--	---	---

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

Key: 1 = Subterranean Termites    2 = Drywood Termites    3 = Fungus/Dryrot    4 = Other Findings    5 = Unknown Further Inspection

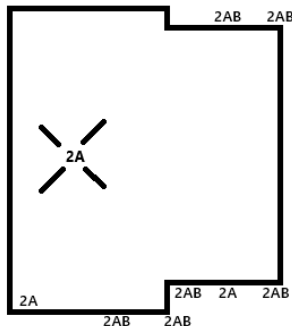

*RED*

Inspected By: Ray Gill State License No.: opr12810 Signature: \_\_\_\_\_

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov).

43M-41 (REV. 04/2015)

## General Comments

### What Is a Wood Destroying Pest and Organism Inspection Report?

The following explains the scope and limitations of a structural pest control inspection and a Wood Destroying Pest & Organism Inspection Report.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of wood destroying insects or organisms in visible and accessible areas on the date of inspection and contains our recommendations for correcting any infestations, infections, or conditions found. The contents of the wood destroying pest & organism inspection report are governed by the structural pest control act and its rules and regulations.

Some structures may not comply with building code requirements or may have structural, plumbing, electrical, heating and air conditioning, or other defects that do not pertain to this report. This report does not address any such defects as they are not within the scope of the license of the inspector or the company issuing this report.

The following areas are considered inaccessible for purposes of inspection or are not included in a normal inspection report and therefore are excluded in this report: the interior of hollow walls; spaces between an upstairs floor and the ceiling below or a porch deck and soffit below; stall showers over finished ceilings; such structural segments as areas enclosed by bay windows, buttresses, built-in cabinet work, areas under floor covering; any areas requiring the removal of storage, furnishings or appliances; and any areas to which there is no access without defacing or removing lumber, masonry or finished workmanship.

Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These areas include, but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than an 18" clear crawl space, the interior of hollow walls, spaces between a floor or porch deck and the ceiling below, areas where there is no access without defacing or tearing out lumber, masonry or finished work that make inspection impractical, and areas or timbers around eaves that would require use of an extension ladder.

Certain areas may be inaccessible for inspection due to construction or storage. We recommend further inspection of areas where inspection was impractical. Re: Structural Pest Control Act, Business and Professions Code Article 1, 8516(b)(9). Stall shower, if any, is water tested in compliance with Title 16 Professional and Vocational Regulations Article 5, §1991.1(12) of the Structural Pest Control Act. The absence or presence of leaks through sub-floor, adjacent floors or walls will be reported. This is a report of the condition of the stall shower at the time of inspection only, and should not be confused as a guarantee. Although we make a visual examination, we do not deface or probe into window or door frames, decorative trim, roof members, etc., in search of wood destroying pests or organisms.

"This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

" NOTE: We do not inspect or certify plumbing, plumbing fixtures, etc.

NOTE: "The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors' State License Board.

" "NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Aftermath Exterminating's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, Aftermath Exterminating will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform.

" "NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

" This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold-like conditions, please contact the appropriate

mold professional.

Local treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated.

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

Description of Findings

SECTION: I  
DRYWOOD TERMITES

Finding:	2A	Evidence of Drywood Termite infestation was noted at the garage framing, attic, fascia, window trim, garage door jamb, and rafter tail as indicated on the diagram.
Recommendation:		Vacate the premises and seal the structure with tarpaulins for fumigation with Sulfuryl Fluoride a state approved fumigant for the control of Drywood Termites. An Occupant Fumigation Notice must be signed prior to the commencement of any work completed. Cover and or mask accessible Drywood Termite Pellets. Drywood termite Fumigations are warranted for a period of four years from the date of fumigation.
Price:	\$1,980.00	
Finding:	2B	Evidence of Drywood Termite damage was noted at the fascia, window trim, garage door jamb, and rafter tail as indicated on the diagram.
Recommendation:		Repair Drywood Termite damaged wood members as needed. If damage extends into an inaccessible area, a supplemental report will be generated with an additional cost estimate. Paint is included in this estimate, however exact match is not guaranteed. Termite repairs are warranted for a period of one year from the date of completion.
Price:	\$1,875.00	

---

Section I Total:	\$3,855.00
Grand Total:	\$3,855.00

---

## **Disclaimer**

In accordance with the laws and regulations of the State of California, we are required to provide you with the following information prior to application of pesticides to your property.

"State law requires that you be given the following information: CAUTION--PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized."

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately."

For further information, contact any of the following:

Aftermath Exterminating (619) 722-6428

Poison Control Center (800) 222-1222

(Health Questions) County Health Department  
San Diego County (619) 338-2222  
Riverside County (951) 358-5000  
Imperial County (760) 482-4436

(Application Info.) County Agriculture Commissioners Office  
San Diego County (858) 694-2739  
Riverside County (951) 955-3000  
Imperial County (760) 482-4314

Structural Pest Control Board (Regulatory Info.) (800) 737-8188  
2005 Evergreen Street, Ste. 1500 Sacramento, CA 95815

Termiticides and Fungicides that will be used for treatment:

Termidor SC ( EPA Reg. No. 7969-210 )  
Active Ingredient: Fipronil 9.1%

Premise Foam ( EPA Reg. No. 432-1391 )  
Active Ingredient: Imidacloprid .05%

Bora-Care ( EPA Reg. No. 64405-1 )  
Active Ingredient: Disodium Octaborate Tetrahydrate 40%

Fumigants that will be used for treatment:

Vikane (EPA Reg. No. 1015-78 )  
Active Ingredient: Sulfuryl Fluoride 99.8%

## **NOTICE TO OWNER**

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material

suppliers are required to provide you with a document entitled Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

IF THIS CONTRACT IS TO BE PAID OUT OF ESCROW THE BUYERS AND SELLERS AGREE TO PROVIDE THIS COMPANY WITH ALL THE ESCROW BILLING INFORMATION REQUIRED TO COLLECT THE AMOUNT DUE. THE PERSONS SIGNING THIS CONTRACT ARE RESPONSIBLE FOR PAYMENT, AND IF THE ESCROW DOES NOT CLOSE WITHIN 10 DAYS AFTER THE DATE OF COMPLETION OF THE WORK, THE SIGNER AGREES TO PAY IN FULL THE AMOUNT SPECIFIED IN THIS WORK AUTHORIZATION AGREEMENT. IT IS SIGNERS RESPONSIBILITY TO CONTACT AFTERMATH EXTERMINATING IF PROPERTY FALLS OUT OF ESCROW TO MAKE PAYMENT ARRANGEMENTS.

NOTE: If the Home Owner fails to pay billing in full, Aftermath Exterminating will have the right to be paid back for all of its costs and expenses to the extent not prohibited by applicable law. Those expenses include, for example (but not limited to), reasonable attorney's fees. If for any reason this account is to be turned over to our collection agency, you will be responsible for all costs of collecting.