

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 26669	Street Modoc	City Lake Arrowhead	ZIP 92352	Date of Inspection 09/29/2023	Number of Pages 5
-----------------------	-----------------	------------------------	--------------	----------------------------------	----------------------



Empire Termite Solutions

Po Box 534
Rimforest CA 92378
(909) 744-8890
Empiretermite@yahoo.com

Report # : 16233
Registration # : PR7434
Escrow # :
 CORRECTED REPORT

Ordered by: Joe Marquez	Property Owner and/or Party of Interest:	Report sent to:
----------------------------	--	-----------------

COMPLETE REPORT LIMITED REPORT SUPPLEMENTAL REPORT REINSPECTION REPORT


GENERAL DESCRIPTION: Two-story single family residence, furnished, and occupied	Inspection Tag Posted: Subarea
	Other Tags Posted: None

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites Drywood Termites Fungus / Dryrot Other Findings Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

Diagram Not To Scale

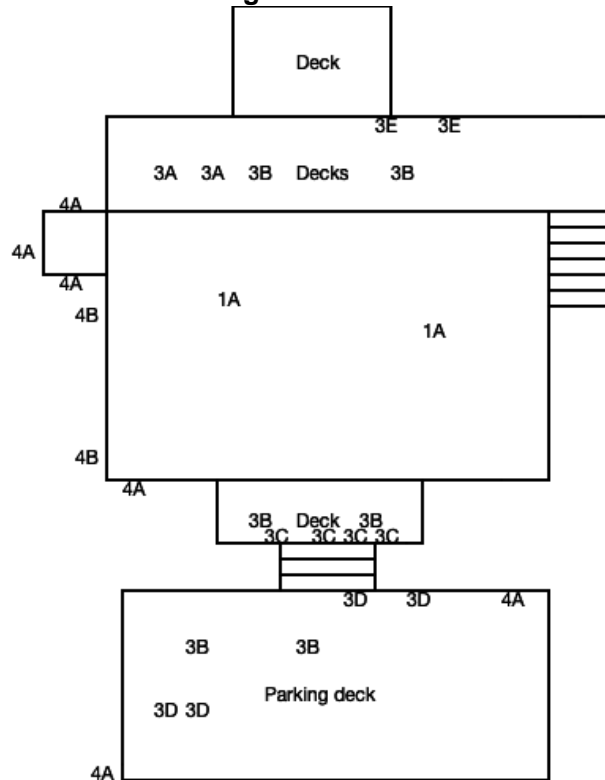

Inspected By: Adolfo Garcia State License No. OPR12958 Signature: *Adolfo Garcia*

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 04/2015)

EMPIRE TERMITE SOLUTIONS

Page 2 of 5 inspection report

26669	Modoc	Lake Arrowhead	CA	92352
Address of Property Inspected		City	State	ZIP
09/29/2023	16233			
Date of Inspection	Corresponding Report No.		Escrow No.	

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

EMPIRE TERMITE SOLUTIONS

Page 3 of 5 inspection report

26669	Modoc	Lake Arrowhead	CA	92352
Address of Property Inspected		City	State	ZIP
09/29/2023	16233			
Date of Inspection	Corresponding Report No.		Escrow No.	

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

1. SUBTERRANEAN TERMITES:

1A - Section I

FINDING: Evidence of subterranean termites noted at the tree stumps under the house.

RECOMMENDATION: Chemically treat the soil with Termidor (Fipronil), and/or Dragnet (Permethrin), and/or Timbor (Disodium Octabrate Tetrahydrate), all products registered with the State of California for the control of subterranean termites. Remove shelter tubes, where accessible.

3. FUNGUS / DRYROT:

3A - Section I

FINDING: Dry rot noted at three cantilevered joists under the back lower deck. This repair will require new concrete piers and posts, which are included in this quote. This repair may reveal additional findings.

RECOMMENDATION: Remove the damaged wood member(s). Replace the damaged wood with new material. (This bid excludes priming, painting, or staining. If any party to the transaction wants the wood primed, painted, or stained, they should contact Empire Termite Solutions for a bid to prime, paint, or stain repaired wood. Empire Termite Solutions is not responsible for damage to bare wood.) This repair might reveal additional findings.

3B - Section I

FINDING: Surface fungus was noted on the joists and deck planks under the front and back deck.

RECOMMENDATION: Scrape away surface fungus and treat the area with Timbor (Sodium Borate) a chemical registered with the state of California, Department of Agriculture, in accordance with the label for the control of fungus.

3C - Section I

FINDING: Dry rot noted at four joists under the entry deck.

RECOMMENDATION: Remove the damaged wood member(s). Replace the damaged wood with new material. (This bid excludes priming, painting, or staining. If any party to the transaction wants the wood primed, painted, or stained, they should contact Empire Termite Solutions for a bid to prime, paint, or stain repaired wood. Empire Termite Solutions is not responsible for damage to bare wood.) This repair might reveal additional findings.

3D - Section I

FINDING: Dry rot noted at about four parking deck joists, two parking deck planks and the base of one 6x6 post under the parking deck.

RECOMMENDATION: Remove the damaged wood member(s). Replace the damaged wood with new material. (This bid excludes priming, painting, or staining. If any party to the transaction wants the wood primed, painted, or stained, they should contact Empire Termite Solutions for a bid to prime, paint, or stain repaired wood. Empire Termite Solutions is not responsible for damage to bare wood.) This repair might reveal additional findings.

3E - Section I

FINDING: Dry rot noted at two joists under the back top deck.

EMPIRE TERMITE SOLUTIONS

Page 4 of 5 inspection report

26669	Modoc	Lake Arrowhead	CA	92352
Address of Property Inspected		City	State	ZIP
09/29/2023	16233			
Date of Inspection	Corresponding Report No.		Escrow No.	

RECOMMENDATION: Remove the damaged area. Repair the damaged area with new material. (This bid excludes priming, painting, or staining. If any party to the transaction wants the wood primed, painted, or stained, they should contact Empire Termite Solutions for a bid to prime, paint, or stain repaired wood. Empire Termite Solutions is not responsible for damage to bare wood.) This repair might reveal additional findings.

4. OTHER FINDINGS:

4A - Section II

FINDING: Earth to wood contact noted at the wood box at the left side of house, the joist and post under the parking deck and the siding at the front of house.

RECOMMENDATION: Remove earth from wood contact and further inspect. This repair may reveal additional findings.

4B - Section II

FINDING: Wood pecker holes were noted at siding at the left side of the house. Wood pecker holes can lead to water intrusion into the house causing an excessive moisture condition.

RECOMMENDATION: Repair the damaged siding. Empire Termite Solutions does not guarantee nor take responsibility for wood peckers or new damage caused by wood peckers. Empire Termite Solutions recommends hiring a licensed pest control company for the removal of the woodpeckers. Please contact Empire Termite Solutions for any questions or recommendations.

NOTES:

Note A

Siding around house is weathered and cracked. If any party to this transaction has questions and/or concerns, they should contact Empire Termite Solutions or a licensed contractor prior to the close of escrow.

Note B

Deck boards and joists are weathered and cracked. If any party to this transaction has questions and/or concerns, they should contact Empire Termite Solutions or a licensed contractor prior to the close of escrow.

Note C

Back top deck handrails are weathered and warped. If any party to this transaction has questions and/or concerns, they should contact Empire Termite Solutions or a licensed contractor prior to the close of escrow.

Note D

Water stains noted at T&G ceiling inside house. If any party to the transaction has doubts about the cause in nature of the stains they should contact a licensed trades person to evaluate prior to the close of escrow.

Note E

Dry wall ceiling in the downstairs room has a crack. If any party to this transaction has questions and/or concerns, they should contact Empire Termite Solutions or a licensed contractor prior to the close of escrow.

Note F

Water stains was noted at the ceilings by the beams. If any party to the transaction has doubts about the cause in nature of the stains they should contact a licensed trades person to evaluate prior to the close of escrow.

Note G

Water stains noted at sub floor construction which may indicate water intrusion to the structure. If any party to the transaction has doubts about the cause in nature of the stains they should contact a licensed trades person to evaluate prior to the close of escrow.

Note H

Insulation between floor joists in subarea, does not allow for visual inspection of the floor in the subarea. No visible signs of

EMPIRE TERMITE SOLUTIONS

Page 5 of 5 inspection report

26669	Modoc	Lake Arrowhead	CA	92352
Address of Property Inspected		City	State	ZIP
09/29/2023	16233			
Date of Inspection	Corresponding Report No.		Escrow No.	

infestation or infection are visible. If any party to this transaction wants these areas to be inspected they should contact Empire Termite Solutions prior to the close of escrow.

Note I

NOTE: IF PAINT ON NEW INSTALLED WOOD IS REQUESTED THE PRICE FOR PAINT WILL BE \$ 450.00

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(909) 387-2105
Health Department	(800) 722-4794
Structural Pest Control Board	(916) 561-8700

2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815



Empire Termite Solutions

Po Box 534
Rimforest CA 92378
(909) 744-8890

Empiretermite@yahoo.com

WORK AUTHORIZATION

Report #: 16233

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 26669 Modoc
City: Lake Arrowhead
State/ZIP: CA 92352

The inspection report of the company dated, **09/29/2023** is incorporated herein by reference as though fully set forth. The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____. This total amount is due and payable within 10 days from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of **ninety (90) days**. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof.

THE OWNER OR OWNER'S AGENT AGREES

To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

ITEMS

Prefix	Section I	Section II	Further Inspection	Other
1A	325.00	0.00	0.00	0.00
3A	2,150.00	0.00	0.00	0.00
3B	345.00	0.00	0.00	0.00
3C	1,650.00	0.00	0.00	0.00
3D	4,650.00	0.00	0.00	0.00
3E	425.00	0.00	0.00	0.00
4A	0.00	125.00	0.00	0.00
4B	0.00	345.00	0.00	0.00
Total:	9,545.00	470.00	0.00	0.00

GRAND TOTAL: 10,015.00

Property Owner: _____ Date: _____ Inspected By: _____ Date: _____

Owner's Agent: _____ Date: _____



INVOICE / STATEMENT

Empire Termite Solutions

Po Box 534
Rimforest CA 92378
(909) 744-8890
Empiretermite@yahoo.com

Date: 09/29/2023

Report Number: 16233

Invoice Number: 16233-1

Escrow Number:

Property 26669 Modoc
Inspected: Lake Arrowhead, CA 92352

Bill To: Joe Marquez

MOBILE: (909) 744-4651
RLTRjoe@gmail.com

Inspection: \$	95.00
Invoice Total: \$	95.00
Payments: \$	0.00
Total Due: \$	95.00

Description of Service

RETAIN THIS COPY FOR YOUR RECORDS
THANK YOU FOR YOUR BUSINESS

CUT HERE

CUT HERE

CUT HERE



INVOICE / STATEMENT

Empire Termite Solutions

Po Box 534
Rimforest CA 92378
(909) 744-8890
Empiretermite@yahoo.com

Date: 09/29/2023

Report Number: 16233

Invoice Number: 16233-1

Escrow Number:

Property 26669 Modoc
Inspected: Lake Arrowhead, CA 92352

Bill To: Joe Marquez

MOBILE: (909) 744-4651
RLTRjoe@gmail.com

Inspection: \$	95.00
Invoice Total: \$	95.00
Payments: \$	0.00
Total Due: \$	95.00

Description of Service

RETURN THIS COPY WITH REMITTANCE
THANK YOU FOR YOUR BUSINESS