


America's Premier Property Inspection Company!

HOME INSPECTION REPORT

952 S Walnut St, Anaheim, CA 92802

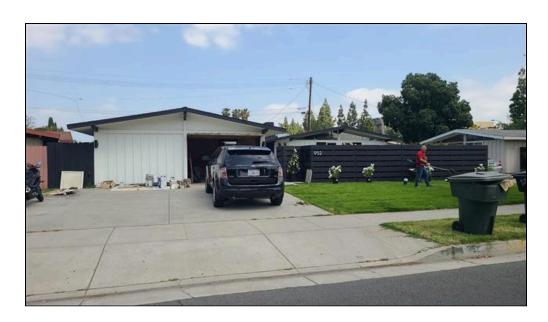

Prepared for: Oanh Nguyen

Inspection Date: 4/25/2023

Report Number: 20230425-952-S-Walnut-St

Real Estate Agent: Katie Reid Home Inspector: David Nguyen

morrisoninspects.com/downey/

General Summary



Morrison Plus Property Inspections

350 Linares Ave. Long Beach, CA 90804 1 (714) 287-9994

> **Customer** Oanh Nguyen

Address 952 S Walnut St Anaheim CA 92802

The following items or discoveries indicate that these systems or components do not function as intended or adversely affects the habitability of the dwelling; or appear to warrant further investigation by a specialist, or requires subsequent observation. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function, efficiency, or safety of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roof Coverings

1.1 ROOF VENTS & PENETRATIONS

Recommendation

(1) Penetration is incorrectly flashed/sealed at front and water staining observed at the sheathing in that area. Recommend correcting/repair.

2. Attic Space

2.1 CONDITION OF FRAMING & SHEATHING

Recommendation

- Frass observed. Recommend further review by a termite specialist.
- 2.3 ROOF VENTILATION (Gables, eaves, fans)

Recommendation

Torn screens observed at the vents. Recommend repair.

3. Exteriors and Grounds

3.0 WALKWAYS AND DRIVEWAYS

952 S Walnut St Page 2 of 52

Nguyen

Recommendation

Displacement observed at walkway(s) at rear. Recommend repair.

3.1 WALL CLADDINGS

Recommendation

(1) Inadequate clearance observed between the wall cladding and the grade at a number of areas. Deterioration observed at front. Recommend pulling back the mulch/soil and correcting/repair.

3.2 TRIM, EAVES & FASCIA

Recommendation

Deterioration observed at the eave(s) in areas. Recommend further evaluation by a qualified termite specialist.

3.3 GRADING/DRAINAGE & PLANTERS

Recommendation

Inadequate grade drainage observed at garage, front, rear and sides. Regarding, filling low lying areas or adding alternative means of drainage is recommended to assure all water drains away from the foundation and exterior walls.

4. Garage

4.1 WALLS, CEILINGS & VENTILATION

Recommendation

Water staining observed at the front wall/shear wall.. See grade drainage comments in the exterior section of this report.

5. Electrical System

5.3 BRANCH WIRING & GROUNDING

Recommendation

Open junction box observed at right side (exterior). Recommend correcting.

5.4 OUTLETS & GFCI (Interior/Exterior)

Recommendation

(1) Ground fault circuit interrupter(s) is not installed at garage. Recommend installing.

6. Plumbing System

6.0 WATER SOURCE

Recommendation

(2) Water meter crock was flooded at time of inspection. Recommend contacting the utility for repair.

6.5 FAUCETS, DRAINS & SHUT OFF VALVES (Functional flow & drainage)

Recommendation

- (1) P trap is incorrectly installed or installed to deep at kitchen sink. Recommend correcting.
- (2) Incorrect installation of drain piping (S-Trap) observed at hall bathroom. Recommend correcting.
- (3) Gurgling observed at the hallway bathroom toilet when a number of fixtures were in use. Recommend further review by a qualified plumber.
- (5) Faucet leaks/drips at kitchen sink water lines. Recommend repair.

952 S Walnut St Page 3 of 52

7. Water Heaters

7.4 SEISMIC STRAPS

Recommendation

Loose straps observed. Recommend correcting.

7.8 WATER HEATER COMMENTS

Recommendation

(2) Hot water temperature throughout the home is high. Recommend adjusting the temperature setting at the unit.

8. Heating and Air Conditioning Systems

8.1 HEATING CONDITION

Recommendation

(4) System did not respond to test for the gas fired furnace. System is at the end of its service life. Recommend further review by a qualified HVAC contractor.

9. Fireplaces and Chimneys

9.0 CHIMNEY STRUCTURE

Recommendation

(2) Mortar is missing in areas. Recommend repair.

9.1 CAP, FLUE & SPARK ARRESTOR

Recommendation

Spark arrestor with rain cover is not installed. Recommend installing.

9.2 FLASHING

Recommendation

Inadequate installation of flashing observed. When a chimney is wider than 30 inches, the flashing should divert water around the chimney. Recommend correcting.

9.3 FIREBOX, HEARTH & DOORS

Recommendation

Decorative insert is not secured. Recommend securing.

9.5 FIREPLACE/CHIMNEY COMMENTS

Recommendation

Decorative insert observed installed at the firebox. Recommend sealing of the chimney by a qualified chimney specialist.

10. Kitchen Appliances

10.0 DISHWASHER

Recommendation

Mission clamp observed at disposal drain line connection. Recommend installing/securing.

952 S Walnut St Page 4 of 52

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances: Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a qualified inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To David Nguyen

952 S Walnut St Page 5 of 52

Table of Contents

Cover Page	<u></u>
General Summary	2
Table of Contents	6
Intro Page	7
1 Roof Coverings	8
2 Attic Space	11
3 Exteriors and Grounds	13
4 Garage	
5 Electrical System	21
6 Plumbing System	25
7 Water Heaters	32
8 Heating and Air Conditioning Systems	37
9 Fireplaces and Chimneys	41
10 Kitchen Appliances	45
11 Interior Rooms	47
12 Thermal Enhancement	50

952 S Walnut St Page 6 of 52

Date: 4/25/2023	Time: 12:00 PM	Report ID: 20230425-952-S-Walnut-St
Property: 952 S Walnut St Anaheim CA 92802	Customer: Oanh Nguyen	Real Estate Professional: Katie Reid Keller Williams Realty

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Please note that each office is independently owned and operated. If you have any questions or concerns regarding the report, please contact the office that scheduled the inspection.

Inspected (IN) = The item, component, or unit was visually observed. If no other comments were made, then it appeared to be functioning as intended, allowing for normal wear and tear.

<u>Limited Inspection (LI)</u> = Observation of the item, component, or unit was limited by personal items, obstructions, or conditions listed during the course of the inspection.

Not Inspected (NI) = The item, component, or unit was not inspected, and no representations were made as to whether or not it was functioning as intended. The reason for not inspecting may be stated.

Not Present (NP) = The item, component, or unit was not present in the home or building.

Recommend (RC) = The item, component, or unit was not functioning as intended or needs further inspection by a qualified specialist. Items, components, or units that can be repaired to satisfactory condition may not need replacement.

Structure Type:Levels:Lot Type:Single Family Dwelling1 Story StructureSloped

Estimated Age of Home: Weather Conditions: Temperature:

Approximately 61 to 70 years of age Clear Approximately 70 to 80 degrees

Rain in last 3 days: Occupant Status: Present:

No Vacant, Staged Seller, Listing Agent

952 S Walnut St Page 7 of 52

1. Roof Coverings

(Refer to Part 2, Section 3 of the CREIA Standards of Practice) Items to be inspected: 1. Covering 2. Drainage 3. Flashings 4. Penetrations 5. Skylights. The inspector is not required to: 1. Walk on the roof surface if in the opinion of the inspector there is risk of damage or a hazard to the inspector 2. Warrant or certify that roof systems, coverings or components are free from leakage









Styles & Materials

Viewed Roof Covering From:

Fully Walked

Roof-Types:

Sloped - Gable

Number of Layers:

Plumbing Vent(s)

Gutters & Downspouts:

Not Installed

Vent Penetrations:

Heating Vent(s) Air Vent(s)

Skylight-Types:

Not Installed

Items

Roof Covering:

Asphalt Composition Shingle -Architectrual Type

Flashings:

Metal

1.0 ROOF COVERINGS

Comments: Inspected

952 S Walnut St Page 8 of 52 (1) We do our very best to inspect all readily accessible areas of the roof system. Be advised we inspect the roof for deterioration, installation methods and materials. Often times observable indication of leaking at the time of inspection are not present and therefore specifically determining if the roof leaks is beyond the scope.

(2) Abandoned satellite fasteners/hardware is bolted through the roof deck at rear. Suggest removal of the hardware and sealing of the penetration.




1.0 Item 1(Picture)

1.1 ROOF VENTS & PENETRATIONS

Comments: Recommendation

(1) Penetration is incorrectly flashed/sealed at front and water staining observed at the sheathing in that area. Recommend correcting/repair.



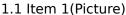



1.1 Item 2(Picture)

952 S Walnut St Page 9 of 52

- (2) ABS plumbing vents are exposed to sunlight. Suggest painting.
- (3) Rusted cap observed above the water heater/furnace. Suggest maintenance.

(4) Deteriorated sealant observed at a number of roof penetrations. Suggest re-sealing.



1.1 Item 3(Picture)

1.2 ROOF FLASHING

Comments: Inspected

1.3 GUTTERS AND DOWNSPOUTS

Comments: Not Present

The roof of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during the inspection and current weather conditions. Our inspection makes an attempt to find a leak but in most cases we are UNABLE to determine if active leaking is present, even during or immediately after precipitation. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of the roof system was made at the time of inspection, (due to roof coverings, height, slope, etc.) the client is advised to consult a qualified roofer to verify the overall condition.

952 S Walnut St Page 10 of 52

2. Attic Space

(Refer to Part 2, Section 4 of the CREIA Standards of Practice) Items to be inspected: 1. Framing 2. Ventilation 3. Insulation. The inspector is not required to: 1. Inspect mechanical attic ventilation systems or components 2. Determine the composition or energy rating of insulation materials.



Styles & Materials

Method used to observe attic:

Access Location:

Rafters (2x6)

Fully Accessed

Hallway

Ceiling Joists (2x4)

Roof & Ceiling Structure:

Insulation:

Vapor Retarder:

Air Ventilation Type:

Not Installed

Felt Paper Observed

Eave

Sheathing:

Plywood

Items

2.0 ACCESS

Comments: Inspected

2.1 CONDITION OF FRAMING & SHEATHING

Comments: Recommendation

952 S Walnut St Page 11 of 52

Frass observed. Recommend further review by a termite specialist.



2.1 Item 1(Picture)


2.2 INSULATION

Comments: Not Present

2.3 ROOF VENTILATION (Gables, eaves, fans)

Comments: Recommendation

Torn screens observed at the vents. Recommend repair.

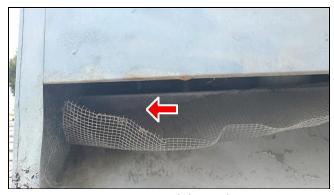

2.3 Item 1(Picture)

The attic space(s) of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Restrictive clearances, insulation or stored personal items can limited the inspection of various components in the attic space. Please be aware that the inspector has your best interests in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the components in this inspection report. If a limited evaluation of the attic space(s) was made at the time of inspection, the client is advised to consult a qualified professional to verify the overall condition.

952 S Walnut St Page 12 of 52

3. Exteriors and Grounds

(Refer to Part 4 Section 2 of the CREIA Standards of Practice) Items to be inspected: 1. Surface grade directly adjacent to the buildings 2. Doors and windows 3. Attached decks, porches, patios, balconies, stairways and their enclosures, handrails and guardrails 4. Wall cladding and trim 5. Portions of walkways and driveways that are adjacent to the buildings. The inspector is not required to: 1. Inspect door or window screens, shutters, awnings, or security bars 2. Inspect fences or gates or operate automated door or gate openers or their safety devices 3. Use a ladder to inspect systems or components









Driveway Material:

Wood Framing

Concrete Slab

Exterior Wall Structure:

Exposed Foundation:

Concrete

Styles & Materials

Lot Type: Walkway Material:

Sloped Concrete

Pavers

Exterior Wall Cladding: Trim Material:

Wood - Board and Batten Wood

Exterior Door(s) Type & Material: Exterior Window(s) Type &

Wood - Windowed **Material:** French Doors Sliding

Stationary

Fencing/Wall Material: Planters:
Wood Concrete

Items

3.0 WALKWAYS AND DRIVEWAYS

Comments: Recommendation

952 S Walnut St Page 13 of 52

Displacement observed at walkway(s) at rear. Recommend repair.



3.0 Item 1(Picture)

3.1 WALL CLADDINGS

Comments: Recommendation

(1) Inadequate clearance observed between the wall cladding and the grade at a number of areas. Deterioration observed at front. Recommend pulling back the mulch/soil and correcting/ repair.



3.1 Item 1(Picture)

(2) Gaps observed at right side penetration(s) and rear of garage. Suggest repair/sealing.







3.1 Item 3(Picture)

3.2 TRIM, EAVES & FASCIA


Comments: Recommendation

Deterioration observed at the eave(s) in areas. Recommend further evaluation by a qualified

952 S Walnut St Page 14 of 52





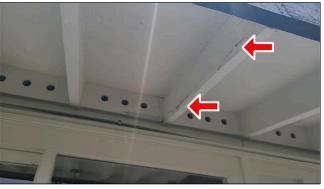


3.2 Item 1(Picture)

3.2 Item 2(Picture)

3.3 GRADING/DRAINAGE & PLANTERS

Comments: Recommendation

Inadequate grade drainage observed at garage, front, rear and sides. Regarding, filling low lying areas or adding alternative means of drainage is recommended to assure all water drains away from the foundation and exterior walls.

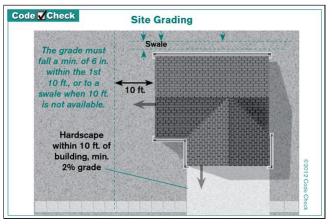



3.3 Item 2(Picture)

3.3 Item 1(Picture) Grading

3.4 EXPOSED FOUNDATION

Comments: Inspected

Concrete slab on grade construction. Houses built with a slab construction may have heating ducts, plumbing, gas, and electrical lines in the slab. We are unable to observe these conditions visually and they are excluded from the scope of this inspection. Interior floor coverings and exterior vegetation limit our view of the slab and the slab edge.

3.5 EXTERIOR DOORS

Comments: Inspected

3.6 EXTERIOR WINDOWS & FRAMES

Comments: Inspected

952 S Walnut St Page 15 of 52

(1) Safety tempered glass is not installed in areas where glass is in close vicinity to doors and grade. Original windows did not have this standard when constructed. Suggest upgrading/replacement.



3.6 Item 1(Picture)

(2) Window does not lock shut at master bedroom front window. Suggest adjusting/correcting.



3.6 Item 2(Picture)

952 S Walnut St Page 16 of 52

(3) Window treatments are not installed at both bathrooms. Suggest installing for enhanced privacy.



3.6 Item 3(Picture)

3.7 FENCING, WALLS & GATES

Comments: Inspected

(1) Leaning observed at the right side wood fencing. Suggest repair.



3.7 Item 1(Picture)

952 S Walnut St Page 17 of 52

- (2) Deterioration and weathered wood observed at wood fencing in areas. Suggest repair/maintenance.
- (3) Abandoned framing/fencing at left side; inadequate head clearances observed. Suggest removal.



3.7 Item 2(Picture)

3.8 EXTERIOR COMMENTS

Comments: Limited Inspection

Regardless of the age of the building we advise inquiring about any permits and inspection records with final signatures for the building and for any changes, remodels or additions that may have been made to the building.

The exterior of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Stored personal items, vegetation or restricted access can limited the inspection of various components of the exterior. Please be aware that the inspector has your best interests in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the components in this inspection report. If a limited evaluation of the exterior was made at the time of inspection, the client is advised to consult a qualified professional to verify the overall condition.

952 S Walnut St Page 18 of 52

4. Garage

(Refer to Part 2, Section 9 of the CREIA Standards of Practice) Items to be inspected: 1. Vehicle doors, door openers, garage interior and occupant doors. The inspector is not required to: 1. Test vehicle door safety devices



Styles & Materials

Garage Type:

Detached

Interior:

Fully Inspected

Interior Walls:

Partially Finished

Garage Door Type: Single car - manual **Garage Door Material:** Tilt-Up - Wood

Items

4.0 ROOF FRAMING & SHEATHING

Comments: Limited Inspection

4.1 WALLS, CEILINGS & VENTILATION

Comments: Recommendation

Water staining observed at the front wall/shear wall.. See grade drainage comments in the exterior section of this report.



4.1 Item 1(Picture)

4.2 FLOOR/SLAB

Comments: Inspected

Cracks observed. Suggest repair.

4.3 FIRE & SERVICE DOORS

Comments: Inspected

4.4 GARAGE DOOR

952 S Walnut St Page 19 of 52 **Comments:** Inspected

4.5 GARAGE DOOR OPERATORS

Comments: Not Present

As of July 1, 2019 all garage door openers are required to have a battery back up that is designed to operate when activated due to an electrical outage. Replacement of the garage doors connected to an automatic opener requires updating to a battery backup type. Verification of compliance is beyond the scope of this inspection. Client is advised to verify compliance and update if needed.

The garage(s) of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Stored personal items, vehicles, pets or locked access can limit the evaluation of the garage. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the garage was made at the time of inspection, the client is advised to consult a qualified professional to verify the overall condition.

952 S Walnut St Page 20 of 52

5. Electrical System

(Refer to Part 2, Section 6 of the CREIA Standards of Practice) Items to be inspected: 1. Service equipment 2. Electrical panels 3. Circuit wiring 4. Switches, receptacles, outlets and lighting fixtures. The inspector is not required to: 1. Operate circuit breakers or circuit interrupters 2. Remove cover plates 3. Inspect de-icing systems or components 4. Inspect private or emergency electrical supply systems or components.



Styles & Materials

Electrical Service Entrance:

Overhead Service

Main Disconnect Location:

Front

Branch Circuit Wiring Type:

Non-Metallic Sheathed

Single Strand

Conduit

BX Cable

Low Voltage Wiring

Not Visible

Smoke & Carbon Monoxide

Detectors:

Installed

Main Service Voltage:

120/240 Volts

Main Panel Manufacturer:

Siemens

and 20 amp):

Copper

Main Disconnect Amperage:

200 AMP

Overload Protection Type:

Circuit breakers

Branch Circuit Wiring Material (15 Grounding Location(s):

2 - Locations found Water supply piping

Grounding rod

Security System:

Not Installed

Items

5.0 MAIN SERVICE ENTRANCE, WIRING & CONNECTIONS

Comments: Inspected


5.1 MAIN PANEL & SUB PANEL(S)

Comments: Inspected

5.2 MAIN DISCONNECT & OVERLOAD PROTECTION (Breakers/Fuses)

Comments: Inspected

952 S Walnut St Page 21 of 52 Arc fault circuit interrupter protection is not installed on all branch circuits. Suggest installing.

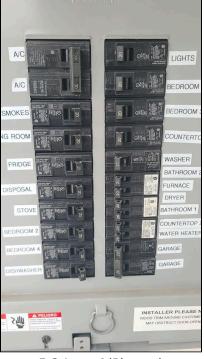

5.2 Item 1(Picture)

5.3 BRANCH WIRING & GROUNDING

Comments: Recommendation

Open junction box observed at right side (exterior). Recommend correcting.



5.3 Item 1(Picture)

5.4 OUTLETS & GFCI (Interior/Exterior)

Comments: Recommendation

952 S Walnut St Page 22 of 52

(1) Ground fault circuit interrupter(s) is not installed at garage. Recommend installing.



5.4 Item 1(Picture)

(2) Loose outlet(s) observed at kitchen. Suggest securing.



5.4 Item 2(Picture)

5.5 LIGHT FIXTURES, CEILING FANS & DOOR BELL (Interior/Exterior)

Comments: Limited Inspection

(1) A number of exterior lights are on timers/sensor equipment. These low voltage systems are beyond the scope of this inspection.

(2) Missing light fixture cover at master bedroom. Suggest replacement.



5.5 Item 1(Picture)

5.6 SMOKE & CARBON MONOXIDE DETECTORS

Comments: Limited Inspection

952 S Walnut St Page 23 of 52

Testing of smoke and carbon monoxide detectors is beyond the scope of this inspection. The client is advised to have all smoke and carbon monoxide detectors tested annually to ensure a safe living environment.

The electrical system of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Restrictive clearances, interior/exterior finishes or stored personal items can limit the evaluation of the electrical system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the electrical system was made at the time of inspection, the client is advised to consult a qualified electrician to verify the overall condition.

952 S Walnut St Page 24 of 52

6. Plumbing System

(Refer to Part 2, Section 5 of the CREIA Standards of Practice) Items to be inspected: 1. Water supply piping 2. Drain/waste/vent piping 3. Faucets and fixtures 4. Fuel gas piping 5. Water heaters 6. Functional flow and drainage The inspector is not required to: 1. Fill any fixture with water, inspect overflow drains or drain-stops, or evaluate backflow devices, waste ejectors, sump pumps, or drain line cleanouts 2. Inspect or evaluate water temperature balancing devices, temperature fluctuation, time to obtain hot water, water circulation, or solar heating systems or components 3. Inspect whirlpool baths, steam showers, or sauna systems or components 4. Inspect fuel tanks or determine if the fuel gas system is free of leaks 5. Inspect wells or water treatment systems







Styles & Materials

Main Water Shut-Off:

Front

Right side

Drain - Waste - Vent Piping:

ABS

Cast Iron/Galvanized
Not visible

Main Gas Shut-Off Location:

Right side

Washer/Dryer Connection Location:

Hallway Interior closet

Fire Sprinkers:

Not Installed

Pressure Regulator:

Not Installed

Location of Main Line Cleanout(s):

ut(5).

Located at interior of home Extra Info : Laundry

Gas Distribution Piping:

Galvanized Steel Piping Black Steel Piping

Dryer Connection Type:

Natural Gas

Water Distribution Piping:

Copper

Cross-Linked Polyethylene PVC

Waste System:

Unable to determine waste system type - Waste system is underground

Seismic Shut Off Valve:

Not installed

Bathroom Exhaust Types:

Window(s) Fan(s)

Items

6.0 WATER SOURCE

Comments: Recommendation

952 S Walnut St Page 25 of 52

(1) Water pressure at the time of inspection was 60 static PSI. Water pressure is between the appropriate range of 40 to 80 PSI.



6.0 Item 1(Picture)

(2) Water meter crock was flooded at time of inspection. Recommend contacting the utility for repair.

6.1 WATER DISTRIBUTION PIPING

Comments: Limited Inspection

6.2 DRAIN, WASTE, VENT PIPING (Readily visible)

Comments: Limited Inspection

6.3 MAIN GAS SHUT-OFF & FUEL PIPING

Comments: Limited Inspection

- (1) A visual observation of the readily accessible gas lines was performed. Testing for gas leaks is technically exhaustive and is therefore beyond the scope of this inspection. The client is advised to verify condition of the gas lines with the gas company and or a qualified plumber.
- (2) Seismic shut-off valve is not installed. The client is advised to check with local city ordinances, as not every city requires a shut-off valve.

6.4 WASHER & DRYER CONNECTIONS

Comments: Limited Inspection

- (1) Washer connections present. Faucet and drain not tested. Suggest verifying condition.
- (2) Washer/dryer is limited to a stackable unit. Suggest measuring prior to purchasing the

952 S Walnut St Page 26 of 52

appliances to ensure they fit into the area.



6.4 Item 1(Picture)

(3) Gas service available. Testing is beyond the scope of this inspection. Suggest verifying condition.

6.5 FAUCETS, DRAINS & SHUT OFF VALVES (Functional flow & drainage)

Comments: Recommendation

952 S Walnut St Page 27 of 52

(1) P trap is incorrectly installed or installed to deep at kitchen sink. Recommend correcting.



6.5 Item 1(Picture)

(2) Incorrect installation of drain piping (S-Trap) observed at hall bathroom. Recommend correcting.



6.5 Item 2(Picture)

952 S Walnut St Page 28 of 52

(3) Gurgling observed at the hallway bathroom toilet when a number of fixtures were in use. Recommend further review by a qualified plumber.



6.5 Item 3(Picture)


(4) Shower head in hall bathroom leaks at fitting when in operation. Suggest maintenance.



6.5 Item 4(Picture)

6.5 Item 5(Picture)

952 S Walnut St Page 29 of 52

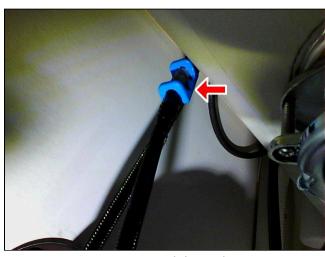

6.5 Item 6(Picture)

6.6 SINKS, SHOWERS, TUBS, TOILETS & BIDETS

Comments: Inspected

Master bathroom shower niche is not correctly sloped. Suggest correcting.

6.7 VENTILATION (Bathroom & laundry room)

Comments: Limited Inspection

6.8 YARD SPRINKLER SYSTEMS

Comments: Limited Inspection

Sprinkler system is controlled by a timing device. Timing devices are beyond the scope of this inspection. Suggest verifying systems performance.



6.8 Item 1(Picture)

952 S Walnut St Page 30 of 52

The plumbing system of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Restrictive clearances, interior/exterior finishes, lot grade or stored personal items can limit the evaluation of the plumbing system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the plumbing system was made at the time of inspection, the client is advised to consult a qualified plumber to verify the overall condition.

952 S Walnut St Page 31 of 52

7. Water Heaters

(Refer to Part 2, Section 5 of the CREIA Standards of Practice) Items to be inspected: 1. Water supply piping 2. Drain/waste/vent piping 3. Faucets and fixtures 4. Fuel gas piping 5. Water heaters 6. Functional flow and drainage. The inspector is not required to: 1. Fill any fixture with water, inspect overflow drains or drain-stops, or evaluate backflow devices, waste ejectors, sump pumps, or drain line cleanouts 2. Inspect or evaluate water temperature balancing devices, temperature fluctuation, time to obtain hot water, water circulation, or solar heating systems or components 3. Inspect whirlpool baths, steam showers, or sauna systems or components 4. Inspect fuel tanks or determine if the fuel gas system is free of leaks 5. Inspect wells or water treatment systems





Styles & Materials

Location:

Interior closet

Capacity:

40 Gallons

Date Manufactured: 2017

Manufacturer:

Rheem

Earthquake Straps:

Correct

Power Source:

Natural gas (quick recovery)

Connections:

Flexible Pipe

Items

7.0 EXHAUST VENT PIPE & COMBUSTION AIR

Comments: Limited Inspection

952 S Walnut St Page 32 of 52

(1) Transite (asbestos) pipe used for exhaust vent pipe; due to the age of the home, this may be of asbestos material. Vent pipe is not damaged.. Suggest upgrading/replacement.



7.0 Item 1(Picture)

(2) Vent pipe is not secured at fitting(s) using screws. Suggest correcting.



7.0 Item 2(Picture)

7.1 FUEL PIPING & SHUT OFF VALVE

Comments: Inspected

952 S Walnut St Page 33 of 52

Sediment trap is not plumbed on the gas line. Suggest correcting.

7.2 WATER PIPING & SHUT OFF VALVE

Comments: Inspected

7.3 TEMPERATURE/PRESSURE RELIEF VALVE & DISCHARGE LINE

Comments: Inspected

Temperature pressure relief valve is installed without a discharge line. Suggest installing.



7.3 Item 1(Picture)

7.4 SEISMIC STRAPS

Comments: Recommendation

952 S Walnut St Page 34 of 52

Loose straps observed. Recommend correcting.



7.4 Item 1(Picture)

7.5 PLATFORM/COMPARTMENT/CLOSET

Comments: Limited Inspection

Water staining observed at water heater compartment walls; stains appear to be older and dry. Suggest testing/remediation or maintenance.



7.5 Item 1(Picture)

952 S Walnut St Page 35 of 52

7.6 DRIP PAN/DRAIN LINE

Comments: Inspected

Drip pan installed without drain line. Suggest installing.

7.7 EXPANSION TANK

Comments: Not Present

7.8 WATER HEATER COMMENTS

Comments: Recommendation

(1) Water heaters should have annual maintenance performed. The client is advised to have the water heater serviced by a qualified plumber.

(2) Hot water temperature throughout the home is high. Recommend adjusting the temperature setting at the unit.



7.8 Item 1(Picture)

The water heating system of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Restrictive clearances, interior/exterior finishes, or stored personal items can limit the evaluation of the water heating system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the water heating system was made at the time of inspection, the client is advised to consult a qualified plumber to verify the overall condition.

952 S Walnut St Page 36 of 52

8. Heating and Air Conditioning Systems

(Refer to Part 2, Section 7 of the CREIA Standards of Practice) Items to be inspected: 1. Heating equipment 2. Central cooling equipment 3. Energy source and connections 4. Combustion air and exhaust vent systems 5. Condensate drainage 5. Conditioned air distribution systems. The inspector is not required to: 1. Inspect heat exchangers or electric heating elements 2. Inspect noncentral air conditioning units or evaporative coolers 3. Inspect radiant, solar, hydronic or geothermal systems or components 4. Determine volume, uniformity, temperature, airflow, balance or leakage of any air distribution system 5. Inspect electronic air filtering of humidity control systems or components









Styles & Materials

Air Conditioning Equipment Type: Air Conditioning Manufacturer:

Mini-Split System - Electric

Condenser

Serial # : Star Air Kontrol

Air Conditioning Location: Right Side

Heating Equipment Type:

Mini-Split System - Electric Heat

Pump

Heating Manufacturer:

Armstrong Air

Exterior

Serial # : Star Air Kontrol

Heating Equipment Location:

Living Room

Thermastat Locations:

Hallway

Remote control

Primary Condensate Termination: Ductwork:

Rigid

Not Visible

Cooling Differential: Heating Operation:

Greater than 15 degrees Fahrenheit

Unit provided heat

Unit did not respond to test

Items


8.0 EXHAUST VENT PIPE

Comments: Limited Inspection

8.1 HEATING CONDITION

Comments: Recommendation


952 S Walnut St Page 37 of 52 (1) Sediment trap is not plumbed on the gas line. Suggest correcting.

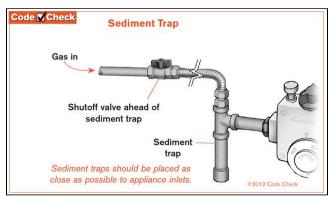

8.1 Item 1(Picture) Sediment Trap

(2) A ductless mini-split heat pump is a sealed, compressor-cycle air conditioning system that can operate in reverse. Adequate air flow is important to the efficiency of this unit, therefore, the filter should be kept clean.

(3) Mini split unit was tested using normal operating controls and provided heat at the service registers. Changing the air filters, servicing and regular maintenance of the components is necessary to prolong the service life of the system.

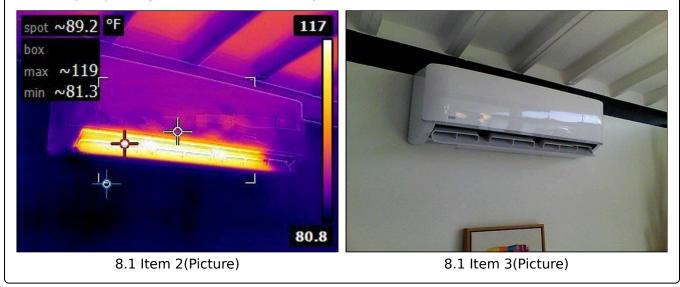

(4) System did not respond to test for the gas fired furnace. System is at the end of its service life. Recommend further review by a qualified HVAC contractor.

8.2 COOLING CONDITION

Comments: Limited Inspection

(1) A ductless mini-split is a sealed, compressor-cycle air conditioning system. Adequate air flow is important to the efficiency of this unit, therefore, the filter should be kept clean.

(2) The air conditioning system was operated using normal operation controls (thermostat). The

952 S Walnut St Page 38 of 52

difference between the return air vent and the service registers was between the recommended range of 15 to 20 degrees Fahrenheit. Changing the air filters, servicing and regular maintenance of the components is necessary to prolong the service life of the system.





8.2 Item 1(Picture)

8.2 Item 2(Picture)

(3) Exterior housing is not sealed. Suggest sealing.



8.2 Item 3(Picture)

8.3 CONDENSATE REMOVAL

Comments: Inspected

8.4 PLATFORM/COMPARTMENT/CLOSET

Comments: Inspected

8.5 THERMOSTATS & AUTOMATIC SAFETY SWITCHES

Comments: Inspected


952 S Walnut St Page 39 of 52

8.6 DUCTING & PLENUMS

Comments: Limited Inspection

(1) Unable to inspect all ductwork. Ducts may be concealed or installed in an inaccessible area. The buyer is advised to verify the overall condition of the ducting with a qualified HVAC contractor.

(2) While asbestos and other chemical testing is beyond the scope of this inspection, my experience leads me to suspect the central air ducting may contain asbestos. Suggest verifying condition with a qualified HVAC contractor.

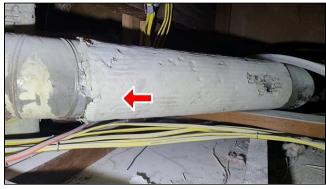

8.6 Item 1(Picture)

8.7 AIR FILTER AND REGISTERS

Comments: Limited Inspection

The HVAC system of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Restrictive clearances, interior/exterior finishes, or stored personal items can limit the evaluation of the HVAC system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the plumbing system was made at the time of inspection, the client is advised to consult a qualified HVAC specialist to verify the overall condition.

952 S Walnut St Page 40 of 52

9. Fireplaces and Chimneys

(Refer to Part 2, Section 8 of the CREIA Standards of Practice) Items to be inspected: 1. Chimney exterior 2. Spark arrestor 3. Firebox 4. Damper 5. Hearth extension. The inspector is not required to: 1. Inspect chimney interiors 2. Inspect fireplace inserts, seals or gaskets 3. Operate any fireplace or determine if a fireplace can be safely used





Styles & Materials

Chimneys (exterior):

Masonry Construction

Viewed Chimney From:

Roof

Chimney Locations:

Front

Through Roof

Type of Fireplace:

Decorative

Fireplace Locations:

Living Room

Items

9.0 CHIMNEY STRUCTURE

Comments: Recommendation

(1) Abandoned hardware is attached to chimney. Suggest removal.



9.0 Item 1(Picture)

952 S Walnut St Page 41 of 52

(2) Mortar is missing in areas. Recommend repair.



9.0 Item 2(Picture)

9.1 CAP, FLUE & SPARK ARRESTOR

Comments: Recommendation

Spark arrestor with rain cover is not installed. Recommend installing.



9.1 Item 1(Picture)

9.2 FLASHING

Comments: Recommendation

952 S Walnut St Page 42 of 52

Inadequate installation of flashing observed. When a chimney is wider than 30 inches, the flashing should divert water around the chimney. Recommend correcting.



9.2 Item 1(Picture)

9.3 FIREBOX, HEARTH & DOORS

Comments: Recommendation

Decorative insert is not secured. Recommend securing.



9.3 Item 1(Picture)

9.4 DAMPERS

Comments: Not Inspected

Locking device is not installed at damper. Recommend installing.

9.5 FIREPLACE/CHIMNEY COMMENTS

Comments: Recommendation

Decorative insert observed installed at the firebox. Recommend sealing of the chimney by a

952 S Walnut St Page 43 of 52

qualified chimney specialist.

The fireplace and chimney of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roofing materials, height, or stored personal items can limit the evaluation of the fireplace and chimney. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the fireplace and chimney was made at the time of inspection, the client is advised to consult a qualified fireplace specialist to verify the overall condition.

952 S Walnut St Page 44 of 52

10. Kitchen Appliances

(Refer to Part 2, Section 9 of the CREIA Standards of Practice) Items to be inspected: Permanently installed cook-tops, mechanical range vents, ovens, dishwashers, and food waste disposals. The inspector is not required to: 1. Operate or evaluate the condition of any non-fixed appliances or added appliances (refrigerators, trash compactors, water purification systems etc.)









Styles & Materials

Exhaust Hood Brand:

Unable to determine

Dishwasher Brand:

Frigidaire

Not Installed

Disposal Brand:

In-Sink Erator Installed

Stove/Oven Brand(s): Microwave Brand:

General Electric

Items

10.0 DISHWASHER

Comments: Recommendation

Mission clamp observed at disposal drain line connection. Recommend installing/securing.



10.0 Item 1(Picture)

952 S Walnut St Page 45 of 52

10.1 STOVE/OVEN

Comments: Inspected

10.2 EXHAUST FAN/HOOD

Comments: Limited Inspection

10.3 DISPOSAL

Comments: Inspected

10.4 MICROWAVE

Comments: Not Present

10.5 REFRIGERATOR

Comments: Not Present

10.6 APPLIANCE COMMENTS

Comments: Limited Inspection

A visual observation and basic function testing of the appliances was performed and run in normal modes only. The client is advised to verify condition of all modes and functions.

The kitchen appliances were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Interior finishes, or stored personal items can limit the evaluation of the kitchen area. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the kitchen was made at the time of inspection, the client is advised to consult a qualified professional to verify the overall condition.

952 S Walnut St Page 46 of 52

11. Interior Rooms

(Refer to Part 2, Section 9 of the CREIA Standards of Practice) Items to be inspected: 1. Walls, ceilings, floors 2. Doors and windows 3. Stairways, handrails and guardrails 4. Permanently installed cabinets 5. Absence of smoke or carbon monoxide alarms. The inspector is not required to: 1. Inspect door, window or floor coverings 2. Determine whether a building is secure from unauthorized entry 3. Operate, test or determine the type of smoke or carbon monoxide alarms


















952 S Walnut St Page 47 of 52





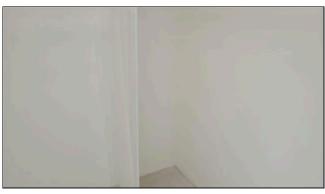



Interior Door Type:

Solid core wood



Styles & Materials

Flooring Material Type:

Tile

Vinyl or Linoleum

Cabinet Material Type:

Wood

Walls & Ceiling Material Type:

Drywall/Sheetrock

Buttonboard

Counter Type:

Quartz

Items

11.0 FLOORS

Comments: Limited Inspection

11.1 WALLS & CEILINGS

Comments: Limited Inspection

11.2 INTERIOR DOORS

Comments: Inspected

11.3 INTERIOR CLOSETS

Comments: Inspected

11.4 CABINETS & COUNTERTOPS

952 S Walnut St Page 48 of 52

Comments: Inspected

The interior of the property was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Interior finishes, or stored personal items can limit the evaluation of the interior areas. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further evaluation or repair issues as it relates to the comments in this inspection report. If a limited evaluation of any area of the interior was made at the time of inspection, the client is advised to consult a qualified professional to verify the overall condition. The identification of toxic materials, asbestos, formaldehyde, lead, "Chinese" drywall, mold or other environmental hazards or conditions is beyond the scope of a home inspection and can only be made in a laboratory. If concerned, a qualified industrial hygienist should be consulted. Many products used in construction may contain materials that can be toxic/hazardous. Formaldehyde, lead and asbestos are the most well-known, but other chemicals can be found in varying amounts. While the use of some of these materials has decreased since the late 1970s; they may still be found, particularly in products imported from overseas. Further evaluation by sampling of suspect material for undesirable or toxic substances by a qualified testing laboratory would be prudent. I suggest reading the publication: "Buyers Guide to Earthquake Safety & Environmental Hazards" available at: http://www.propertyid.com/govbooklets/govenviro.pdf

952 S Walnut St Page 49 of 52

12. Thermal Enhancement





Styles & Materials

Locations Scanned:

Main Electrical Panel Kitchen Bathroom(s) Water Heater(s) Laundry Area

Grooming Area

Outside Temperature:

71 to 80 F


Indoor Temperature:

71 to 80 F

Items

12.0 MAIN & SUB PANELS

Comments: Limited Inspection

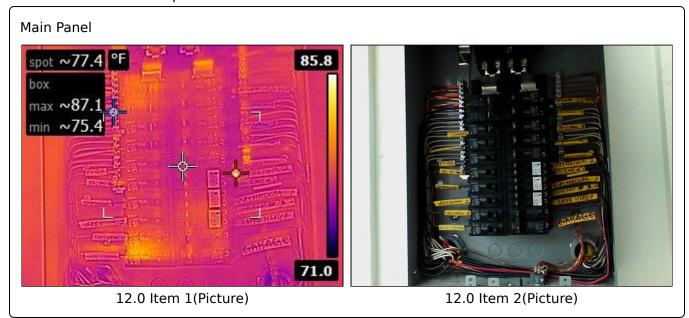


12.1 OUTLETS & LIGHT FIXTURES

Comments: Limited Inspection

12.2 WATER HEATER AREA

Comments: Limited Inspection

952 S Walnut St Page 50 of 52

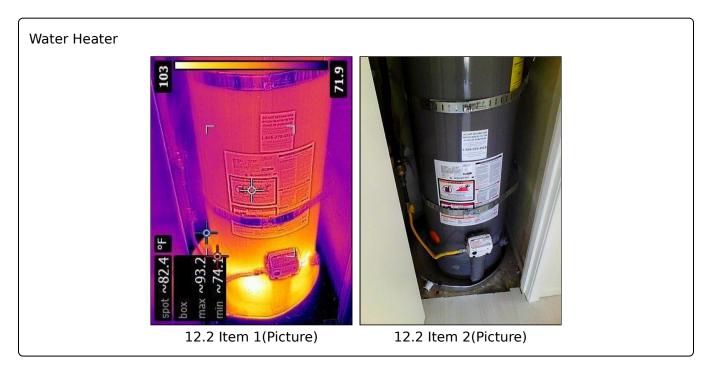

12.3 KITCHEN AREAS


Comments: Limited Inspection



12.4 BATHROOM AREAS


Comments: Limited Inspection

952 S Walnut St Page 51 of 52

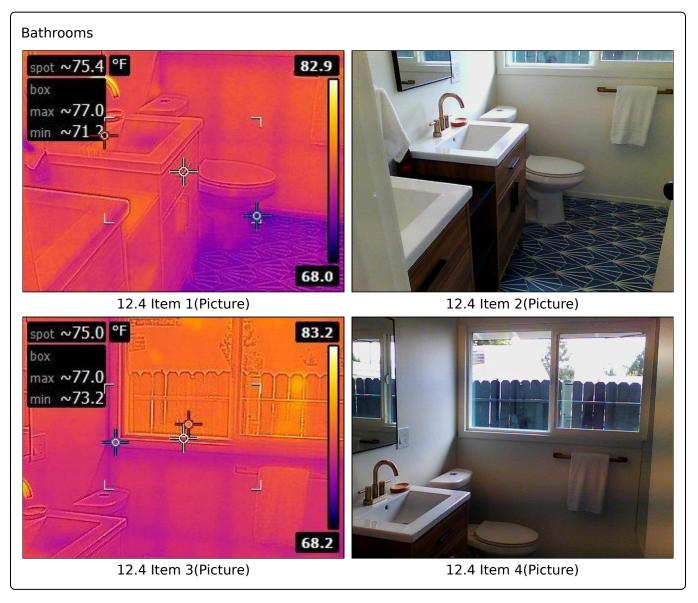

12.5 THERMAL COMMENTS

Comments: Limited Inspection

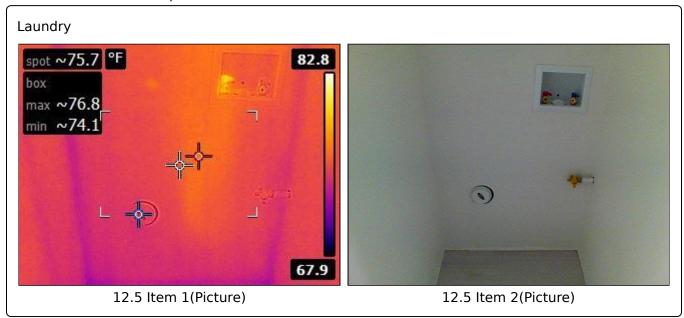

952 S Walnut St Page 52 of 52