



PACIFIC CREST HOME INSPECTIONS

858-386-3204

info@pchinspections.com

<https://www.pacificcresthomeinspections.com>



INSPECTION REPORT BY PACIFIC CREST INSPECTIONS

937 Westport Ln
Vista, CA 92084

Chad Baker
08/31/2026



Inspector

Andrew Powell

InterNACHI Certified Master Inspector

858-386-3099

andrew@pchinspections.com



Agent

Jeff Underdahl

eXp Realty

(760)271-8772

jeff@jeffunderdahl.com

TABLE OF CONTENTS

1: Inspection Details	10
2: Service Disconnects	12
3: Built-In Appliances	15
4: Plumbing System	18
5: Electrical System	26
6: Interiors	29
7: Garage	35
8: Insulation and Ventilation	38
9: Roofing	40
10: Exterior	43
11: Structural Components	46
12: Heating Equipment	48
13: Cooling Equipment	51
14: Chimney, Fireplace, or Stove	53
15: General Pictures	54
Standards of Practice	59

Thank you for choosing Pacific Crest Home Inspections! We appreciate the trust you have placed in us and are proud to be a part of your home buying experience. Please take the time to review the entire inspection report. A lot of pride and effort goes into each home inspection, and we want you to take as much information away from this process as possible. If you have any questions regarding this report please contact us at your earliest convenience so that we may assist you.

www.PacificCrestHomeInspections.com

PLEASE BE ADVISED:

This inspection report is the exclusive and sole property of **Pacific Crest Home Inspections** and the Clients who's name appears in the Inspection Details Section of this report labeled **Client**.

Unauthorized reproduction and/or distribution of this report is strictly prohibited.

Subsequent buyers, real estate agents and/or sellers assume full responsibility for giving this inspection report to anyone who does not have a signed contract or written agreement with Pacific Crest Home Inspections. Due to the natural aging process of the materials used in constructing a home, and the normal wear and tear on the mechanical items in the home, **THIS REPORT CAN ONLY REFLECT OBSERVATIONS MADE ON THE DAY OF THE INSPECTION**. Subsequent buyers should have a new inspection performed to protect their interests.

Inspectors working for Pacific Crest Home Inspections inspect properties in accordance with the Standards of Practice of the International Association of Certified Home Inspectors and our inspection agreement which are listed on our website. Items that are excluded (not inspected) are indicated in the contract and/or disclaimed in the aforementioned [Standards of Practice](#). **The observations and opinions expressed within the report take precedence over any verbal comments.** It should be understood that the inspector is only on-site for a few hours and will not comment on insignificant deficiencies, but rather, confine the observations to truly significant defects or deficiencies that significantly affect the value, desirability, habitability or safety of the structure. The Client should consider all defects identified in this inspection report as significant.

The inspection shall be limited to those specific systems, structures and components

that are present and accessible. Components and systems shall be operated with normal user controls, and not forced or modified to work. Those components or systems that are found not to work at time of inspection will be reported, and those items should be inspected and repaired or replaced by a qualified specialist in that field. You must obtain estimates for any items noted in the report that require further evaluation or repair. **The inspector cannot know what expense would be considered significant by client, as everyone's budget is different.** It is therefore client's responsibility to obtain quotations prior to the end of the contingency period. . This is very important, as once you pass the contingency period, or purchase the house, repairs become your sole responsibility. If you have questions about the significance of a repair item, call a licensed professional immediately.

The recommendations that the inspector makes in this report for specialist evaluations should be completed within the contingency period by licensed professionals, who may well identify additional defects or recommend some upgrades or replacements that could affect your evaluation of the property. We caution you to be wary of anyone who has a vested interest, and particularly those who attempt to alarm you or denigrate others.

We feel that everything in this inspection report is significant. Especially the items marked "Annotation" (A). We cannot assume liability for an item, system, or component the client did not feel was significant at time of inspection, but later feels is. For this reason, we are informing you now that when as little as one (1) "Annotation" (A) item is indicated in any portion of the inspection report, you must have that entire system further evaluated by a licensed specialist in that field before the end of your contingency period. These licensed specialist may well identify additional defects or recommend some upgrades or replacements that could affect your evaluation of the property.

Paying Pacific Crest Home Inspections for this general home inspection and written inspection report constitutes your understanding and agreeing to what has been outlined in this paragraph.

SCOPE OF WORK

You have contracted for us, Pacific Crest Home Inspections, to perform a general inspection. We performed this inspection in accordance with standards of practice established by the International Association of Certified Home Inspectors (Inter-NACHI). A copy of these standards can be obtained by visiting Standards of Practice. It is distinct from a specialist inspection, which can be costly, take several days to complete, involve the use of specialized instruments, the dismantling of equipment, video-scanning, destructive testing, and laboratory analysis. By contrast, the general inspection is completed on-site, at a fraction of the cost and within a few hours. Consequently, the general inspection and its report will not be as comprehensive as that generated by specialists and it is not intended to be. **The purpose of this inspection is to identify systems that should be further evaluated by licensed contractors who through their evaluations may identify additional material defects or adverse conditions that could result in injury or lead to costs that would significantly affect your evaluation of the property. We strongly urge you to follow our further evaluation**

recommendations as stated in the inspection report prior to the end of your contingency period to prevent issues from arising after the close of escrow.

We evaluate conditions, systems, or components, and report on their condition, which does not mean that they are ideal but that they are either functional or met a reasonable standard at a given point in time. We do take into consideration when a house was built and allow for the predictable deterioration that would occur through time, such as the cracks that appear in concrete and in the plaster around windows and doors, scuffed walls or woodwork, worn or squeaky floors, stiff or stuck windows, and cabinetry that does not function as it did when new. Therefore, we tend to ignore insignificant and predictable defects, and do not annotate them, and particularly those that would be apparent to the average person or to someone without any construction experience. We are not authorized, or have the expertise, to test for environmental contaminants, or comment on termite, dry rot or fungus, but may alert you to its presence. Similarly, we do not test the quality of the air within a residence. However, clean air is essential to good health, and we categorically recommend air sampling and the cleaning of supply ducts as a wise investment in environmental hygiene. Therefore, you should schedule any such specialized inspections with the appropriate specialist before the close of escrow.

A house and its components are complicated, and because of this and the limitations of an on-site report, we offer unlimited consultation and encourage you to ask questions. In fact, we encourage candid and forthright communication between all parties, because we believe that it is the only way to avoid stressful disputes and costly litigation. Remember, we only summarized the report on-site and it is essential that you read all of it, and that any recommendations that we make for service or evaluation by specialists should be completed and documented well before the close of escrow, because additional defects could be revealed by specialists, or some upgrades recommended that could affect your evaluation of the property, and our service does not include any form of warranty or guarantee.

If you or a family member has health problems, or you are concerned about mold, it is **YOUR** responsibility to get an air quality or mold inspection regardless of the findings in this report. Mold/Mildew testing/sampling is an optional fee-based service that is NOT included with a standard home inspection report. Pacific Crest Home Inspections performs a visual, limited mold assessment as a complementary service with each Inspection. PCHI can perform targeted sampling or air sampling as a separate service. Any reference to the presence of Musty Odors, Possible Organic Growth and/or Water Intrusion is recommended to have a professional investigation be obtained by a qualified specialist.

Definitions of Comments

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. That professional should inspect the entire system or component, as problems at one area could indicate problems at other areas of

the system. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN)= I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP)= This item, component or unit is not in this home or building.

Annotation (A)= One of the following conditions exist:

Observation Item, **Attention Item** or **Safety Concern**

Definition of Annotation Item

Observation Item = May include one or more of the following conditions:

1. Items that are cosmetic in nature or that are attributed to normal wear and/or age.
2. Items that should be monitored and may require repair.
3. Items that are functional but may require replacement due to age or condition.

Attention Item = May include one or more of the following conditions:

1. Items that do not function as intended.
2. Items that require further evaluation by qualified professionals in a specific field.
3. Items or components within a system that are not accessible or identifiable due to limitations, or restrictions within the Standards of Practice.

Safety Concern = May include the following condition:

1. Items or deficiencies that pose a potential safety hazard to the occupants or structure. These items should be further evaluated and repaired immediately by qualified personnel to ensure safety.

Note: Damage or additional items in need of repair may exist that are not identified in this inspection report and/or are beyond the scope of this home inspection, may be

discovered by the licensed contractor. This is why we strongly recommend that you seek further inspections and evaluations **BEFORE THE END OF YOUR CONTINGENCY PERIOD. We cannot and will not be responsible for your failure to follow our recommendations listed in this inspection report.**

A home inspection and its report are only describing the condition of the systems and components of this house on the day of inspection. A home inspection is not a home warranty or guarantee of any kind. Systems and components of this home may and probably will fail anytime after the inspection.

We HIGHLY recommend that you purchase and maintain a comprehensive home warranty, including coverage for your roofing, heating and air conditioning, plumbing, and electrical systems and renew it each year you own this house.

119

ITEMS INSPECTED

17

OBSERVATION ITEM

37

ATTENTION ITEM

4

SAFETY CONCERN

- 🔧 2.1.1 Service Disconnects - Main Water Shut-Off Device (Describe Location): Automatic Shut-Off
- ⚠️ 3.1.1 Built-In Appliances - Dishwasher: Rollers Missing
- ⚠️ 3.2.1 Built-In Appliances - Ranges and Cooktops: Burner Inoperable
- ⚠️ 4.3.1 Plumbing System - Fixtures and Connected Devices : Angle Stop Corroded
- ⚠️ 4.3.2 Plumbing System - Fixtures and Connected Devices : Laundry Valves Rusted
- ⚠️ 4.3.3 Plumbing System - Fixtures and Connected Devices : Sink Stopper Defect
- ⚠️ 4.3.4 Plumbing System - Fixtures and Connected Devices : Low Flow
- ⚠️ 4.4.1 Plumbing System - Tub/Shower Fixtures: Tub Diverter Servicing
- ⚠️ 4.4.2 Plumbing System - Tub/Shower Fixtures: Tub Stop Missing
- 🔧 4.5.1 Plumbing System - Plumbing Drain, Waste and Vent Systems: Previous Leak
- ⚠️ 4.5.2 Plumbing System - Plumbing Drain, Waste and Vent Systems: Leak-Sink
- 🔧 4.6.1 Plumbing System - Water Heaters, Controls, Flues and Vents: Water Heater-Replaced
- 🔧 4.6.2 Plumbing System - Water Heaters, Controls, Flues and Vents: Expansion Tank
- ⚠️ 4.6.3 Plumbing System - Water Heaters, Controls, Flues and Vents: Corrosion at Valve/Supply
- ⚠️ 4.6.4 Plumbing System - Water Heaters, Controls, Flues and Vents: Flue-Diameter Increase
- 🔧 4.6.5 Plumbing System - Water Heaters, Controls, Flues and Vents: Sediment Trap Improper
- ⚠️ 4.8.1 Plumbing System - Water Heater Strapping/Bracing : Strapping Should Encircle Tank
- ⚠️ 5.4.1 Electrical System - Branch Circuit Conductors : Open Splices General
- ⚠️ 5.5.1 Electrical System - Connected Devices and Fixtures: Lights - Inoperable
- 🔧 5.9.1 Electrical System - Operation of AFCI (Arc Fault Circuit Interrupters): Lack of Adequate Protection
- 🔧 6.2.1 Interiors - Ceilings : Patch/Paint Mis-Matched
- 🔧 6.2.2 Interiors - Ceilings : Attic Cover Damaged
- ⚠️ 6.4.1 Interiors - Floor Coverings : Carpet-Old
- 🔧 6.6.1 Interiors - Counters and a Representative Number of Cabinets: Mirror Failing
- ⚠️ 6.7.1 Interiors - Tub/Shower Enclosure: Enclosure Walls Leak
- 🔧 6.8.1 Interiors - Doors (Representative Number): Door stop
- 🔧 6.8.2 Interiors - Doors (Representative Number): Closet-plastic-floor guide
- ⚠️ 6.8.3 Interiors - Doors (Representative Number): Hardware Damaged
- ⚠️ 6.9.1 Interiors - Windows (Representative Number): Fogged or Failing Windows
- ⚠️ 6.9.2 Interiors - Windows (Representative Number): Slipped Spring

- 🔧 6.9.3 Interiors - Windows (Representative Number): Dirty
- ⊖ 6.9.4 Interiors - Windows (Representative Number): Frame Separates
- 🔧 6.9.5 Interiors - Windows (Representative Number): Damaged Window Covering
- 🔧 6.9.6 Interiors - Windows (Representative Number): Damaged/Peeling Seals
- ⊖ 6.10.1 Interiors - Attic: Wood Destroying Organisms
- ⊖ 7.2.1 Garage - Garage Ceiling/Roof Framing : Storage Racks
- ⊖ 7.2.2 Garage - Garage Ceiling/Roof Framing : Water Stains
- ⊖ 7.3.1 Garage - Garage Walls (Including Firewall Separation): Damaged Drywall
- ⊖ 7.5.1 Garage - Garage Door: Damaged Weatherstripping
- ⚠ 7.6.1 Garage - Occupant Door From Garage to Inside Home: Compromised Door
- ⚠ 7.6.2 Garage - Occupant Door From Garage to Inside Home: Gaps in Door Seal
- ⊖ 7.7.1 Garage - Garage Door Operators: Backup Battery
- ⊖ 8.1.1 Insulation and Ventilation - Insulation in Attic: Displaced Insulation
- ⊖ 8.5.1 Insulation and Ventilation - Ventilation Systems (Kitchens, Baths and Laundry): Dryer Vent
- ⊖ 9.2.1 Roofing - Roof Coverings: Slipped/Cracked Tile (Tile)
- 🔧 9.2.2 Roofing - Roof Coverings: Wear/Deterioration (General)
- ⊖ 9.3.1 Roofing - Flashings, Skylights and Roof Penetrations: Seal Penetrations (General)
- ⊖ 9.5.1 Roofing - Roof Drainage Systems: Gutter System Incomplete
- 🔧 10.2.1 Exterior - Wall Cladding, Flashing and Trim: Stucco Cracks
- ⊖ 10.2.2 Exterior - Wall Cladding, Flashing and Trim: A/C Line Voids
- ⊖ 10.4.1 Exterior - Doors (Exterior): Missing/Damaged Weather Stripping
- ⊖ 10.7.1 Exterior - Decks, Balconies, Steps, Porches, Patio Covers and Applicable Railings: Wood Damage
- ⊖ 10.9.1 Exterior - Fencing and Gates: Wood Damage
- ⊖ 12.1.1 Heating Equipment - Heating Equipment : Heater - Aged
- 🔧 12.1.2 Heating Equipment - Heating Equipment : Drip Leg
- ⊖ 13.1.1 Cooling Equipment - Cooling and Air Handler Equipment: Staining at HVAC platform
- ⊖ 13.1.2 Cooling Equipment - Cooling and Air Handler Equipment: AC Condenser Corroded
- ⊖ 13.1.3 Cooling Equipment - Cooling and Air Handler Equipment: Accumulator-Damaged/Deteriorated

1: INSPECTION DETAILS

Information

Type Of Building Single Family	Year Built (According to Available Data) 2003	Weather Conditions Sunny
Outside Temperature (Approximate) 80 Degrees	Number of Levels 2	Property Occupied Yes
Parties Present Buyer, Buyer's Agent		
It is preferred and recommended that the client be present during the inspection process. This is advised so that concerns can be discussed and addresses at the time of the inspection. It is encouraged that the client inquire about any information that is not understood or questions that arise during the inspection process or after completion of the inspection report		

What To Take Away for the Inspection?

Now that you've bought your home and had your inspection, you may still have some questions about your new house and the items revealed in your report.

Home maintenance is a primary responsibility for every homeowner, whether you've lived in several homes of your own or have just purchased your first one. Staying on top of a seasonal home maintenance schedule is important, and we can help you figure this out so that you never fall behind. Don't let minor maintenance and routine repairs turn into expensive disasters later due to neglect or simply because you aren't sure what needs to be done and when.

Your home inspection report is a great place to start. In addition to the written report, checklists, photos, and what the inspector said during the inspection not to mention the sellers disclosure and what you noticed yourself it's easy to become overwhelmed. However, it's likely that your inspection report included mostly maintenance and repair recommendations, age-related deficiencies, and general wear-and-tear notations. These are useful to know about.

But the issues that really matter fall into four categories:

1. major defects, such as a structural damage;
2. things that can lead to major defects, such as evidence of active or previous moisture issues;
3. things that may hinder your ability proceed in the transaction; and
4. safety hazards, such as Carbon Monoxide (CO) or Fire hazards.

Anything in these categories should be addressed as soon as possible. Often, a serious problem can be corrected inexpensively to protect both life and property (especially in categories 2 and 4).

Most sellers are honest and are often surprised to learn of defects uncovered during an inspection. It's important to realize that sellers are under no obligation to repair everything mentioned in your inspection report. No house is perfect. Keep things in perspective as you move into your new home.

And remember that homeownership is both a joyful experience and an important responsibility, so be sure to call on us at Pacific Crest Home Inspections to help you devise an annual maintenance plan that will keep your family safe and your home in good condition for years to come.

Schedule a Home Maintenance Inspection

Even the most vigilant homeowner can, from time to time, miss small problems or forget about performing some routine home repairs and seasonal maintenance. That's why an Annual Home Maintenance Inspection will help you keep your home in good condition and prevent it from suffering serious, long-term and/or expensive damage from minor issues that should be addressed now.

The most important thing to understand as a new homeowner is that your house requires care and regular maintenance. As time goes on, parts of your house will wear out, break down, deteriorate, leak, or simply stop working. But none of these issues means that you will have a costly disaster on your hands if you're on top of home maintenance, and that includes hiring an expert once a year.

Just as you regularly maintain your vehicle, consider getting an Annual Home Maintenance Inspection as part of the cost of upkeep for your most valuable investment; your home!

Pacific Crest Home Inspections can show you what you should look for so that you can be an informed homeowner. Protect your family's health and safety, and enjoy your home for years to come by having an Annual Home Maintenance Inspection performed every year.

Schedule next year's maintenance inspection with us today!

Every house should be inspected every year as part of a homeowner's routine home maintenance plan. Catch problems before they become major defects.

Limitations

General Inspection Info

OCCUPIED: YES

Portions of the home were not adequately visible due to occupants personal items, furniture and/or vehicles. We are not permitted to move these items as part of the inspection process. Portions of the inspection were limited as a result. We are not permitted to move these items as part of the inspection process. It is recommended that special care be taken during the final walk-through to determine if latent defects exist prior to close of escrow.

General Inspection Info

PRE-LISTING INSPECTION

This inspection was performed for the home owner selling this home and was inspected according to standards and practices. The comments made in this report were based on the condition of the home at time of inspection. There is no warranty from the inspection company. For a fee, our company can return and review the inspection, or inspect the home again. The proposed buyer can hire a different inspector if desired. Different inspectors can find different things sometimes on the same home. My inspection company is not responsible for any discoveries included or not found. As this inspection report ages, the condition of this home and its components can change.

2: SERVICE DISCONNECTS

		IN	NI	NP	A
2.1	Main Water Shut-Off Device (Describe Location)				X
2.2	Main Gas Shut Off Valve (Describe Location)	X			
2.3	Main and Distribution Panels (Describe Location)	X			

IN = InspectedNI = Not InspectedNP = Not PresentA = Annotation

Information

**Main Water Shut-Off Device
(Describe Location): Main Water
Shut off Location**
Left Side of the Building



**Main Gas Shut Off Valve
(Describe Location): Main Gas
Shut Off Valve Location**
Left Side of the Building



**Main and Distribution Panels
(Describe Location): Main Panel
Location**
Left Exterior




Main Water Shut-Off Device (Describe Location): Shut Off Information

The water service can be shut off at the Main Water Shut Off Valve listed at the location above. There two primary types of valves:

1. Ball Valve. This valve operates by turning a lever. Turning the valve "Perpendicular" to the pipe will secure the water supply to the home.
2. Gate Valve. This valve operates like a hose bib. Turning this valve clockwise will secure the water supply to the home.

There is typically a "Owner Shut Off" located at the water meter at the front curb. This valve is often not adequately accessible and should only be used if operation of the Main Water Shut off is not possible.

It is advised that you consult a licensed plumbing contractor for assistance if not operating in an emergency situation. It is recommended that the disconnect only be operated by the service provider or a Licensed Plumbing Contractor unless an emergency situation does not permit this. Below you will find an image with information for your convenience:

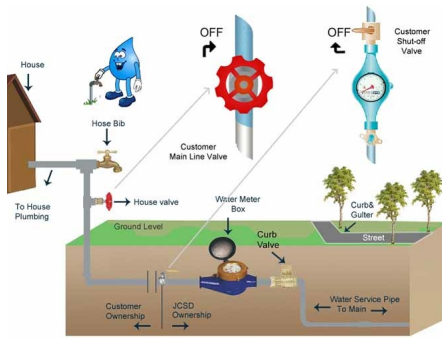

Main Gas Shut Off Valve (Describe Location): Shut Off Information

The main gas shut off valve can be operated utilizing an approved emergency shut off wrench. A wrench is typically necessary to operate this valve. It is recommended that the valve only be operated by the service provider unless an emergency situation does not permit this. Below you will find a link with further information for your convenience:

[SDGE Reference for Emergency Shut Off](#)

Main and Distribution Panels (Describe Location): Shut Off Information

The main electrical service can be shut off at the Main Service Entrance listed at the location above. Each electrical panel is different, but most panels have a clearly labeled "Service Disconnect" or "Main Shut Off". The breaker can be operated under emergency conditions. It is advised that you consult a licensed electrical contractor for assistance if not operating in an emergency situation. It is recommended that the disconnect only be operated by the service provider or a Licensed Electrical Contractor unless an emergency situation does not permit this. Below you will find a link with further information for your convenience:

[SDGE Reference for Emergency Shut Off](#)

Observations

2.1.1 Main Water Shut-Off Device (Describe Location)



AUTOMATIC SHUT-OFF

The subject property is not currently equipped with an automatic water shut off valve. Many insurance companies are requiring these valves to be installed in order to buy the policy. This is not a current building requirement. This is for your information. Recommend contacting your insurance provider to verify if installation is necessary and have installed by a licensed plumbing contractor as needed.

Recommendation

Contact a qualified professional.



3: BUILT-IN APPLIANCES

		IN	NI	NP	A
3.1	Dishwasher				X
3.2	Ranges and Cooktops				X
3.3	Exhaust Fan/Range Hood/Downdraft	X			
3.4	Wall Oven	X			
3.5	Garbage Disposer	X			
3.6	Built-In Microwave	X			
3.7	Refrigerator		X		
3.8	Washer/Dryer		X		

IN = Inspected

NI = Not Inspected

NP = Not Present

A = Annotation

Information

Dishwasher

Whirlpool

Range

-Gas-, Whirlpool

Exhaust/Range Hood

-Built into Microwave-, Whirlpool

Disposer

In Sink Erator

Built-in Microwave

Whirlpool

Oven

-Gas-, Whirlpool

Home Warranty

This inspection is intended to represent the condition of the appliances at the time of the inspection. It is common for appliance issues to arise in homes that are in the transition process. Damage can occur during the move-in/move-out process, appliances that are accustomed to frequent operation can seize due to inactivity(or fail entirely) and latent defects can become apparent once personal items are removed. It is recommended that you obtain and maintain a thorough **Home Warranty** to guard against these unforeseen conditions.

Dishwasher: Dishwasher Test

We test the dishwasher to introduce a load on the plumbing drain and waste system. We do not use soap. It is not intended to determine how well the dishwasher will clean dishes. Please note that we cannot see behind or below the dishwasher. Past and/or current leaks can occur behind or below the dishwasher that would not be visible without removing the dishwasher. Doing so is outside the scope of this inspection. It is recommended that you obtain and maintain a home warranty program to safeguard against any future issues.

Ranges and Cooktops: Thermal Image Showing Operation

Infrared picture of range/cooktop in operation. This image shows function of the operable range burners.



Wall Oven: Thermal Image Showing Operation

Infrared picture of oven in operation. This image shows function of the operable oven heat source.



Built-In Microwave : Picture of Microwave During Operation

The operation of the microwave was tested using a microwave tester. This unit appeared functional at the time of inspection.



Limitations

General Appliance Information

BUILT-IN APPLIANCE INSPECTION LIMITATIONS

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

General Appliance Information

APPLIANCES NOT MOVED

Our company cannot inspect behind or beneath built-in appliances. We cannot move them to see behind or beneath them. We cannot see through any appliance or building materials. Damage that may include but not limited to; moisture damage, wood destroying organism damage, mold or other environmental hazards, to the floor and wall behind the built-in appliances can be present and not reported on because of this limitation. You may wish to ask the sellers to disclose any known and unknown defects that may exist behind or below the built-in appliances in this home. You may also wish to have them moved to view these areas for yourself before the close of escrow.

Refrigerator

REFRIGERATOR NOT INSPECTED

Refrigerators are not inspected because they are outside the scope of a standard home inspection.

Washer/Dryer

WASHER/DRYER NOT INSPECTED

Clothes washer and dryer were not tested nor inspected. Testing these units is outside the scope of a standard home inspection.

Observations

3.1.1 Dishwasher



ROLLERS MISSING

The dishwasher trays were noted missing rollers. Advise correction to allow for proper operation.

Recommendation

Contact a qualified appliance repair professional.



3.2.1 Ranges and Cooktops



BURNER INOPERABLE

One or more burner was inoperable or did not function properly at the time of the inspection. Unable to determine the exact cause. Recommend further evaluation and servicing/repair by a licensed appliance contractor.

Recommendation

Contact a qualified appliance repair professional.



4: PLUMBING SYSTEM

		IN	NI	NP	A
4.1	Plumbing General	X			
4.2	Plumbing Water Supply and Distribution System	X			
4.3	Fixtures and Connected Devices				X
4.4	Tub/Shower Fixtures				X
4.5	Plumbing Drain, Waste and Vent Systems				X
4.6	Water Heaters, Controls, Flues and Vents				X
4.7	Temperature and Pressure (T&P) Relief Valve	X			
4.8	Water Heater Strapping/Bracing				X
4.9	Water Pressure	X			
4.10	Gas Storage and Distribution Systems (Interior Fuel Storage, Piping, Venting, Supports, Leaks)	X			
4.11	Correct Plumbing at Faucets(Hot Left, Cold Right)	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Water Source

Public

Plumbing Supply

Copper

Plumbing Distribution

Copper, Partially Visible

Washer Drain Size

2" Diameter

Plumbing Waste

ABS, Partially Visible

Water Heater Fuel Source

Natural Gas

Water Heater Flue Pipe Material

Double Wall Metal, Flexible Metal

Capacity

50 GALLONS

Year Water Heater Was Made

2017

Manufacturer

Bradford-White

Water Pressure

75-80 psi (normal)

Gas Distribution Piping

Rigid Iron Pipe

Plumbing Drain, Waste and Vent Systems: Cleanout Location

Driveway



Water Heaters, Controls, Flues and Vents: Picture of Water Heater



Water Heaters, Controls, Flues and Vents: Thermal Image Showing Operation

Thermal image showing production of hot water at the sink location.



Water Pressure: Water Pressure Normal

Water pressure was noted within normal operation parameters.



Plumbing General : Plumbing-General

A majority of the plumbing supply, distribution, drain, waste, and vent systems were concealed behind the flooring, buried in the slab, routed through the attic below the insulation or in inaccessible sections of the attic or crawlspace and were not visible at the time of the inspection. Our inspection of the plumbing system is non-intrusive and non-destructive and only included the visibly accessible components of the plumbing system. The purpose of this inspection is to identify systems that should be further evaluated by licensed contractors. These licensed contractors may find additional issues that need to be addressed that are not included or reported on in this report. Our inspection is not to be confused with a specialist further evaluation and is not intended to be technically exhaustive nor a substitute for a specialist inspection or further evaluation. You, as the homeowner, should purchase a **homeowner insurance policy** and **home warranty** that covers the plumbing system in the event problems develop in this system.

Plumbing General : Plumbing General Continued...

The plumbing system is typically the most all-encompassing system in any given property. In most homes, the plumbing system contains the largest number of single defects of any system in the inspection report. It is recommended that, as part of the disclosure process, you request any and all information pertaining to past plumbing repairs, leaks/moisture-related issues, and plumbing-related maintenance. In addition, it is strongly advised that you consult with a licensed plumbing contractor regarding any disclosures and deficiencies in this inspection report **prior to the removal of your contingencies**. If there are any questions regarding the statements made in this section of the report, please don't hesitate to contact Pacific Crest Home Inspections for clarification.

Limitations

Plumbing General

PLUMBING INSPECTION LIMITATIONS

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain lines, for example, cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fail under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Plumbing Water Supply and Distribution System

GENERAL PLUMBING LIMITATIONS

Please note: due to wall coverings, insulation, HVAC ductwork, buried lines or other obstructions, it was not possible to observe the entire water supply and distribution system throughout this entire home. Damage to the piping can be present in a non-visible location. You may wish to have the water supply and distribution system further explored by a licensed plumber contractor before the end of your contingency period to determine if any latent defects exist.

Gas Storage and Distribution Systems (Interior Fuel Storage, Piping, Venting, Supports, Leaks)

GENERAL GAS SUPPLY AND DISTRIBUTION LIMITATIONS

Please note: due to wall coverings, insulation, HVAC ductwork, buried lines or other obstructions, it was not possible to observe the entire gas supply and distribution system throughout this entire home. Damage to the piping can be present in a non-visible location. You may wish to have the gas supply and distribution system further explored by a licensed plumber contractor before the end of your contingency period to determine if any latent defects exist.

Observations

4.3.1 Fixtures and Connected Devices

ANGLE STOP CORRODED

VARIOUS LOCATIONS



Some of the angle stops/shut off valves and/or supply lines under the sinks or behind the toilets are corroding, have mineral deposits or are rusted. This may be indicative of previous possible leaks. The valve appeared dry at the time of the inspection. The valves are not operated as part of the home inspection process in order to prevent possible damage. These valves are typically recommended for replacement every 10 years. Recommend consulting a licensed plumbing contractor to verify proper operation and determine if corrections are needed at this time.

Recommendation

Contact a qualified plumbing contractor.



Half Bathroom



Hall Bathroom



Master Bathroom



Master Bathroom

4.3.2 Fixtures and Connected Devices

LAUNDRY VALVES RUSTED

LAUNDRY

Corrosion was noted at the laundry valves at the washing machine connection. These valves are prone to leaks due to the lack of periodic operation. It is typically recommended that these valves be replaced with the installation of the new appliances. Recommend consulting a licensed plumbing contractor to determine if such replacement is needed.

Recommendation

Contact a qualified plumbing contractor.



Attention Item



Laundry

4.3.3 Fixtures and Connected Devices

SINK STOPPER DEFECT

VARIOUS LOCATIONS

Several sink stoppers in the home were noted missing, inoperable or in need of adjustment. Recommend consulting a licensed plumbing contractor for necessary repairs.



Attention Item

Recommendation

Contact a qualified plumbing contractor.



Hall Bathroom



Master Bathroom

4.3.4 Fixtures and Connected Devices

LOW FLOW

HALF BATHROOM

Low water flow was noted at the faucet. Unable to determine the exact cause. You may wish to have this further evaluated by a licensed plumbing contractor.

Recommendation

Contact a qualified plumbing contractor.



Attention Item



Half Bathroom

4.4.1 Tub/Shower Fixtures

TUB DIVERTER SERVICING

HALL BATHROOM


The tub diverter did not function properly at the time of the inspection. Water sprays from shower head and tub spout at the same time. This is typically due to corrosion and or hard water build-up. Recommend further evaluation by a licensed plumbing contractor and correction as necessary.

Recommendation

Contact a qualified plumbing contractor.



Attention Item

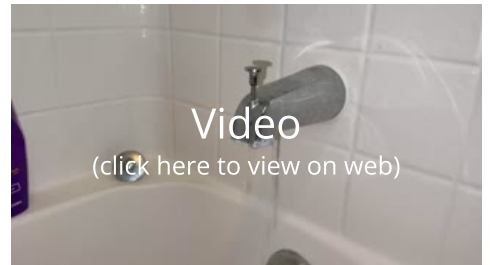

4.4.2 Tub/Shower Fixtures

TUB STOP MISSING

VARIOUS LOCATIONS

The tub stop was noted removed or missing. Recommend installation of a permanent tub stop.

Recommendation

Contact a qualified plumbing contractor.



Attention Item



Master Bathroom

4.5.1 Plumbing Drain, Waste and Vent Systems

PREVIOUS LEAK

VARIOUS LOCATIONS

Evidence of previous possible leaks were noted at the drain line below the sink. Area appeared dry at the time of the inspection. Advise monitoring and repair by a licensed plumbing contractor.

Recommendation

Contact a qualified plumbing contractor.



Observation Item



Hall Bathroom



Master Bathroom

4.5.2 Plumbing Drain, Waste and Vent Systems

LEAK-SINK

HALL BATHROOM

A leak was noted below the sink. Advise further evaluation and repair by a licensed plumbing contractor.

Recommendation

Contact a qualified plumbing contractor.



Attention Item



Hall Bathroom

4.6.1 Water Heaters, Controls, Flues and Vents

WATER HEATER-REPLACED

Observation Item

The water heater installed in this home is not original. Recommend asking the sellers for documentation showing that this unit was installed by a licensed plumbing contractor per the manufactures installation requirements. If documentation cannot be produced, I recommend this unit be further explored by a licensed plumbing contractor or SDG&E for safety.

Recommendation

Contact a qualified plumbing contractor.



MFD 2017

4.6.2 Water Heaters, Controls, Flues and Vents



Observation Item

EXPANSION TANK

An expansion tank is not installed at the water heater. This may not have been a required fixture at the time of construction. However, most water heater manufacturers recommend installation when the home's water system is a "closed" system. Recommend consulting a licensed plumbing contractor to determine if corrections are needed at this time.

Recommendation

Contact a qualified plumbing contractor.



4.6.3 Water Heaters, Controls, Flues and Vents



Attention Item

CORROSION AT VALVE/SUPPLY

Corrosion/evidence of previous possible leaks were noted at the water heater supply lines and/or valves. Advise consulting a licensed plumbing contractor to determine a complete list of necessary correction.

Recommendation

Contact a qualified plumbing contractor.



4.6.4 Water Heaters, Controls, Flues and Vents



Safety Concern

FLUE-DIAMETER INCREASE

The water heater flue pipe appears to increase in diameter. This condition can prevent proper drafting and promote Carbon Monoxide hazards. Advise further evaluation and repair by a licensed plumbing contractor for safety.

This increase in diameter can effect the drafting of the unit and is a potential CO hazard. Recommend further evaluation by a licensed plumber to determine if repairs are needed.

Recommendation

Contact a qualified plumbing contractor.



4.6.5 Water Heaters, Controls, Flues and Vents

SEDIMENT TRAP IMPROPER

The sediment trap was noted installed at the water heater side. This is not in compliance with today's building standards. Recommend correction by a licensed plumbing contractor as required.

Recommendation

Contact a qualified plumbing contractor.



Observation Item



4.8.1 Water Heater Strapping/Bracing

STRAPPING SHOULD ENCIRCLE TANK

The water heater appears to be improperly braced. Seismic strapping is required to be installed at the top and bottom 1/3 of the water heater and encircle the tank. Advise consulting a licensed plumbing contractor or qualified professional for necessary correction.

Recommendation

Contact a qualified professional.



Attention Item



5: ELECTRICAL SYSTEM

		IN	NI	NP	A
5.1	Main and Distribution Panels	X			
5.2	System Grounding and Grounding Equipment	X			
5.3	Overcurrent Devices (Circuit Breakers, Fuses)	X			
5.4	Branch Circuit Conductors				X
5.5	Connected Devices and Fixtures				X
5.6	Exterior Lighting	X			
5.7	Polarity and Ground of Receptacles	X			
5.8	Operation of GFCI (Ground Fault Circuit Interrupters)				X
5.9	Operation of AFCI (Arc Fault Circuit Interrupters)				X
5.10	Smoke Detectors	X			
5.11	Carbon Monoxide Detector	X			
5.12	Cable and Telephone Entrance	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Electrical Service Conductors

Below Ground

Panel Type

Circuit Breakers

Panel Capacity

200 AMP

Electric Panel Manufacturer

SQUARE D

Branch Wire 15 and 20 Amp

Copper

Wiring Methods

Romex

Exterior Lighting Control

Standard switched

Main and Distribution Panels: Type

Main Panel

Main and Distribution Panels: Picture of Panels

Pictures of electrical panel(s).



Operation of GFCI (Ground Fault Circuit Interrupters): GFCI INFO

Definition: A ground-fault is an unintentional electrical path between a source of electrical current and a grounded surface. Electrical shock can occur if a person comes into contact with an energized part. GFCI's (ground-fault circuit-interrupters) can greatly reduce the risk of shock by immediately shutting off an electrical circuit when that circuit represents a shock hazard (i.e., a person comes in contact with a faulty appliance together with a grounded surface). GFCI's can be installed in a circuit breaker panel board or directly in a receptacle outlet.

Operation of AFCI (Arc Fault Circuit Interrupters): AFCI INFO

Definition: When an electrical switch is opened or closed, an arc, or discharge of electricity across a circuit, occurs. Unintentional arcs can occur at loose connections or where wires or cords have been damaged. Such arcs can lead to high temperatures and sparking, possibly igniting combustibles. AFCI's (arc-fault circuit-interrupters) protect against fire by continuously monitoring the electrical current in a circuit and shutting off the circuit when unintended arcing occurs. These devices are designed to discriminate between unintended arcing and the type of arcing that occurs when a switch is operated.

Limitations

General

ELECTRICAL INSPECTION LIMITATIONS

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair and further evaluation recommendation items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Branch Circuit Conductors

ELECTRICAL INSPECTION LIMITATIONS

Please note: due to wall coverings, insulation, HVAC ductwork or other obstructions, it was not possible to observe the branch circuit wiring throughout this entire home. Damage to the insulation or wiring itself can be present in a non-visible location. You should consider having the branch circuit wiring further explored by a licensed electrical contractor before the end of your contingency period to determine if any latent defects exist.

Operation of GFCI (Ground Fault Circuit Interrupters)

NOT TESTED

Portions of the GFCI protection were not tested due to occupants personal items. Recommend verification of operation during your final walk-through.

Observations

5.4.1 Branch Circuit Conductors

OPEN SPLICES GENERAL

KITCHEN

Open wire splices were observed at one or more location. All Romex connections must be enclosed in a covered junction box that is secured to a framing member of the house. Recommend correction by a licensed electrician.



Safety Concern

Recommendation

Contact a qualified electrical contractor.



Kitchen

5.5.1 Connected Devices and Fixtures

LIGHTS - INOPERABLE

VARIOUS LOCATIONS

Several lights are inoperable or not functioning as intended. This condition may be a simple bulb replacement or minor fixture repair, but I am unable to determine the exact cause. Due to this condition, we recommend asking the seller to correct the condition and demonstrate operation or have further evaluated and repaired by a licensed electrical contractor as necessary.

Recommendation

Contact a qualified professional.



Kitchen

5.9.1 Operation of AFCI (Arc Fault Circuit Interrupters)

LACK OF ADEQUATE PROTECTION

The home is not equipped with adequate AFCI protection as per today's building requirements. Recommend retrofitting as required by a licensed electrical contractor.

Recommendation

Contact a qualified electrical contractor.



6: INTERIORS

		IN	NI	NP	A
6.1	Interior General	X			
6.2	Ceilings				X
6.3	Walls	X			
6.4	Floor Coverings				X
6.5	Steps, Stairways, Balconies and Railings	X			
6.6	Counters and a Representative Number of Cabinets				X
6.7	Tub/Shower Enclosure				X
6.8	Doors (Representative Number)				X
6.9	Windows (Representative Number)				X
6.10	Attic				X
6.11	Room Additions/Modifications	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Ceiling Materials

Sheetrock

Wall Materials

Sheetrock

Floor Covering(s)

Carpet, Tile, Vinyl Tongue and Groove

Interior Doors

Wood

Cabinetry

Wood

Kitchen Countertop

Quartz

Windows

Aluminum, Double Pane

Limitations

Interior General

GENERAL LIMITATIONS

The interior of the structure was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, equipment or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Interior General

GENERAL LIMITATIONS CONT.

Please note: Determining if damage, the presence of organic growths, moisture or wood rot behind wall, floor and ceiling coverings is beyond the scope of this inspection. If you are concerned or believe that these conditions may exist in a non-visible or concealed area, I recommend that you have this home further examined by a qualified contractor or environmental hygienist.

Attic

ATTIC LIMITED ACCESS

Due to the structure of the roof/framing, insulation and forced air handling components, some areas of the attic were not visible and could not be fully inspected.

Observations

6.2.1 Ceilings

PATCH/PAINT MIS-MATCHED

KITCHEN

Patches or evidence of repairs and/or mis-matched paint noted in areas. Unable to determine the exact cause. You may wish to ask the sellers about any repairs you are concerned about. Please note: determining if damage exist behind the walls of any surface is beyond the scope of this inspection.

Recommendation

Contact a qualified professional.



Kitchen

6.2.2 Ceilings

ATTIC COVER DAMAGED

ATTIC ENTRY

Damage was noted at the attic access cover. You may wish to view this for yourself and have repaired or replaced as desired.

Recommendation

Contact a qualified drywall contractor.



6.4.1 Floor Coverings

CARPET-OLD

VARIOUS LOCATIONS

The carpeted flooring appeared to be approaching the end of it's useful life. Recommend further evaluation by a licensed flooring contractor.

Recommendation

Contact a qualified professional.



6.6.1 Counters and a Representative Number of Cabinets

MIRROR FAILING

VARIOUS LOCATIONS

The reflective coating at one or more bathroom mirror was noted failing. The condition causes distortion and cosmetic damage. You may wish to view this for yourself and have repaired/replaced as desired.



Recommendation

Contact a qualified professional.



Master Bathroom

6.7.1 Tub/Shower Enclosure

ENCLOSURE WALLS LEAK

MASTER BATHROOM

Evidence of leaking were noted at the shower enclosure walls. Unable to determine the exact cause. Recommend cleaning/re-caulking and/or repair by qualified professional as necessary.

Recommendation

Contact a qualified professional.



Master Bathroom

6.8.1 Doors (Representative Number)

DOOR STOP

VARIOUS LOCATIONS

One or more door stop is missing/damaged. Advise repair to prevent damage to the adjacent wall.

Recommendation

Contact a qualified professional.



Garage

6.8.2 Doors (Representative Number)

CLOSET-PLASTIC-FLOOR GUIDE


VARIOUS LOCATIONS

One or more closet door floor guide appeared to be missing or damaged. This could prove to be a pinching hazard for small children. Advise repair.

Recommendation

Contact a qualified professional.



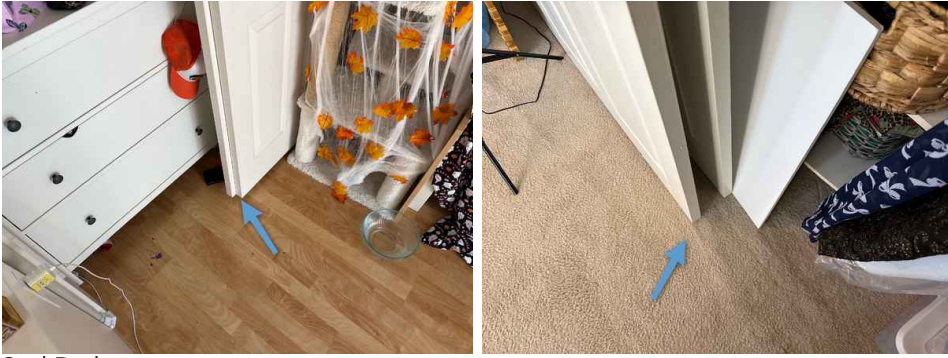

2nd Bedroom

6.8.3 Doors (Representative Number)



Attention Item


HARDWARE DAMAGED

KITCHEN

The door latch hardware was noted damaged and inoperable. Advise repair by a licensed door contractor.

Recommendation

Contact a qualified door repair/installation contractor.

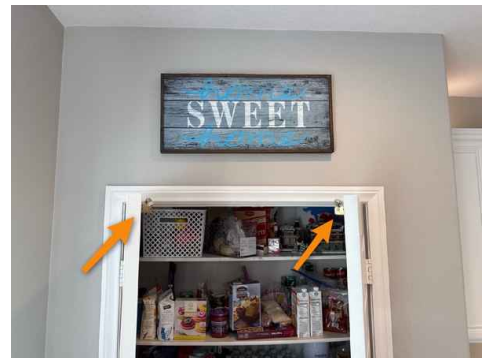

Kitchen

6.9.1 Windows (Representative Number)



Attention Item

FOGGED OR FAILING WINDOWS

BREAKFAST NOOK

Fogged windows or failing UV coatings were noted. This may be indicative of failed hermetic seals. This condition will reduce the visibility and thermal efficiency of these windows. Recommend further evaluation by a licensed window contractor to determine repairs needed at this time.

Recommendation

Contact a qualified window repair/installation contractor.



6.9.2 Windows (Representative Number)



Attention Item

SLIPPED SPRING

MASTER BATHROOM

Slipped/damaged sash balance spring noted at one or more single hung window(s). This effects the operation of the window and/or the window will not remain open. Advise further evaluation and repair by a licensed window contractor or qualified professional.

Recommendation

Contact a qualified window repair/installation contractor.



Master Bathroom

6.9.3 Windows (Representative Number)

DIRTY

Multiple windows in the home were noted dirty and in need of general cleaning and servicing. This condition obstructed visibility and limited our inspection of the hermetic seals. Advise professional cleaning and examination by a licensed window contractor to determine if latent defects exist.

Recommendation

Contact a qualified professional.



Observation Item

6.9.4 Windows (Representative Number)

FRAME SEPARATES

MASTER BATHROOM

One or more window frame was noted loose to the glass panel. This condition can expose the sharp edge of the glass and promote injury or damage. Advise consulting a licensed window contractor to determine the scope of necessary repairs.

Recommendation

Contact a qualified professional.



Attention Item



Master Bathroom

6.9.5 Windows (Representative Number)

DAMAGED WINDOW COVERING

LIVING ROOM


Damaged/missing window coverings noted. These items are beyond the scope of the home inspection. You may wish to do this for yourself and have repaired as desired.

Recommendation

Contact a qualified professional.



Observation Item

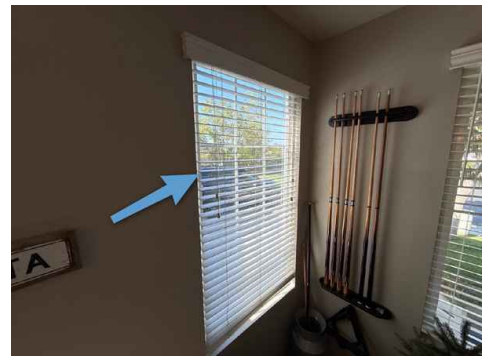

Living Room

6.9.6 Windows (Representative Number)

DAMAGED/PEELING SEALS

DINING ROOM

Damaged or peeling window seals were noted visible. This is indicative of age and use and may lead to failed seals and condensation or "fogging". Recommend further evaluation by a licensed window contractor to determine the repairs needed at this time.

Recommendation

Contact a qualified window repair/installation contractor.



Observation Item



Dining Room

6.10.1 Attic

WOOD DESTROYING ORGANISMS

Evidence of previous wood destroying organism activity noted in the attic. Recommend consulting the termite inspection report to determine repairs needed at this time.



Attention Item

Recommendation

Contact a qualified professional.

7: GARAGE

		IN	NI	NP	A
7.1	Garage General	X			
7.2	Garage Ceiling/Roof Framing				X
7.3	Garage Walls (Including Firewall Separation)				X
7.4	Garage Floor	X			
7.5	Garage Door				X
7.6	Occupant Door From Garage to Inside Home				X
7.7	Garage Door Operators				X
7.8	Garage Vents	X			

IN = Inspected

NI = Not Inspected

NP = Not Present

A = Annotation

Information

Garage Door Type

Two automatic

Garage Door Material

Metal

Auto-opener Manufacturer

GENIE

Limitations

Garage General

PERSONAL ITEMS

Due to occupants personal items, not all areas were visible. I was unable to view all the wall and floor surfaces. Damage can exist in these areas that were not visible. Because of this, I advise a careful evaluation during final walk-through. If issues are discovered during your final walk-through, Please contact your inspector immediately to arrange a reinspection of this area so that the inspection report can be updated.

Observations

7.2.1 Garage Ceiling/Roof Framing

STORAGE RACKS

Overhead storage was noted present in the garage. Storing weight on the roof structure of the garage can promote damage and sagging of the roof structure. In addition, we are unable to determine load capacity or proper installation. Recommend consulting a licensed general contractor for further evaluation to determine if corrections are needed at this time.

Recommendation

Contact a qualified professional.



Attention Item



7.2.2 Garage Ceiling/Roof Framing

WATER STAINS



Attention Item

Water/moisture staining observed at the garage ceiling/sheathing in one or more areas. Unable to determine if this is new or older staining. Recommend further review by a qualified contractor prior to the close of escrow.

Recommendation

Contact a qualified professional.



7.3.1 Garage Walls (Including Firewall Separation)



DAMAGED DRYWALL

Damage was noted at the drywall in areas. Recommend consulting a licensed drywall contractor for necessary repairs.

Recommendation

Contact a qualified drywall contractor.



7.5.1 Garage Door



DAMAGED WEATHERSTRIPPING

Damaged weatherstripping was noted at the garage door. Advise replacement by a licensed garage door contractor.

Recommendation

Contact a qualified garage door contractor.



7.6.1 Occupant Door From Garage to Inside Home



COMPROMISED DOOR

In order to comply with current fire and safety standards and regulations, fire doors must be intact and free of any alterations. This door compromises the integrity of the fire door. We advise replacement.

Recommendation

Contact a qualified door repair/installation contractor.



7.6.2 Occupant Door From Garage to Inside Home

 Safety Concern

GAPS IN DOOR SEAL

The door seal was noted damaged or missing at the garage entry door. This is considered a breach in the fire separation. Advise consulting a licensed door contractor for necessary repairs to comply with fire safety.

Recommendation

Contact a qualified door repair/installation contractor.



7.7.1 Garage Door Operators

 Attention Item

BACKUP BATTERY

The garage door opener does not appear to be equipped with a back up battery. This is a modern building requirement and is a recommended upgrade for safety. Advise consulting a licensed garage door contractor to determine cost of necessary correction.

Recommendation

Contact a qualified garage door contractor.



8: INSULATION AND VENTILATION

		IN	NI	NP	A
8.1	Insulation in Attic				X
8.2	Insulation Under Floor System		X		
8.3	Vapor Retarders (On Ground, In Crawlspace or Basement)		X		
8.4	Ventilation of Attic and Foundation Areas	X			
8.5	Ventilation Systems (Kitchens, Baths and Laundry)				X
8.6	Ventilation Fans and Controls	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Attic Insulation

Fiberglass

Floor System Insulation

Unknown/Not Visible

Ventilation

Soffit Vents, Dormer Vents

Exhaust Fans

Fan

Dryer Power Source

Gas Connection

Dryer Vent

Flexible Metal

Limitations

General

INSULATION AND VENTILATION INSPECTION LIMITATIONS

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Observations

8.1.1 Insulation in Attic

DISPLACED INSULATION

Displaced insulation noted in the attic. Advise corrections by a qualified professional to improve the thermal efficiency of the home.

Recommendation

Contact a qualified professional.



Attention Item

8.5.1 Ventilation Systems (Kitchens, Baths and Laundry)

DRYER VENT

We recommend cleaning/servicing the dryer vent upon moving into the home.



Attention Item

Recommendation

Contact a qualified professional.

9: ROOFING

		IN	NI	NP	A
9.1	Roof General	X			
9.2	Roof Coverings				X
9.3	Flashings, Skylights and Roof Penetrations				X
9.4	Roof Sheathing (As observable from attic)	X			
9.5	Roof Drainage Systems				X

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Roof Covering Concrete, Tile	Viewed roof covering from Ground, Other vantage points, Attic Space	Chimney (exterior) Stucco
--	--	-------------------------------------

Limitations

Roof General

ROOF UNDERLAYMENT INSPECTION LIMITATION

Due to lack of visibility as a result of the installed roof coverings, we are not able to inspect, evaluate or comment on the condition or installation of the roof underlayment system. Deficiencies with the underlayment can include but not limited to: premature failure, shrinkage, not installed, improper installation or physical damage. As a result of these limitations, we recommend further evaluation by a licensed roof contractor to determine if latent defects exist.

Roof General

ROOF INSPECTION LIMITATIONS

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Roof Coverings

INSPECTED FROM GROUND (UNSAFE MOUNTING CONDITIONS)



Portions of the roof covering was inspected from the ground and attic due to pitch or unsafe mounting conditions. This is in accordance with the CalNACHI standards of practice. The entire roof was not visible. I cannot guarantee that all of the roof materials, flashings, and roof penetrations are in good condition. I recommend that you have the roof inspected by a licensed roof contractor if you are concerned that there may be tiles that are broken or have slipped out of position.

Flashings, Skylights and Roof Penetrations

LIMITED INSPECTION (GENERAL)

My inspection of the roof penetrations was limited to what could be seen from our vantage points. I cannot guarantee that all the roof penetrations are in good condition. You may wish to contact a licensed roof contractor for further evaluation.

Observations

9.2.1 Roof Coverings

SLIPPED/CRACKED TILE (TILE)



Attention Item

Slipped/cracked tiles noted. The roof covering was inspected from the ground and attic to avoid damaging the roof covering, and possibly voiding the warranty. This is in accordance with the NACHI standards of practice. The entire roof was not visible, and there may be additional defects. Advise maintenance review of the entire roof and necessary corrections by a licensed roofer.



Recommendation

Contact a qualified roofing professional.

9.2.2 Roof Coverings

WEAR/DETERIORATION (GENERAL)






Observation Item

Wear and deterioration noted at roof covering due to age and sun exposure. This appears to be normal deterioration. However, prior to close of escrow we advise consulting with a licensed roofing contractor to review and give estimates of life remaining and necessary repairs to prevent leaks. This is also important because a home inspection is not a guarantee against roof leaks.

Recommendation

Contact a qualified roofing professional.

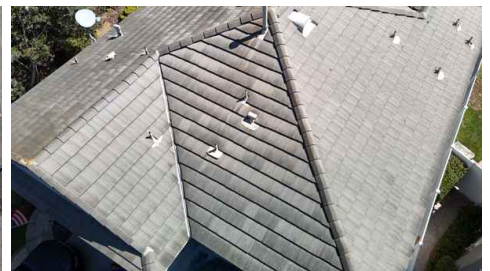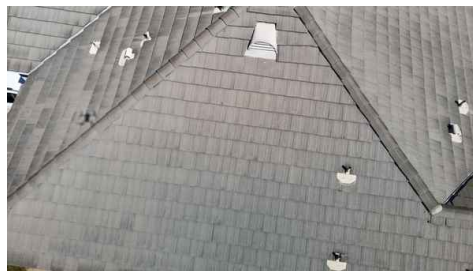

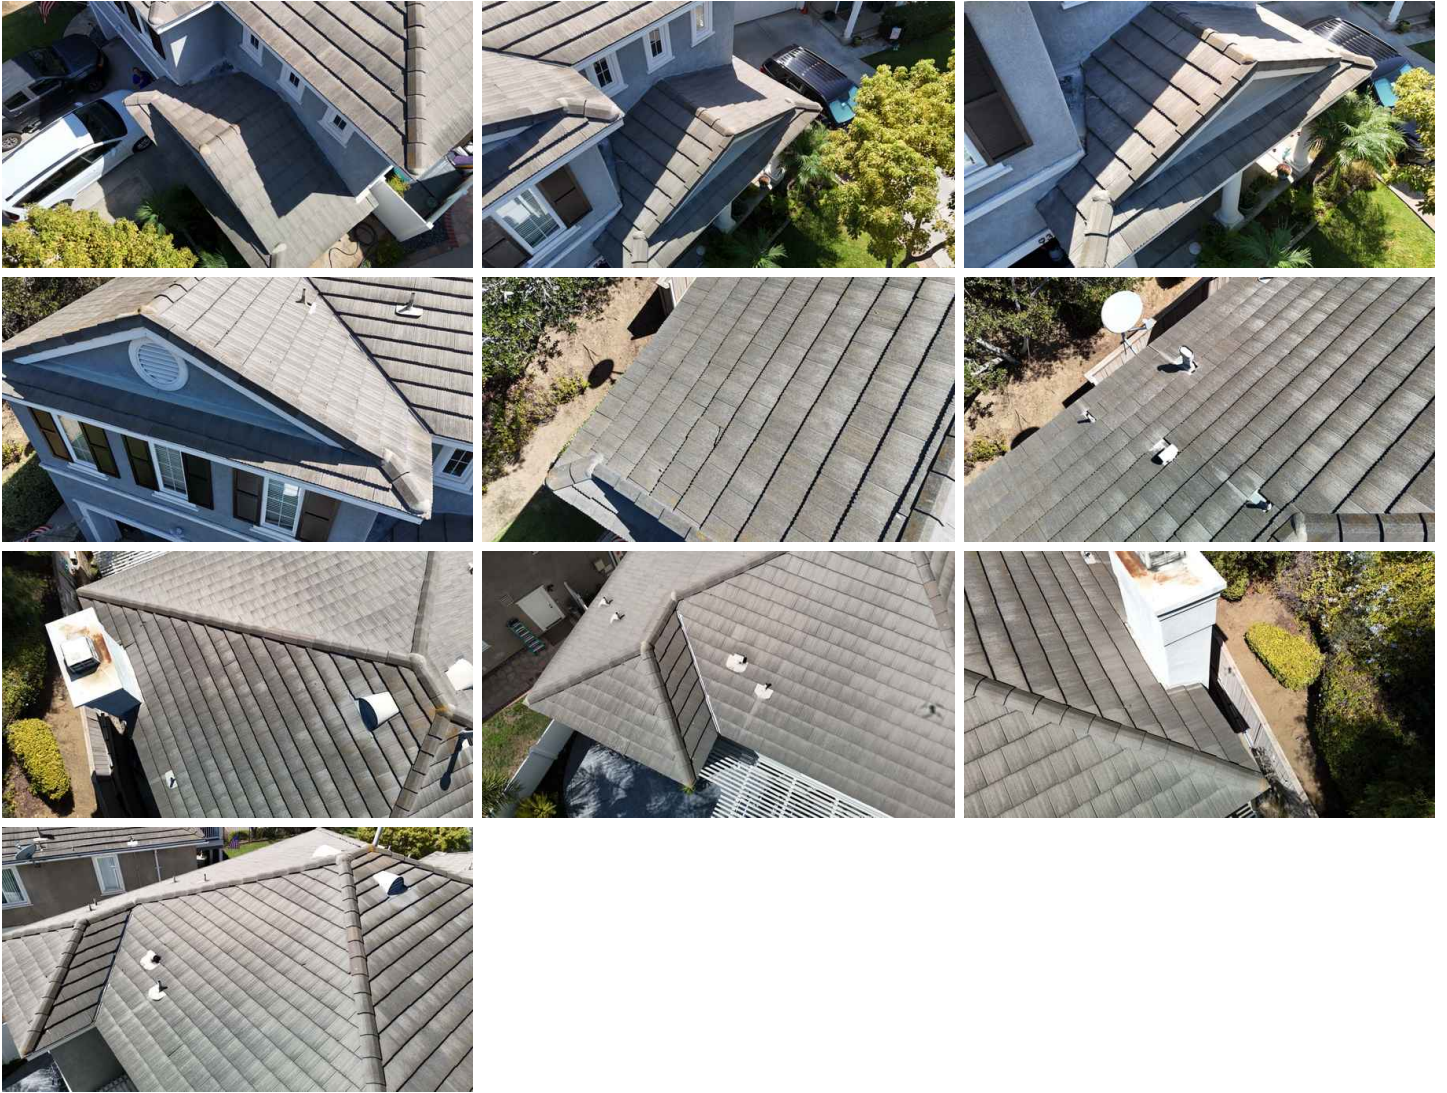

9.3.1 Flashings, Skylights and Roof Penetrations

SEAL PENETRATIONS (GENERAL)

The roof penetrations need caulking around the perimeter of the flashings where sealant is aged and/or failing. Advise repair by a licensed roof contractor.

Recommendation

Contact a qualified roofing professional.



9.5.1 Roof Drainage Systems

GUTTER SYSTEM INCOMPLETE

The home is not equipped with a full system of gutters and downspouts/drain lines. Gutters and drain lines are recommended to mitigate erosion and prevent possible water intrusion.

Recommendation

Contact a qualified professional.



10: EXTERIOR

		IN	NI	NP	A
10.1	Exterior General Information	X			
10.2	Wall Cladding, Flashing and Trim				X
10.3	Windows	X			
10.4	Doors (Exterior)				X
10.5	Eaves, Soffits and Fascia	X			
10.6	Vegetation, Grading, Drainage and Hardscape (With respect to their effect on the condition of the building)	X			
10.7	Decks, Balconies, Steps, Porches, Patio Covers and Applicable Railings				X
10.8	Tempered Glass at Doors/Windows	X			
10.9	Fencing and Gates				X

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

SIDING MATERIAL

STUCCO

EXTERIOR ENTRY DOORS

STEEL, GLASS

APPURTENANCE

PATIO, PORCH, SIDEWALK

DRIVEWAY

CONCRETE

Limitations

Exterior General Information

EXTERIOR LIMITATIONS

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Observations

10.2.1 Wall Cladding, Flashing and Trim

STUCCO CRACKS

Stucco cracks and deterioration noted in areas. These cracks may be prone to moisture intrusion issues. You may wish to view them for yourself and have repaired by a licensed contractor.

Recommendation

Contact a stucco repair contractor



Observation Item



Entry Area



Front Exterior

10.2.2 Wall Cladding, Flashing and Trim



Attention Item

A/C LINE VOIDS

Gaps noted at the flashing around the a/c refrigerant lines, where the lines enter the home. I recommend sealing these gaps to prevent rodent intrusion.

Recommendation

Contact a qualified professional.



10.4.1 Doors (Exterior)



Attention Item

MISSING/DAMAGED WEATHER STRIPPING

GARAGE

Missing or damaged weather stripping noted. This can cause drafts and lead to moisture intrusion. Advise repair by a qualified professional.

Recommendation

Contact a qualified professional.



Garage

10.7.1 Decks, Balconies, Steps, Porches, Patio Covers and Applicable Railings



Attention Item

WOOD DAMAGE

Wood damage/evidence of wood destroying organisms noted at the deck structure. Recommend consulting a licensed termite inspection company and/or decking contractor to determine corrections needed at this time.

Recommendation

Contact a qualified pest control specialist.



10.9.1 Fencing and Gates

WOOD DAMAGE

Evidence of wood damage/wood destroying organisms was noted at the fencing in multiple locations. Recommend consulting a licensed fencing contractor to determine the scope of necessary repairs.

Recommendation

Contact a qualified professional.



Attention Item



11: STRUCTURAL COMPONENTS

		IN	NI	NP	A
11.1	Structural General Information	X			
11.2	Walls (Structural)	X			
11.3	Foundations, Basements and Crawlspace	X			
11.4	Floors (Structural)	X			
11.5	Ceilings (structural)	X			
11.6	Roof Structure and Attic	X			
11.7	Presence of Foundation Bolts	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Foundation

Poured concrete

Wall Structure

2 X 4 Wood

Floor Structure

Slab

Ceiling Structure

2X4

Roof Structure

Engineered wood trusses

Roof-Type

Hip

Method used to observe attic

Crawled, Limited access

Attic info

Scuttle hole

Structural General Information: Suggested Foundation Maintenance & Care

Proper drainage and moisture maintenance is imperative to all types of foundations due to the expansive nature of the area load bearing soils. Drainage must be directed away from all sides of the foundation with grade slopes. In most cases, floor coverings and/or stored articles prevent recognition of signs of settlement-cracking in all but the most severe cases. It is important to note, this was not a structural engineering survey nor was any specialized testing done of any sub-slab plumbing systems during this limited visual inspection, as these are specialized processes requiring excavation. In the event that structural movement is noted, client is advised to consult with a Structural Engineer who can isolate and identify causes, and determine what corrective steps, if any, should be considered to either correct and/or stop structural movement.

Structural General Information: Foundations

Future performance of the structure cannot be predicted or warranted. This inspection is one of the first impressions and the inspector was not provided with any historical information pertaining to the structural integrity of the inspected real property. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time the inspection. Weather conditions, drainage, leakage and other adverse factors are able to effect structures, and differential movements are like to occur. The Inspector's opinion is based on visual observations of accessible and unobstructed areas of the structure at the time of the inspection. The inspection of the foundation may show it to be providing adequate support for the structure or having movement typical to this region at the time of the inspection. This does not guarantee the future life or failure of the foundation. The inspector is not a structural engineer. This inspection is not an engineering report or evaluation and should not be considered one, either expressed or implied. If any cause of concern is noted on this report, or if you want further evaluation, you should consider an evaluation by a Structural Engineer of your choice. Foundations inspected in accordance with the Standards of Practice.

Limitations

Structural General Information

STRUCTURAL INSPECTION LIMITATIONS

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Foundations, Basements and Crawlspaces

LIMITED INSPECTION DUE TO OBSTRUCTIONS

Due to floor coverings, vegetation, siding or other obstructions, not all areas of the foundation were visible. Our review of the home's foundation is limited. You may wish to have this further explored by a licensed foundation contractor and/or a licensed structural engineer to determine if any latent defects exist.

Floors (Structural)

FLOOR/FOUNDATION INSPECTION LIMITATIONS

Due to floor coverings, vegetation, siding or other obstructions, not all areas of the foundation were visible. Our review of the home's foundation is limited. You may wish to have this further explored by a licensed foundation contractor and/or a licensed structural engineer to determine if any latent defects exist.

Presence of Foundation Bolts

HOME LIKELY BOLTED

The home is likely bolted to the foundation. However, drywall was in place at the time of the inspection. Bolts could not be seen because of this. I recommend further evaluation by a licensed foundation contractor to confirm.

12: HEATING EQUIPMENT

		IN	NI	NP	A
12.1	Heating Equipment				X
12.2	Normal Operating Controls	X			
12.3	Automatic Safety Controls	X			
12.4	Presence of Installed Heat Source in Each Room	X			
12.5	Flue(s) for Heating Equipment	X			
12.6	Distribution Systems (HVAC Ducting and Related Equipment)	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Heat Type

Forced Air

Energy Source

Natural gas

Number of Heat Systems (excluding wood)

One

Heat System Brand

LENNOX

Ductwork

Insulated

Filter Type

Disposable

Cooling Equipment Type

Air conditioner unit

Cooling Equipment Energy Source Central Air Manufacturer

Electricity

BRYANT

Number of AC Only Units

One

Heating Equipment : Picture of Heating Equipment

Picture of heating equipment.

Normal Operating Controls : Type

Thermostat



Automatic Safety Controls : Type

Safety switch

Presence of Installed Heat Source in Each Room: Type

In ceiling

Heating Equipment : Thermal Image Showing Operation

The furnace turned on and produced heat at the time of the inspection.



Limitations

General

HEATING AND COOLING SYSTEM LIMITATIONS

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

General

ADDITIONAL HEATING AND COOLING SYSTEM LIMITATIONS

Please note: due to wall or floor coverings, insulation, roof framing or other obstructions, it was not possible to observe the entire HVAC distribution system throughout this entire home. Damage to the ducting can be present in a non-visible location. You may wish to have the HVAC distribution system further explored by a licensed HVAC contractor before the end of your contingency period to determine if any latent defects exist.

Distribution Systems (HVAC Ducting and Related Equipment)

EVALUATION LIMITED

Please note: Due to wall or floor coverings, insulation, roof framing or other obstructions, it was not possible to observe the entire HVAC distribution system throughout this entire home. Damage to the ducting can be present in a non-visible location. You may wish to have the HVAC distribution system further explored by a licensed HVAC contractor before the end of your contingency period to determine if any latent defects exist.

Observations

12.1.1 Heating Equipment

HEATER - AGED



The heater appeared to function at time of inspection. However, determining the life remaining is beyond the scope of a home inspection. Also, due to the age of the unit, I recommend further evaluation/safety check be performed by a licensed HVAC contractor before the end of your contingency period.

Recommendation

Contact a qualified HVAC professional.



12.1.2 Heating Equipment



DRIP LEG

The furnace gas piping is not equipped with a sediment trap or drip leg. Advise installation by a licensed plumber or qualified professional.

Recommendation

Contact a qualified HVAC professional.



13: COOLING EQUIPMENT

		IN	NI	NP	A
13.1	Cooling and Air Handler Equipment				X
13.2	Normal Operating Controls	X			
13.3	Presence of Installed Cooling Source in Each Room	X			

IN = InspectedNI = Not InspectedNP = Not PresentA = Annotation

Information

Cooling and Air Handler Equipment: System Information

For HVAC system information, please refer to Heating Equipment.



Cooling and Air Handler Equipment: Thermal Image Showing Operation

The AC appeared to turn on and produce cold air at the time of the inspection.



Cooling and Air Handler Equipment: AC - OK

The ambient air test was performed by using thermometers on the air handler of Air conditioner to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. During the test of this home air conditioning system a minimum split of 14 degrees was achieved and appears to be functional.

Limitations

Cooling and Air Handler Equipment

CONDENSATION DRAIN NOT VISIBLE

The AC primary condensation drain appeared to terminate to an approve location. I was unable to verify the condition of the entire span of the drain line due to wall cladding and other finishes. You may wish to have this further evaluated by a licensed HVAC contractor to determine if maintenance is needed at this time.

Observations

13.1.1 Cooling and Air Handler Equipment

STAINING AT HVAC PLATFORM

Staining was noted around the HVAC platform/return air compartment. This may be indicative of previous possible condensation leaks or other related issues. Unable to determine the exact cause. Area appeared dry at the time of the inspection. Advise consulting a licensed HVAC and restoration contractor to determine if corrections are needed at this time.

Recommendation

Contact a qualified HVAC professional.



Attention Item



13.1.2 Cooling and Air Handler Equipment

AC CONDENSER CORRODED


The AC condenser was noted corroded. Recommend consulting a licensed HVAC contractor for necessary servicing and to determine potential cost of repairs and remaining life.

Recommendation

Contact a qualified heating and cooling contractor



Attention Item

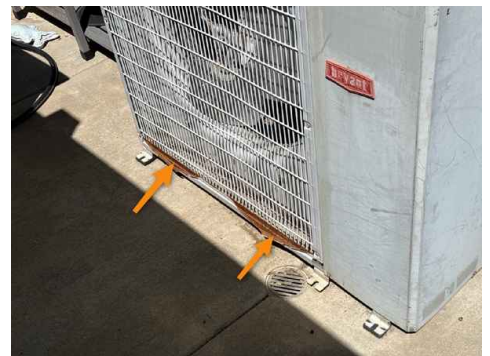

13.1.3 Cooling and Air Handler Equipment

ACCUMULATOR- DAMAGED/DETERIORATED


The air conditioning accumulator was noted damaged or deteriorated at the time of the inspection. Recommend consulting a license HVAC contractor to determine if maintenance or replacement as needed.

Recommendation

Contact a qualified HVAC professional.



Attention Item

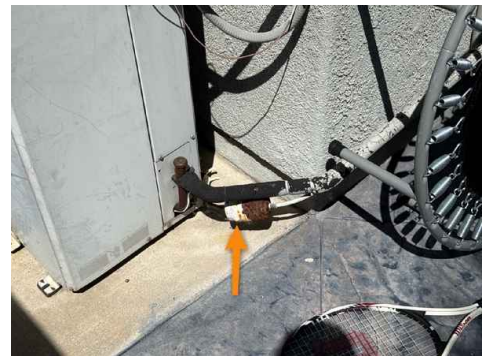

14: CHIMNEY, FIREPLACE, OR STOVE

		IN	NI	NP	A
14.1	Chimneys and Flues (for Fireplaces)	X			
14.2	Gas/LP(Propane) Fire Logs and Fireplaces	X			

IN = Inspected NI = Not Inspected NP = Not Present A = Annotation

Information

Types of Fireplaces

Gas log

Limitations

Chimneys and Flues (for Fireplaces)

RECOMMEND SECONDARY EVALUATION

Note: The Nation Fire Protection Association (nfpa.org) recommends that fireplaces and chimneys be professionally inspected (Level 2 Inspection) with each change of ownership. The chimney should also be inspected by a qualified chimney sweep to determine if cleaning/maintenance is required.

Chimneys and Flues (for Fireplaces)

LINER NOT FULLY INSPECTED

The liner was not fully inspected inspected by our company. It is recommended to have a qualified chimney sweep clean and inspect for safety.

Gas/LP(Propane) Fire Logs and Fireplaces

GAS LINE NOT FULLY VISIBLE

Note: Gas leaks below the finished grade (underground) or between the walls or behind the fireplace hearths or any concealed area cannot be detected and are not evaluated as part of the inspection process.

Gas/LP(Propane) Fire Logs and Fireplaces

FIREPLACE NOT IGNITED

Note: If the fireplace is equipped with a gas log or gas lighter with the pilot light turned off, the Standards of Practice prevent the inspector from lighting and operating these fixtures. It is recommended that the pilot be lit and the fireplace operation be verified with the current owner prior to closing to ensure proper operation.

15: GENERAL PICTURES

Information

Half Bathroom



Laundry Room



Complementary Photos

The photos in this section are provided as a complementary service and are not intended to represent or identify deficiencies within each evaluated room.

Kitchen



Dining Area



Living Room



Family Room



Master Bedroom



Master Bathroom



Hall Bathroom



2nd Bedroom



3rd Bedroom



4th Bedroom



Garage



Rear Yard



Right Side Yard



Left Side Yard



STANDARDS OF PRACTICE

Inspection Details

Please refer to the Home Inspection [Standards of Practice](#) while reading this inspection report. I performed the home inspection according to the standards and my clients wishes and expectations. Please refer to the inspection contract or agreement between the inspector and the inspector's client.

Built-In Appliances

The kitchen appliances are not included in the scope of a home inspection according to the Standards of Practice.

The inspector will out of courtesy observe and operate the basic functions of the following kitchen appliances:

Dishwasher, Range, Cook Top, Oven; Trash Compactor; Garbage Disposal; Ventilation Equipment or Range Hood; and Permanently installed Microwave Oven.

The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units.

The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

Chimney, Fireplace, or Stove

I. The inspector shall inspect:

1. readily accessible and visible portions of the fireplaces and chimneys;
2. lintels above the fireplace openings;
3. damper doors by opening and closing them, if readily accessible and manually operable; and
4. cleanout doors and frames.

II. The inspector shall describe:

1. the type of fireplace.

III. The inspector shall report as in need of correction:

1. evidence of joint separation, damage or deterioration of the hearth, hearth extension or chambers;
2. manually operated dampers that did not open and close;
3. the lack of a smoke detector in the same room as the fireplace;
4. the lack of a carbon-monoxide detector in the same room as the fireplace; and
5. cleanouts not made of metal, pre-cast cement, or other non-combustible material.