

Inspection Report Richard Brester, Successor Trustee

Property Address:

6712 Birch Ct Dublin CA 94568



DB Standard Home Inspection

Justin Mullaney
DBStandardOffice@gmail.com
925-487-2811

******* TABLE OF CONTENTS

Cover Page	1
Table of Contents	2
Intro Page	3
REPORT SUMMARY	4
1 Utilities	16
2 Roof	18
3 Exterior	19
4 Structure	22
5 Garage	26
6 Electrical System	27
7 Plumbing System	31
8 Heating, AC, and Fire Places	35
9 Interior	37
10 Kitchen Appliances	40
11 Insulation and Ventilation	41
Invoice	43

Date: 6/12/2024	Time: 02:15 PM	Report ID: 20240612-6712-Birch-Ct
Property:	Customer:	Real Estate Professional:
6712 Birch Ct	Richard Brester, Successor Trustee	John Manos
Dublin CA 94568		

The Inspection and Report are conducted and prepared for the Customer as named above. It is recommended that Buyers of pre-inspected properties hire their own inspector and/or consult with this company for an inspection on their behalf prior to completing the purchase.

Comment Definitions

The following definitions of comment descriptions are used in this inspection report. All comments by the inspector should be considered BEFORE purchasing or selling this property. Any recommendations by the inspector to repair or replace suggests a second opinion or further evaluation by a qualified tradesperson. All costs associated with the information and recommendations contained in this report should also be considered.

<u>Satisfactory (Sat)</u> = The item was visually inspected and deemed to be in satisfactory condition. If no other comments were made then it appeared to be functioning as intended.

<u>Action Recommended (AR)</u> = The item is not functioning as intended, needs further evaluation by a qualified tradesperson, is not installed, or needs further information. Items that can be repaired to satisfactory condition may not need replacement.

Not Inspected (NI)= The item was not inspected. No representations of whether or not it was functioning as intended was made.

Not Present (NP) = The item is not on the property or inside the building(s).

For Your Information (FYI) = This is just a note that may be of interest to someone reading this report.

Type of building:	Approximate date of original	Occupancy:
Single Family Residence, One story	construction:	Vacant
	1967	
In attendance:	Weather:	Temperature:
Sellers Agent	Clear	Hot: over 85 degrees

Front door roughly faces:

West

6712 Birch Ct Page 3 of 43

TREPORT SUMMARY



DB Standard Home Inspection DBStandardOffice@gmail.com 925-487-2811

Customer

Richard Brester, Successor Trustee

Address

6712 Birch Ct Dublin CA 94568

The following items or discoveries indicate that these systems or components **do not function as intended**, adversely affect the habitability of the building, warrant further investigation by a specialist, or requires subsequent observation. The Summary is NOT the entire report. The complete report may include additional information of concern to the customer. It is recommended that the client(s) READ THE COMPLETE REPORT.

2. ROOF

2.2 FLASHINGS

ACTION RECOMMENDED

(1) Some flashings are lifting and/or have loose fasteners. Professional repair is recommended.

6712 Birch Ct Page 4 of 43



2.2 Item 1(Picture)

(2) Two turbine roof vents were covered in plastic during the inspection. Consulting with a roofing professional for further evaluation is recommended.



2.2 Item 2(Picture)

3. EXTERIOR

3.0 ACCESS AND VISIBILITY AROUND THE STRUCTURE(S)

ACTION RECOMMENDED

Vegetation is in contact with the building. Trimming it as needed is recommended to prevent physical damage; to discourage rodent activity; and to provide proper access to vents, equipment, and utilities as needed.




3.0 Item 1(Picture)

3.4 EAVES (ROOF SHEATHING, RAFTERS, BLOCKING, AND FASCIA)

ACTION RECOMMENDED

There is weather damage in the eaves. Professional repair or replacement of all damaged materials is recommended.

6712 Birch Ct Page 5 of 43

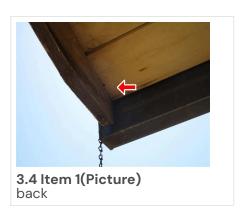

3.5 SIDING AND TRIM

- ACTION RECOMMENDED
- (1) There are cracks in the stucco. Properly patching them is recommended to prevent further cracking and/or moisture penetration.







3.5 Item 2(Picture)

(2) The stucco is cracked and bowed in some areas - separating from the wall framing. Consulting with a stucco siding professional for further evaluation and repair is recommended.



3.5 Item 3(Picture) south side

3.7 EXTERIOR VENTS (FOR ATTICS, CRAWL SPACES, AND GARAGES)

ACTION RECOMMENDED

There are damaged crawl space screens. Repair is recommended to prevent rodent access.

6712 Birch Ct Page 6 of 43



3.7 Item 1(Picture) back



3.7 Item 2(Picture) north side

4. STRUCTURE

4.7 SUBFLOORS, JOISTS, SHEARWALL, AND GIRDERS

ACTION RECOMMENDED

There is apparent moisture damage and/or organic growth on wood members in the crawl space. Consulting with appropriate trade professionals for further evaluation, treatment, and repair as needed is recommended.



4.7 Item 1(Picture) family room



4.7 Item 2(Picture) master bedroom

4.10 FOUNDATION

ACTION RECOMMENDED

There are foundation cracks. Consulting with appropriate trade professionals for further evaluation and repair as needed is recommended to prevent further cracking, movement, and/or concrete deterioration.



4.10 Item 1(Picture) below master bathroom



4.10 Item 2(Picture) below master bathroom

6712 Birch Ct Page 7 of 43

5. GARAGE

5.0 GARAGE FIREWALL AND/OR CEILING BARRIER

ACTION RECOMMENDED

There is an opening in the firewall (garage walls and ceilings adjacent to any living space). Properly sealing it with fire-rated material and/or approved sealant as needed is recommended to maintain proper garage/house fire separation and to prevent rodent access.




5.0 Item 1(Picture) garage

6. ELECTRICAL SYSTEM

6.6 OUTLETS (RECEPTACLES)

ACTION RECOMMENDED

(1) One outlet has reversed polarity (hot and neutral wires are mis-wired). Consulting with a licensed electrician for repair is recommended.

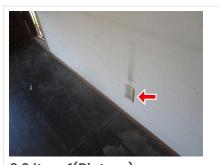

6.6 Item 1(Picture) family room

(2) One outlet shows evidence of excessive heat. Consulting with a licensed electrician for further evaluation and repair is recommended

6712 Birch Ct Page 8 of 43



6.6 Item 2(Picture) family room

(3) Two outlets are broken. Professional repair is recommended.



6.6 Item 3(Picture) guest bedroom



6.6 Item 4(Picture) master bedroom

(4) One outlet is dead (not functional). Consulting with a licensed electrician for further evaluation and repair is recommended.



6.6 Item 5(Picture) south bedroom

6.7 GFCIS (GROUND FAULT CIRCUIT INTERRUPTERS)

ACTION RECOMMENDED

The kitchen countertop and guest bathroom outlets are not GFCI protected. Consulting with a licensed electrician to install them is recommended as a safety upgrade.

6.8 INSTALLED ELECTRICAL FIXTURES

ACTION RECOMMENDED

There is no way to light the family room. Repair is recommended.

6712 Birch Ct Page 9 of 43



7. PLUMBING SYSTEM

7.2 WATER SUPPLY PIPING

ACTION RECOMMENDED

The water pressure throughout the house is generally low and rusting fittings are visible. This is typical of older, galvanized steel supply piping and is caused by rust accumulation inside the pipes. Professional replacement of the remaining supply piping with copper is recommended.



7.2 Item 1(Picture)



7.2 Item 2(Picture)

7.3 WASTE PIPING

ACTION RECOMMENDED

There are waste pipe leaks in the crawl space. Professional repair is recommended.



7.3 Item 1(Picture) hall bathroom tub



7.3 Item 2(Picture) hall bathroom



7.3 Item 3(Picture) master bathroom shower

6712 Birch Ct Page 10 of 43



7.3 Item 4(Picture) south bedroom

7.7 FAUCETS, SHOWER HEADS, AND DIVERTERS

ACTION RECOMMENDED

There is a leaking faucet. Repair is recommended.



7.7 Item 1(Picture) garage sink

7.8 SINKS, TUBS, AND DRAINS

- ACTION RECOMMENDED
- (1) A sink is cracked through. Replacing the sink is recommended.



7.8 Item 1(Picture) garage sink

(2) A mechanical drain stopper is not functional. Repair is recommended.

6712 Birch Ct Page 11 of 43



7.8 Item 2(Picture) hall bathroom

7.9 TOILETS

ACTION RECOMMENDED

A toilet is loose. Properly securing it to the floor is recommended.



7.9 Item 1(Picture) guest bathroom

7.11 SUMP AND/OR EJECTOR PUMP

ACTION RECOMMENDED

The sump pump is improperly installed. Consulting with a plumbing professional for proper reinstallation is recommended.



7.11 Item 1(Picture) drains to backyard



7.11 Item 2(Picture) extension chord use



7.11 Item 3(Picture) improper installation

9. INTERIOR

9.3 WALLS

ACTION RECOMMENDED

6712 Birch Ct Page 12 of 43

There are wall cracks in some areas. This is typical and does not seem to indicate excessive structural movement. Patching and painting is recommended.





9.5 WINDOWS

ACTION RECOMMENDED

Some windows have discoloration and/or evidence of fogging between the dual panes. Consulting with a window installation professional for further evaluation of all windows and replacement of the affected panes is recommended.



9.5 Item 1(Picture) family room



9.5 Item 2(Picture) master bedroom

9.6 FLOORS

ACTION RECOMMENDED

The flooring is damaged in some areas. Professional repair is recommended.



9.6 Item 1(Picture) master bathroom



9.6 Item 2(Picture) guest bathroom

9.7 TUB AND SHOWER AREAS

ACTION RECOMMENDED

6712 Birch Ct Page 13 of 43 (1) There are loose bathroom tiles. This may indicate moisture penetration behind the tiles. Consulting with a tile installation professional for further evaluation and repair is recommended.



9.7 Item 1(Picture) guest bathroom shower

(2) The guest bathroom shower door and panel are cracked. Repair is recommended.



9.7 Item 2(Picture)

Home inspectors are NOT required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substances including but not limited to asbestos, lead, mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the client(s), secondary readers of this information should hire a qualified inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

THIS CONCLUDES THE SUMMARY AND REPAIR RECOMMENDATION SECTION. PLEASE CONSULT WITH TRAINED PROFESSIONALS FOR REPAIR RECOMMENDATIONS AS APPROPRIATE TO INSURE PROPER WORKMANSHIP AND

6712 Birch Ct Page 14 of 43

SAFETY OF THE PERSON(S) INVOLVED. THE BODY OF THE INSPECTION REPORT FOLLOWS. PLEASE READ THE ENTIRE REPORT FOR MORE INFORMATION ABOUT EACH SECTION OF THE PROPERTY.

Prepared Using HomeGauge http://www.HomeGauge.com: Licensed To Justin Mullaney

6712 Birch Ct Page 15 of 43

© RESULTS AT A GLANCE

99

 28

SUMMARY COMMENTS

Total number in report.

75 PHOTOS

Total number in report.



ITEMS: UTILITIES

1.0 MAIN WATER VALVE

⊗ SATISFACTORY

Included is a photo of a main water shut-off valve.



1.0 Item 1(Picture) front

1.1 SEWER CLEAN-OUT

⊗ FYI

6712 Birch Ct Page 16 of 43

Included is a photo of a sewer clean-out. Consulting with a plumbing professional for an invasive, video camera inspection of the sewer piping to insure proper slope, structure, and flow should be considered. This procedure is not included under the scope of this inspection.



1.1 Item 1(Picture) front

1.2 MAIN GAS SHUT-OFF VALVE

SATISFACTORY

Included is a photo of the main gas valve. No smell of gas was detected around the meter or gas appliances at the time of this inspection. However, if the smell of gas is present, immediately exit the building and contact a plumbing professional and/or the gas supplier. When the valve is lined up with the pipe, it is open. To turn off the gas, rotate the valve 1/4 turn until it becomes perpendicular to the pipe (a heavy wrench may be needed).



1.2 Item 1(Picture) side of garage

1.3 AUTOMATIC GAS SHUT-OFF VALVE

NOT PRESENT

Excess Flow and/or Earthquake gas shut-off valves are not yet required in all areas. Consult with the local gas supplier and/or the local building department if more information is desired.

1.4 MAIN ELECTRICAL SERVICE DISCONNECT

SATISFACTORY

6712 Birch Ct Page 17 of 43

Included is a photo of the electric meter and main service disconnect.



1.4 Item 1(Picture) side of garage



2 ROOF

B DESCRIPTION

The home inspector shall Observe roof covering and drainage systems; flashings, skylights, chimneys, and other roof penetrations, plus signs of leaks or damage. The home inspector shall Describe the type of roof covering materials and Report the methods used to observe the roof. The home inspector is NOT required to walk on the roofing or inspect attached accessories including, but not limited to, solar systems, antennae, and satellite dishes. (NORMAL SERVICE LIFE: Roofing materials are expected to last from 15-50 years depending on the slope and type of material)

STYLES & MATERIALS: ROOF

Roofing material:

Composition shingles

Method of roof inspection:

Ladder at roof edges Viewed from ground

ITEMS: ROOF

2.0 ROOF SURFACE MATERIAL

SATISFACTORY

(1) The roof surface material appears to be in satisfactory condition. Consulting with a roofing professional for annual inspections and maintenance is recommended to prevent future leakage and moisture-related damage.



2.0 Item 2(Picture)

6712 Birch Ct Page 18 of 43 (2) NOTE: A licensed roofing contractor was also hired to perform a roof inspection for this customer.

2.1 ROOF PERFORMANCE

SATISFACTORY

2.2 FLASHINGS

ACTION RECOMMENDED

(1) Some flashings are lifting and/or have loose fasteners. Professional repair is recommended.



2.2 Item 1(Picture)

(2) Two turbine roof vents were covered in plastic during the inspection. Consulting with a roofing professional for further evaluation is recommended.



2.2 Item 2(Picture)

2.3 CHIMNEYS AND SKYLIGHTS

⊗ SATISFACTORY

2.4 ROOF DRAINAGE SYSTEM

SATISFACTORY

2.5 SOLAR PANELS





B DESCRIPTION

The home inspector shall Observe siding, flashings, and trim; exterior doors and windows; attached decks, balconies, steps, porches and railings; eaves, soffits, and fascias; vegetation, grading, drainage, driveways, patios,

walkways, and retaining walls with respect to their effect on the structure. The home inspector shall Describe siding materials; Operate all exterior doors and windows; Probe exterior wood components where deterioration is suspected and safely accessible. The inspector is NOT required to observe: screening, shutters, awnings, and similar seasonal accessories; fences; presence of safety glazing in doors and windows; remote control transmitters; geological conditions; recreational facilities (including spas, saunas, swimming pools, playground equipment, and other entertainment or athletic facilities); detached buildings; or buried fuel storage tanks. The home inspector is NOT required to: move personal items, panels, furniture, equipment, plants, soil, or debris that obstruct access or visibility.

* STYLES & MATERIALS: EXTERIOR

Siding materials:

Stucco

Wood

Rock veneer

Attached patio covers and awnings:

None

Attached decking and porches:

None

ITEMS: EXTERIOR

3.0 ACCESS AND VISIBILITY AROUND THE STRUCTURE(S)

ACTION RECOMMENDED

Vegetation is in contact with the building. Trimming it as needed is recommended to prevent physical damage; to discourage rodent activity; and to provide proper access to vents, equipment, and utilities as needed.



3.0 Item 1(Picture)

3.1 DRIVEWAYS, WALKWAYS, AND PATIOS

⊗ SATISFACTORY

3.2 LOT GRADING AND DRAINAGE

⊗ SATISFACTORY

The lot grading and drainage system appears to have adequately directed roof and exterior surface water away from the building(s). Keeping the roof and lot drainage systems clear of debris during rains is recommended to properly direct water away from the building(s).

3.3 FENCING AND GATES

NOT INSPECTED


6712 Birch Ct Page 20 of 43

Inspecting fencing and gates is NOT included as part of this inspection. However, consulting with appropriate trade professionals for further evaluation of the fencing as appropriate should be considered.

3.4 EAVES (ROOF SHEATHING, RAFTERS, BLOCKING, AND FASCIA)

ACTION RECOMMENDED

There is weather damage in the eaves. Professional repair or replacement of all damaged materials is recommended.

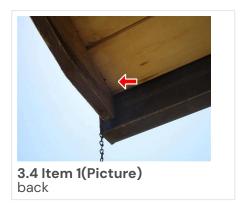

3.5 SIDING AND TRIM

ACTION RECOMMENDED

(1) There are cracks in the stucco. Properly patching them is recommended to prevent further cracking and/ or moisture penetration.



3.5 Item 1(Picture)



3.5 Item 2(Picture)

(2) The stucco is cracked and bowed in some areas - separating from the wall framing. Consulting with a stucco siding professional for further evaluation and repair is recommended.



3.5 Item 3(Picture) south side

6712 Birch Ct Page 21 of 43

3.6 DOORS AND JAMBS

SATISFACTORY

3.7 EXTERIOR VENTS (FOR ATTICS, CRAWL SPACES, AND GARAGES)

ACTION RECOMMENDED

There are damaged crawl space screens. Repair is recommended to prevent rodent access.



3.7 Item 1(Picture) back



3.7 Item 2(Picture) north side

3.8 WINDOWS AND SCREENS

SATISFACTORY

1 4. STRUCTURE

DESCRIPTION

The Home Inspector shall Observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall Describe the type of foundation, floor structure, wall structure, columns or piers, ceiling structure, and roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is NOT required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons, or Move furniture or personal property. It is impractical to determine what, if any, building codes were in effect when a structure was built or remodeled and it is impossible to know how the codes were interpreted and enforced at those times.

Note about HAZARDOUS MATERIALS: Older homes may have been constructed with materials that are now considered hazardous. However, inspecting and testing for hazardous materials is NOT included as part of this inspection. Professional hazardous material inspection and testing services are available. Consulting with appropriate trade professionals for further evaluation of this home should be considered. The following Environmental Protection Agency web sites contain valuable information: epa.gov/asbestos, epa.gov/mold, epa.gov/lead, epa.gov/radon.

STYLES & MATERIALS: STRUCTURE

Roof Structure: Ceiling Structure: Method of attic inspection:

Wood framed Wood framed Entered the attic

Wall Structure: Floor Structure: Foundation type:

6712 Birch Ct Page 22 of 43 Wood framed

Poured concrete, raised foundation

Wood joists, girders, and subfloor

Floor supports:

Concrete piers with wood pads and posts

Method of crawl space inspection:

Entered the crawl space

ITEMS: STRUCTURE

4.0 GENERAL STRUCTURE

⊗ SATISFACTORY

It is the inspectors opinion that no excessive structural movement is present. Foundation cracks, wall and ceiling cracks, sloping floors, and ill-fitting doors are commonly occurring issues due to climatic conditions, soil movement, and/or older construction methods. If further evaluation is desired, consulting a structural engineer is recommended.

4.1 INTERIOR ACCESS AND VISIBILITY

⊗ SATISFACTORY

4.2 ATTIC SPACE(S)

⊗ SATISFACTORY

The attic entrance is located in a hallway. Included are general photos inside the attic. FYI



4.2 Item 1(Picture)



4.2 Item 2(Picture)



4.2 Item 3(Picture)



4.2 Item 4(Picture)

4.3 ROOF STRUCTURE

SATISFACTORY

6712 Birch Ct Page 23 of 43

4.4 CEILINGS (STRUCTURAL)

⊗ SATISFACTORY

4.5 WALLS (STRUCTURAL)

⊗ SATISFACTORY

4.6 CRAWL SPACE(S)

⊗ SATISFACTORY

There are crawl space entrances in two bedroom closets. Included are general photos inside the crawl space areas. FYI



4.6 Item 1(Picture) south side



4.6 Item 2(Picture) living room



4.6 Item 3(Picture) living room



4.6 Item 4(Picture) kitchen



4.6 Item 5(Picture) water heater/furnace closet



4.6 Item 6(Picture) hall bathroom toilet



4.6 Item 7(Picture) family room



4.6 Item 8(Picture) family room



4.6 Item 9(Picture) guest bathroom shower

6712 Birch Ct Page 24 of 43



4.6 Item 10(Picture) guest bathroom toilet



4.6 Item 11(Picture) south side



4.6 Item 12(Picture) master bathroom toilet



4.6 Item 13(Picture) rear addition



4.6 Item 14(Picture) rear addition



4.6 Item 15(Picture) rear addition

4.7 SUBFLOORS, JOISTS, SHEARWALL, AND GIRDERS

ACTION RECOMMENDED

There is apparent moisture damage and/or organic growth on wood members in the crawl space. Consulting with appropriate trade professionals for further evaluation, treatment, and repair as needed is recommended.



4.7 Item 1(Picture) family room



4.7 Item 2(Picture) master bedroom

4.8 FLOOR SUPPORT SYSTEM

⊗ SATISFACTORY

4.9 CRAWL SPACE SOIL CONDITION

SATISFACTORY

Some soil in the crawl space is wet. No moisture related damage is noted.

4.10 FOUNDATION

6712 Birch Ct Page 25 of 43

ACTION RECOMMENDED

There are foundation cracks. Consulting with appropriate trade professionals for further evaluation and repair as needed is recommended to prevent further cracking, movement, and/or concrete deterioration.



4.10 Item 1(Picture) below master bathroom



4.10 Item 2(Picture) below master bathroom

4.11 APPARENT REMODELING AND/OR UPDATES

SATISFACTORY

Structural addition, dual pane windows, and newer HVAC system and ducting remodeling are some apparent improvements that may have been subject to local permits and building codes at the time of their installation. Other improvements, repairs, and insurance claims may have been made that are not apparent to the inspector. Inquiring about all related history and documentation is recommended.

4.12 RODENT ACTIVITY

NOT INSPECTED

The scope of this inspection does not specifically include looking for pest or rodent activity. However, pests and rodents can enter a building through a variety of means at any time. Consulting with pest control professionals for further evaluation should be considered. Abatement procedures and maintenance programs are available.

★ 5. GARAGE

DESCRIPTION

The home inspector shall Inspect all accessible and visible areas of each garage and Operate all functional and accessible doors.

🛪 STYLES & MATERIALS: GARAGE

Garage:

Attached

ITEMS: GARAGE

5.0 GARAGE FIREWALL AND/OR CEILING BARRIER

6712 Birch Ct Page 26 of 43

ACTION RECOMMENDED

There is an opening in the firewall (garage walls and ceilings adjacent to any living space). Properly sealing it with fire-rated material and/or approved sealant as needed is recommended to maintain proper garage/house fire separation and to prevent rodent access.



5.0 Item 1(Picture) garage

5.1 GARAGE FLOOR

⊗ SATISFACTORY

Cracks are visible on the floor of the garage. These are typical and do not appear to represent excessive structural movement.



5.1 Item 1(Picture)

5.2 GARAGE DOORS

⊗ SATISFACTORY

5.3 GARAGE DOOR OPENERS

SATISFACTORY

The overhead garage door operates manually.

5.4 GARAGE/HOUSE DOOR

SATISFACTORY

6. ELECTRICAL SYSTEM

B DESCRIPTION

The home inspector shall Observe: main service equipment, grounding equipment, amperage and voltage

6712 Birch Ct Page 27 of 43

ratings; branch circuit conductors, over current devices (breakers and/or fuses); The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles; The polarity and grounding of the accessible receptacles; The presence of ground fault circuit interrupters, carbon monoxide detectors, and smoke detectors. The home inspector shall Describe: service amperage and voltage; conductor materials; location of main and subpanels. The home inspector is NOT required to; dismantle any electrical device other than to remove the covers of the main and subpanels if safely accessible; or inspect central vacuum systems, built-in refrigerators, wine storage closets, ice-makers, and low voltage systems such as; landscape lighting, security systems, telephone, TV, or intercoms. NOTE: When adding additional electrical systems such as solar panels and/or additional circuits, upgrading and/or relocating electrical panels and other related equipment may be required by the local building department. (NORMAL SERVICE LIFE: Electrical components including breakers, panels, wiring, fixtures, and receptacles can last several decades, but systems and components older than 30 years should be periodically evaluated by a licensed electrician to insure safe operation and to provide any updates as may be needed or required.)

* STYLES & MATERIALS: ELECTRICAL SYSTEM

Main electrical service wires:

Overhead

Predominant branch circuit wiring type(s):

Non-metallic cable Conduit covered Main panel rating:

100 amps, 240 volts

Branch circuit wiring material (15 and 20 amp):

Copper

Overload protection devices:

Breakers

Type(s) of outlets:

Grounded, 3 prong

ITEMS: ELECTRICAL SYSTEM

6.0 OVERHEAD ELECTRIC SERVICE WIRES

⊗ SATISFACTORY

6.1 MAIN ELECTRICAL GROUND

SATISFACTORY

6.2 ELECTRIC PANELS

SATISFACTORY

Subpanel photo



6.2 Item 1(Picture) garage

6.3 BREAKER LABELING

6712 Birch Ct Page 28 of 43

SATISFACTORY

6.4 ELECTRICAL PANEL WIRING

SATISFACTORY

6.5 DISTRIBUTION WIRING

⊗ SATISFACTORY

6.6 OUTLETS (RECEPTACLES)

ACTION RECOMMENDED

(1) One outlet has reversed polarity (hot and neutral wires are mis-wired). Consulting with a licensed electrician for repair is recommended.



6.6 Item 1(Picture) family room

(2) One outlet shows evidence of excessive heat. Consulting with a licensed electrician for further evaluation and repair is recommended



6.6 Item 2(Picture) family room

6712 Birch Ct Page 29 of 43

(3) Two outlets are broken. Professional repair is recommended.



6.6 Item 3(Picture) guest bedroom



6.6 Item 4(Picture) master bedroom

(4) One outlet is dead (not functional). Consulting with a licensed electrician for further evaluation and repair is recommended.



6.6 Item 5(Picture) south bedroom

6.7 GFCIS (GROUND FAULT CIRCUIT INTERRUPTERS)

ACTION RECOMMENDED

The kitchen countertop and guest bathroom outlets are not GFCI protected. Consulting with a licensed electrician to install them is recommended as a safety upgrade.

6.8 INSTALLED ELECTRICAL FIXTURES

ACTION RECOMMENDED

There is no way to light the family room. Repair is recommended.



6.8 Item 1(Picture)

6.9 240 VOLT DRYER OUTLET

SATISFACTORY

6712 Birch Ct Page 30 of 43

NOTE: When installing a new dryer, the outlet and/or the power chord may have to be updated.

👚 7. PLUMBING SYSTEM

B DESCRIPTION

The home inspector shall Describe: water supply and distribution piping materials; drain, waste, and vent piping materials; water heating systems; and location of the main water supply shutoff valve. The home inspector shall Operate all plumbing fixtures, including faucets, except where the flow end of the faucet is connected to an appliance. The home inspector is NOT required to fill tubs and sinks to their overflow openings, state the effectiveness of anti-siphon devices; determine whether water supply and waste disposal systems are public or private; operate automatic safety controls; operate any valves; inspect water conditioning or filtering systems; fire and lawn sprinkler systems; water supply quantity and quality; waste disposal systems; irrigation systems; solar water heating equipment; or observe the system for proper sizing, design, or use of proper materials.

ASBESTOS NOTE: In many homes built prior to the early 1980's asbestos was present in water heater flue material and/or tape. When replacing or repairing the water heater, consulting with asbestos abatement professionals for further evaluation, testing, and abatement of the material as may be needed is recommended. (NORMAL SERVICE LIFE: Water heaters and pumps can be expected to last at least 10 years, faucets and fixtures a bit longer, while copper and plastic piping has an indefinite life expectation.)

* STYLES & MATERIALS: PLUMBING SYSTEM

Gas Service: Visible water supply pipe (to Natural gas building):

Not visible

Sewage system: Visible waste water piping:

Public Plastic

Laundry service location: Water conditioning system:

Garage Filtered drinking water

dispenser

Visible water distribution piping (inside building):

Copper

Galvanized steel

Water heater power source:

Natural gas

Fire sprinkler system:

None

ITEMS: PLUMBING SYSTEM

7.0 GAS PIPING

SATISFACTORY

7.1 GAS SUPPLY FOR A DRYER


7.2 WATER SUPPLY PIPING

ACTION RECOMMENDED

6712 Birch Ct Page 31 of 43

The water pressure throughout the house is generally low and rusting fittings are visible. This is typical of older, galvanized steel supply piping and is caused by rust accumulation inside the pipes. Professional replacement of the remaining supply piping with copper is recommended.



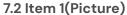



7.2 Item 2(Picture)

7.3 WASTE PIPING

ACTION RECOMMENDED

There are waste pipe leaks in the crawl space. Professional repair is recommended.



7.3 Item 1(Picture) hall bathroom tub



7.3 Item 2(Picture) hall bathroom



7.3 Item 3(Picture)
master bathroom shower



7.3 Item 4(Picture) south bedroom

7.4 WATER HEATER

SATISFACTORY

7.5 AGE OF WATER HEATER

The water heater appears to have been installed since approximately 2017.

7.6 SEISMIC STRAPPING

6712 Birch Ct Page 32 of 43

SATISFACTORY

The water heater appears to be properly strapped and braced to resist lateral forces such as an earthquake.



7.6 Item 1(Picture) family room closet

7.7 FAUCETS, SHOWER HEADS, AND DIVERTERS

ACTION RECOMMENDED

There is a leaking faucet. Repair is recommended.



7.7 Item 1(Picture) garage sink

7.8 SINKS, TUBS, AND DRAINS

ACTION RECOMMENDED

(1) A sink is cracked through. Replacing the sink is recommended.



7.8 Item 1(Picture) garage sink

6712 Birch Ct Page 33 of 43

(2) A mechanical drain stopper is not functional. Repair is recommended.



7.8 Item 2(Picture) hall bathroom

7.9 TOILETS

ACTION RECOMMENDED

A toilet is loose. Properly securing it to the floor is recommended.



7.9 Item 1(Picture) guest bathroom

7.10 IRRIGATION SYSTEM

Inspecting irrigation systems is NOT included as part of this inspection. However, consulting with appropriate trade professionals for further evaluation of the irrigation system should be considered.

7.11 SUMP AND/OR EJECTOR PUMP

ACTION RECOMMENDED

6712 Birch Ct Page 34 of 43

The sump pump is improperly installed. Consulting with a plumbing professional for proper reinstallation is recommended.



7.11 Item 1(Picture) drains to backyard



7.11 Item 2(Picture) extension chord use



7.11 Item 3(Picture) improper installation

8. HEATING, AC, AND FIRE PLACES

B DESCRIPTION

The home inspector shall Observe permanently installed heating, ventilation, and air-conditioning (HVAC) systems using normal operating controls; chimneys, flues, and vents where readily visible; plus gas and solid fuel heating devices (fireplaces). The home inspector shall Describe energy sources; HVAC equipment and distribution type. The home inspector shall open accessible panels provided by the manufacturer or installer for routine maintenance. The home inspector is NOT required to operate systems when weather conditions or other circumstances may cause equipment damage; operate automatic safety controls; ignite solid fuel fires; or observe the interior of flues; observe heat exchangers; fireplace insert flue connections; humidifiers; electronic air filters; or the uniformity and or adequacy of forced air supply to the various rooms. ASBESTOS NOTE: In many homes built prior to the early 1980's asbestos material was used as sealant, tape, and/or insulation on HVAC system ducting and flues. Before repairing or replacing HVAC ducting, consulting with asbestos abatement professionals for further evaluation, testing, and abatement of the materials as may be needed is recommended. (NORMAL SERVICE LIFE: HVAC systems and components can be expected to last at least 20 vears.)

TYPES & MATERIALS: HEATING, AC, AND FIRE PLACES

Heating system type(s):

AC system type(s): Gas forced air Split system, 240 volts **Distribution ducting:**

Fireplace locations:

Family room

Flexible plastic, insulated

6712 Birch Ct Page 35 of 43 ITEMS: HEATING, AC, AND FIRE PLACES

8.0 HEATING SYSTEM(S)

SATISFACTORY

The heating system appeared to function properly. Regular professional service of the heating system is recommended as a safety precaution.



8.0 Item 1(Picture) family room closet

8.1 AGE OF HEATING SYSTEM(S)

The system appears to have been installed since approximately 2017.

8.2 EXHAUST AND VENTING SYSTEMS

⊗ SATISFACTORY

8.3 THERMOSTATS

SATISFACTORY

8.4 FILTER INFORMATION

SATISFACTORY

The filter is located inside the furnace.



8.4 Item 1(Picture)

8.5 DUCTS AND REGISTERS

⊗ SATISFACTORY

6712 Birch Ct Page 36 of 43

Each register was checked for warm and/or cooled air during the HVAC system inspection. The scope of the inspection does not include precise pressure and volume measurements.



8.5 Item 1(Picture) heating



8.5 Item 2(Picture) cooling

8.6 AIR CONDITIONING (AC)

⊗ SATISFACTORY

The AC system appeared to function properly. Air produced at the registers dropped at least 16 degrees relative to ambient air when operating in the cooling mode.



8.6 Item 1(Picture) back

8.7 AGE OF AC SYSTEM(S)

The system appears to have been installed since approximately 2017.

8.8 AC CONDENSATE DRAIN SYSTEM

SATISFACTORY

8.9 WOOD-BURNING FIREPLACES

SATISFACTORY

8.10 DAMPERS

SATISFACTORY

9. INTERIOR

6712 Birch Ct Page 37 of 43

B DESCRIPTION

The home inspector shall Observe walls, ceiling, and floors; steps, stairways, balconies, and railings. The home inspector shall Operate a representative number of windows and interior doors; and report signs of water penetration into the building or signs of abnormal condensation. The home inspector is NOT required to observe draperies, blinds, or other window treatments.

* STYLES & MATERIALS: INTERIOR

Ceiling Material:	Wall Material:	Window Types:
Textured Drywall	Textured drywall	Dual pane

ITEMS: INTERIOR

9.0 SMOKE DETECTORS

⊗ SATISFACTORY

Smoke detectors are installed in a central area and in each bedroom. SAFETY NOTE: Smoke detectors should be inspected, tested, and replaced according to the manufacturer's instructions.

9.1 CARBON MONOXIDE (CO) DETECTORS

⊗ SATISFACTORY

A Carbon Monoxide detector is installed. SAFETY NOTE: CO detectors should be inspected, tested, and replaced according to the manufacturer's instructions.



9.2 CEILINGS

⊗ SATISFACTORY

9.3 WALLS

ACTION RECOMMENDED

6712 Birch Ct Page 38 of 43

There are wall cracks in some areas. This is typical and does not seem to indicate excessive structural movement. Patching and painting is recommended.





9.4 DOORS

SATISFACTORY

9.5 WINDOWS

ACTION RECOMMENDED

Some windows have discoloration and/or evidence of fogging between the dual panes. Consulting with a window installation professional for further evaluation of all windows and replacement of the affected panes is recommended.



9.5 Item 1(Picture) family room



9.5 Item 2(Picture) master bedroom

9.6 FLOORS

ACTION RECOMMENDED

The flooring is damaged in some areas. Professional repair is recommended.



9.6 Item 1(Picture) master bathroom




9.6 Item 2(Picture) guest bathroom

6712 Birch Ct Page 39 of 43

9.7 TUB AND SHOWER AREAS

ACTION RECOMMENDED

(1) There are loose bathroom tiles. This may indicate moisture penetration behind the tiles. Consulting with a tile installation professional for further evaluation and repair is recommended.

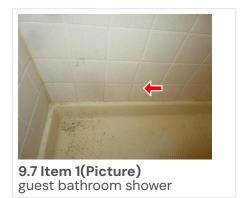

(2) The guest bathroom shower door and panel are cracked. Repair is recommended.



9.8 COUNTERS AND CABINETS

SATISFACTORY

10. KITCHEN APPLIANCES

B DESCRIPTION

The home inspector shall Inspect and Operate the basic functions of installed kitchen appliances such as: dishwasher, disposal, oven, stove, stove fan, microwave oven, trash compactor; and instant hot water device. The inspector is NOT required to evaluate the complete and proper function of each appliance. The inspector is NOT required to inspect clocks, warming drawers, coffee makers, timers, refrigerators, freezers, ice-makers, and non built-in appliances. (NORMAL SERVICE LIFE: Kitchen appliances can be expected to last at least 10 years)

ITEMS: KITCHEN APPLIANCES

10.0 STOVE

⊗ SATISFACTORY

10.1 OVEN

6712 Birch Ct Page 40 of 43

SATISFACTORY

10.2 STOVE EXHAUST FAN

SATISFACTORY

10.3 DISHWASHER

⊗ SATISFACTORY

No "air gap" for the dishwasher drainage system is installed. Air gaps are not required for all dishwasher installations and are not required in all municipalities. Consulting the dishwasher installation manual and the local municipality for more information should be considered.

10.4 DISPOSAL

SATISFACTORY

10.5 BUILT-IN MICROWAVE OVEN

SATISFACTORY

11. INSULATION AND VENTILATION

B DESCRIPTION

The home inspector shall Observe insulation and vapor retarders in unfinished spaces; ventilation of attics, basements, and crawl spaces; kitchen, bathroom, and laundry venting systems; and Operate accessible thermostat-controlled attic and crawl space ventilation fans (depending on current temperature). The home inspector shall Describe insulation or lack thereof in unfinished spaces. The home inspector is NOT required to move or disturb insulation.

* STYLES & MATERIALS: INSULATION AND VENTILATION

Dryer duct:

Attic insulation:

Wall insulation:

Flexible metal

Loose fill (blown in)

Assumed to be installed based on the age of building

Subfloor insulation:

None

ITEMS: INSULATION AND VENTILATION

11.0 ATTIC INSULATION

SATISFACTORY

11.1 ATTIC VENTILATION

SATISFACTORY

6712 Birch Ct Page 41 of 43

11.2 DRYER DUCT

⊗ SATISFACTORY

11.3 BATHROOM VENTILATION

SATISFACTORY

11.4 CRAWL SPACE VENTILATION

SATISFACTORY

6712 Birch Ct Page 42 of 43



INVOICE

DB Standard Home Inspection DBStandardOffice@gmail.com 925-487-2811 Inspected By: Justin Mullaney

Inspection Date: 6/12/2024 Report ID: 20240612-6712-Birch-Ct

Customer Info:	Inspection Property:
Richard Brester, Successor Trustee	6712 Birch Ct Dublin CA 94568
Customer's Real Estate Professional: John Manos	

Price	Amount	Sub-Total
700.00	1	700.00
-50.00	1	-50.00
	700.00	700.00 1

Tax \$0.00 Total Price \$650.00

Payment Method: Payment Status:

Note:

6712 Birch Ct Page 43 of 43