

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 8915	Street Appaloosa Ct	City Rancho Cucamonga	Zip 91737-1456	Date of Inspection 06/06/2025	Number of Pages 1 of 8
-----------------------------	-------------------------------	---------------------------------	--------------------------	---	----------------------------------



TermiKE Pest Control

137 W Chapman Ave. Ste C

Fullerton, CA 92832

Tel 714-222-1326 Fax 888-683-3592

Registration #: 8832

A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.

Report #: 3216

Ordered by: WM Real Estate Group 8915 Appaloosa Ct Rancho Cucamonga, CA 91737-1456 951-310-3458	Property Owner and Party of Interest: WM Real Estate Group 8915 Appaloosa Ct Rancho Cucamonga, CA 91737-1456 951-310-3458	Report sent to: Walid Milad walid.milad@gmail.com
---	---	---


COMPLETE REPORT ☐
LIMITED REPORT ☒
SUPPLEMENTAL REPORT ☐
REINSPECTION REPORT ☐

General Description: Two Story, Single Family Residence, Slab And Raised Foundation, Tile Roof, Vacant -Limited To Partial: Substructure Area, Attic, Patio And Exterior Only	Inspection Tag Posted: Other Tags Posted:
---	--

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☐
 Drywood Termites ☒
 Fungus/Dryrot ☒
 Other Findings ☒
 Further Inspection ☐

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

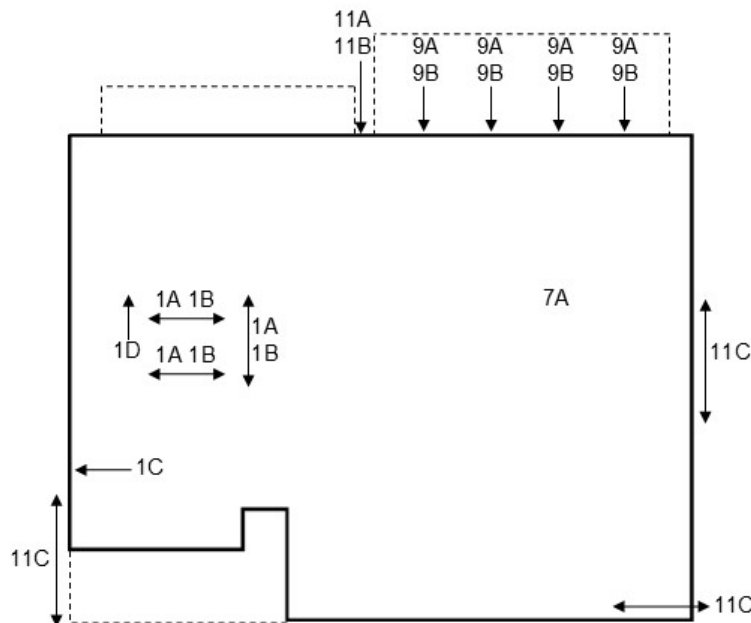

Inspected By: Mickael Labib State License No.: OPR14043 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (REV. 04/2015)

General Comments

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each re-inspection. The re-inspection must be done within ten (10) working days of request. The re-inspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

1. SUBSTRUCTURE AREA: 1A 1B 1C 1D
2. SHOWER:
3. FOUNDATIONS:
4. PORCHES:
5. VENTILATION:
6. ABUTMENTS:
7. ATTIC SPACES: 7A
8. GARAGES:
9. PATIOS AND/OR DECKS: 9A 9B
10. INTERIOR:
11. EXTERIOR: 11A 11B 11C

SUBSTRUCTURE AREA

Description of Findings

Finding:	1A	Evidence of drywood termites was found in area (s) indicated on the diagram.
Recommendation:		Fumigate the structure(s) with an approved fumigant for the eradication of drywood termites. A three-day process that also includes the aeration of the structure before admitting occupants again. Owner/agent to prepare for fumigation by following guidelines provided by Termike Pest Control. Terms, waivers, and conditions are detailed in a separate agreement, given to customer after service is requested.
Note:		Fumigation: \$3,420 - \$342 Discount = 3,078 *3 Yr. Warranty
Price:	\$3,078.00	
Finding:	1B	Damage from drywood termites was found in area(s) indicated on the diagram.
Recommendation:		Repair/Patch damaged wood members by drywood termites as necessary. One coat of primer will be applied to these areas. Painting is not included. If additional adverse conditions are uncovered during repairs, further inspection will be recommended and a supplemental report will be issued indicating any infection, or additional repairs.
Note:		Wood Damage Repair Work: \$4,050 - \$405 Discount = \$3,645 *2 Yr. Warranty
Price:	\$3,645.00	
Finding:	1C	Damage from dry rot/fungus was found in area(s) indicated on the diagram.
Recommendation:		Repair/Patch dry-rot damaged wood members as necessary. One coat of primer will be applied to these areas. Painting is not included. If additional adverse conditions are uncovered during repairs, further inspection will be recommended and a supplemental report will be issued indicating any infection, or additional repairs.
Note:		*2 Yr. Warranty
Price:		Please refer to 1B finding for price.
Finding:	1D	Sighting of water stain was found in area(s) indicated on the diagram.
Recommendation:		Owner should employ the services of the appropriate tradesman to make recommendations and perform necessary repairs.
Price:		Not Estimated. If you have any questions please contact us.

ATTIC SPACES

Finding:	7A	Evidence of drywood termites was found in area (s) indicated on the diagram.
Recommendation:		SEE 1A
Price:		Please refer to 1A finding for price.

PATIOS AND/OR DECKS

Finding:	9A	Evidence of drywood termites was found in area (s) indicated on the diagram.
Recommendation:		SEE 1A
Price:		Please refer to 1A finding for price.
Finding:	9B	Damage from drywood termites was found in area(s) indicated on the diagram.
Recommendation:		SEE 1B
Price:		Please refer to 1B finding for price.

EXTERIOR

Finding:	11A	Evidence of drywood termites was found in area (s) indicated on the diagram.
Recommendation:		SEE 1A
Price:		Please refer to 1A finding for price.
Finding:	11B	Damage from drywood termites was found in area(s) indicated on the diagram.
Recommendation:		SEE 1B

Price: Please refer to 1B finding for price.

Finding: 11C Damage from dry rot/fungus was found in area(s) indicated on the diagram.

Recommendation: SEE 1C

Price: Please refer to 1B finding for price.

Grand Total: \$6,723.00

Disclaimer

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report. Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property. Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following:

Termike Pest Control (714) 222-1326 / (888) 683-3592

Poison Control Center (800) 876-4766

County Health Dept.

Orange County (714) 834-7700; Los Angeles County (213) 250-8055; San Bernardino County (909) 387-6280; Riverside County (909) 358-5000

County Agriculture Commission

Orange County (714) 447-7100; Los Angeles County (626) 575-5465; San Bernardino County (909) 387-2115; Riverside County (951) 955-3000

Structural Pest Control Board (916) 561-8704

2005 Evergreen St. Suite 1500, Sacramento, CA 95825

TERMITE AND FUNGUS CONTROL CHEMICALS USED:

Tim-bor (EPA Reg. No. 64405-8), Active Ingredient: Disodium Octaborate Tetrahydrate Termidor SC (EPA Reg. No. 7969-210), Active Ingredient: Fipronil Vikane (EPA Reg. No. 1015-78), Active Ingredient: Sulfuryl Fluoride

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his/her work or supplies, has a right to enforce a claim against your property. This means that, after a court hearing, your property could be sold by a court officer, and the proceeds of the sale will be used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if subcontractor, laborer, or suppliers remain unpaid.

Preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

Note: All repair bids on this report are to repair existing structures as noted on our report. It is the responsibility of the owner of this property to inform Termike Pest Control. If some existing structure being repaired is not permitted or not built to code. It is the property owners responsibility prior to approving any repairs to check with the City Building Dept. to see if permits are required for the work estimated below. If required, the property owner will need to pull permits as an owner and notify Termike Pest Control. Any additional work required by City Building Dept. and or field inspectors will be an additional cost.

PLEASE NOTE: It is the responsibility of the ESCROW COMPANY to notify us IMMEDIATELY, if for any reason the transaction falls out of escrow or is cancelled. If this should happen, the HOMEOWNER is responsible for paying the full

invoiced amount, for any and all work completed, within 10 days of the cancelled escrow. ADDITIONALLY: It is the AGENTS' responsibility to provide Termite Pest Control with any and all escrow information. If we do not receive any Escrow information, all reports and billing invoices will be sent to the agent ordering the inspection. It is then the AGENTS' responsibility to furnish any and all WDO/Termite inspections, completion, and billing documentation directly to Escrow. Unless other arrangements have been made and documented, Escrow should NOT close before WDO invoices are PAID IN FULL.

FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. ***

NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, etc.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE A RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY. NOTICE: THE CHARGE FOR SERVICE THAT THIS COMPANY SUBCONTRACTS TO ANOTHER REGISTERED COMPANY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH PAYING THE SUBCONTRACTOR. YOU MAY ACCEPT TERMITE PEST CONTROL'S BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, TERMITE PEST CONTROL WILL NOT BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM. Pesticides are the products Termike Pest Control uses to control the target pests listed in your agreement. Pesticides make a better life for all by helping control disease carriers and wood destroying insects, thus protecting our health and property. When properly used, pesticides pose no problems to humans or the environment. Your Technician is a State certified applicator whose knowledge is constantly being upgraded through regularly scheduled training sessions. If you have any questions, please call us at: 714-222-1326 or write to: Termike Pest Control, 137 W Chapman Ave. Ste C, Fullerton, CA 92832.

STATE LAW REQUIRES THAT YOU BE GIVEN THE FOLLOWING INFORMATION:
PESTICIDE NOTICE (SECTION 8538)

CAUTION: PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following an application you experience symptoms similar to common seasonal illness, comparable to the flu, eye, skin, or lung irritation, or difficulty with blood clotting, contact Termike Pest Control, your physician, and/or your Poison Control Center. For the Poison Control Center, contact the following: (1-800-876-4766). FOR FURTHER INFORMATION: Contact any of the following: Your pest control company is Termike Pest Control; for Regulatory Information call the Structural Pest Control Board (916-561-8700), or write 2005 Evergreen Street, Suite 1500, Sacramento, CA, 95815-3831. For answers to your health questions, call the County Health Department (see list below) and for application information, contact the County Agriculture Commissioner (see list below):

County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.
Los Angeles:	(213) 250-8055	(626) 575-5466	Riverside:	(909) 358-5000	(909) 955-3000			
Orange:	(714) 834-7700	(714) 447-7100	San Bernardino:	(909) 387-6280	(909) 387-2115			

PESTICIDES: 24-3-8 w/Dimension(Dithiopyr),565 Plus XLO(Pyrethrins, PBO, MGK-264),ACE-Jet(Acephate), Advance 375A Select(Abamectin B1), Advance Granular Carpenter Ant Bait(Abamectin B1), Advion Ant Bait Arena(Indoxacarb),Advion Ant Gel(Indoxacarb),Advion Cockroach Bait Arena(Indoxacarb),Advion Cockroach Gel Bait(Indoxacarb), Advion Insect Granular Bait(Indoxacarb),Advion Micro Flow(Indoxacarb), Advion WDG(Indoxacarb),AGRI-FOS(Mono-and di-potassium salts of Phosphorous Acid), Allure MD(Z-9,E-12-Tetradecadien-1-yl acetate), Alpine Dust(Dinotefuran & Diatomaceous Earth), Alpine Flea with IGR(Dinotefuran, Pyriproxyfen, Prallethrin), Alpine PI(Dinotefuran), Alpine Pressurized Fly Bait(Dinotefuran), Alpine WSG(Dinotefuran), Altosid Briquets(S-Methoprene), Altriset(Chlorantr aniliprole), Aprehend(Beauveria bassiana),Arbor-OTC(Oxytetracycline Hydorchloride), Archer(Pyriproxyfen), Arena 0.25G(Clothianidin), Avert DF(Abamectin), Avian Control Repellent(Methyl Anthranilate), Avitrol Whole Corn(4-Aminopyridine),AzaSol(Azadirachtin),Bactimos PT(Bacillus thuringiensis), balEnce(Beauveria bassiana Strain HF23),Bandit(Imidacloprid),Banner Maxx II(Propiconazole), BioampAA(),Bo ra-Care(Disodium Octaborate Tetrahydrate),Capstone(Aminopyralid, Triclopyr), Card-O-Vap 8(Dichlorvos, DDVP),CB-80(Pyrethrins, Piperonyl Butoxide),Chase Granular Mole Gopher Repellent(Castor Oil USP, Sodium Lauryl Sulfate), Chloropricrin(Chloropricrin),Cidetrak IMM((9Z,12E)-9,12-tetradecadien-1-yl acetate), Cidetrak IMM MEC((9Z,12E)-9,12-tetradecadien-1-yl acetate),CimeXa(Amorphous Silica Gel),Conserve SC(spinosad), Contrac All Weather Blox(Bromadiolone), ContraPest(4-Vinylcyclohexene diepoxide, Triptolide), Crossfire(Clothianidin, Metofluthrin, PBO), CrossFire Aerosol(Clothianidin, Metofluthrin, Piperonyl Butoxide),Cy-Kick C & C Pressurized Residual(Cyfluthrin), CyKick CS(Cyfluthrin),DeltaGard(Deltamethrin),Deltaguard G(Deltamethrin), Demand CS(Lambda-Cyhalothrin),Detex Blox(N/A),Diacon IGR(Methoprene),Dimension Ultra 40 WP(Dithiopyr), Dismiss CA(Sulfentrazone),Ditrac All Weather Blox (Diphacinone),Ditrac Ground Squirrel Bait(Diphacinone), Dioxem Precise(Indoxacarb),Dragnet SFR(Permethrin),Drain Gel(Bacteria (Bacillus Spores)), Drione(Pyrethrins, Piperonyl Butoxide Technical, Amorphous Silica Gel),Drive XLR8(dimethylamine salt of quinclorac), Esglanade 200 SC(Indaziflam), Esglanade EZ(Indaziflam, Diquat Dibromide, Glyphosate, Isopropylamine Salt), Essentria G(Eugenol, Thyme Oil),Essentria IC Pro(Sodium Lauryl Sulfate, Geraniol, Clove Oil, Cornmint Oil), Essentria IC3(Rosemary Oil, Geraniol, Peppermint Oil),Essentria Wasp & Hornet(Peppermint oil, Sodium lauryl sulfate),Evergreen(Pyrethrins),ExciteR(Pyrethrins, Piperonyl Butoxide),Fastrac All Weather Blox(Bromethalin), Fastrac Soft Bait(Bromethalin),Fendona CS(alpha-Cypermethrin), Fendona CS II(alpha-Cypermethrin), FirstStrike(difethialone), Flatline(Chlorophacinone),Foam Fighter(Dimethyl silicone fluid emulsion),Fuse(Fipronil, Imidacloprid),Fusilade II(Fluazifop-P butyl),Gallery 75 DF(Isoxaben), Garlon 4 Ultra(Triclopyr),Gentrol Aerosol(Hydroprene),Gentrol IGR Concentrate(Hydroprene), Gentrol Point Source(Hydroprene),Headway G(Azoxystrobin),Heritage(Azoxystrobin),IGI Carbon Dioxide(Carbon Dioxide),IMA-Jet(Imidacloprid),Impel Rods (Anhydrous Disodium Octaborate),In2Mix(Pyriproxyfen, Beauveria bassiana strain GHA),In Vade bio foam(foaming agents, citrus oil and waste-digesting bacillus bacteria), InVite liquid lure(Food grade materials),Kapus Ground Squirrel(Diphacinone, Imidacloprid),Kapus- D(Diphacinone),Kapus-D Ground Squirrel(Diphacinone, Imidacloprid),Lesco Hort Oil(Mineral Oil), Lesco Three-Way(MCPA, Triclopyr, Dicamba),Lifeline(Glufosinate-ammonium),Liqua-Tox II(Sodium Salt of Diphacinone),Magnify(Ammonium Salts, Alkyl polyglucoside + Dimethylpolysiloxane), Maintain CF 125(Methyl Ester Chloreflurenol, Flurecol-Methyl, Methyl-2,7-dichloro-9-hydroxyfluorene-9- carboxylate), Maxforce FC Roach Bait Stations(Fipronil),Maxforce FC Ant Stations(Fipronil),Maxforce FC Select(Fipronil),Maxforce Fleet Ant Gel(Fipronil),Maxforce Fly Spot Bait(Imidacloprid),Maxforce Granular Fly Bait (Imidacloprid),Maxforce Impact(Clothianidin),MaxForce Quantum(Imidacloprid),Merit 75 WSP(Imidacloprid),Microcare 3% CS(Pyrethrins, Piperonyl Butoxide, Technical),Milestone Speciality(aminopyralid),Mole Scram(Castor Oil, Citronella Oil, Garlic Oil),Mother Earth Scatter Bait(Boric Acid),Natular DT(Spinosad),Niban(Orthoboric Acid), No Foam A(Nonylphenoxy polyethoxy ethanol, Isopropanol and Fatty acids),No Foam B(Octyl phenoxy polyethoxy ethanolisopropanol, Linear alkyl sulfonate, IBuffering acids, Coconut amine, condensate, Silicone defoamer),NU-FILM- P(Poly - 1 -p-Menthene), Nuvan ProStrips+(DDVP),NyGuard(Pyriproxyfen),Odoban RTU(Alkyl (C12-16) dimethyl benzyl ammonium chloride), OneGuard(Lambda-cyhalothrin, Prallethrin, Pyriproxyfen, Piperonyl butoxide),Onslaught(Esfenvalerate, Prallethrin, Piperonyl butoxide), Onslaught FastCap(Esfenvalerate, Prallethrin, PBO),Optigard Ant Gel Bait(Thiamethoxam(1)),Optigard Roach Bait(Emamectin benzoate),Optimate(Gamma Cyhalothrin),OvoControl P(Nicarbazin),P.C.Q. Pro(Diphacinone), Patrol(Lambda-Cyhalothrin),PBO-8(Technical Piperonyl Butoxide), PENTRA-BARK(Polyalkylene Modified Heptamethyltrisiloxane and nonionic surfactants), Permethrin SFR(Permethrin),Perm-X UL 30/30(Permethrin, Piperonyl Butoxide), Petcor 2(Etofenprox, (S)-Methoprene, Piperonyl Butoxide), Phantom II PI(Chlorfenapyr),Phantom SC(Chlorfenapyr), PHOSPHO-Jet(Mono-and di-potassium salts of Phosphorous Acid),Precor 2625(Etofenprox, Tetramethrin,Pyrethrins,PBO, S-Methoprene), Precor IGR Concentrate(Methoprene),Premise 75(Imidacloprid),Premise Foam(Imidacloprid),Premise Pro(Imidacloprid), Pro Foam Platinum(Sulfates Disodium Lauroampho Diacetate), Proflex(Lambda-cyhalothrin, Novaluron, Pyriproxyfen), Progress(Ethofumesate),Propizol(Propiconazole.),Purge III(Pyrethrins), Quikstrike(Dinotefuran),QuikStrike Fly Bait Spray(Dinotefuran),Rat-Out Gel(Garlic Oil, White pepper), RatX(Corn Gluten Meal, Sodium Chloride, Citric Acid, Pubescent Whole Egg Solids, Soybean Oil),Rodent Bait Diphacinone .01% (Diphacinone),RoundUp Custom(GLYPHOSATE, ISOPROPYLAMINE SALT), Rozol Ground Squirrel(Chlorophacinone),Rozol Pocket Gopher Bait(Chlorophacinone-Lipadione),Rozol Vole Bait(Chlorophacinone), Safari 20 SG(Dinotefuran), Sedgehammer(Halosulfuron-methyl),Selontra(Chole calciferol),SFM-75(Sulfometuron Methyl), Sluggo(Iron Phosphate), Sluggo Leaf Life(Iron Phosphate), Snapshot(Trifluraline, isoxaben & isomers), SpeedZone Southern(Carfentrazone-ethyl, 2,4-D, 2-ethylhexyl ester, MCPP, Dicamba),SpeedZone Southern EW(2,4-D, Dichloropro-p, Dicamba, Carfentrazone-ethyl), Sumari(Clothianidin, Pyriproxyfen), Sumari Ant Bait(Chlothianidin), Sumilarv(Pyriproxyfen), SureGuard SC(Flumioxazin), Suspend PolyZone(Deltamethrin), Suspend SC(Deltamethrin), Takedown II(Bromethalin), Talpid(Bromethalin),TAP Insulation(Boric Acid), Taurus SC(Fipronil),Tekko 10(Novaluron), Tekko Pro(Novaluron, Pyriproxyfen),Tempo SC Ultra(Beta-Cyfluthrin), Terad3 Ag Blox(Cholecalciferol), Terad3 Blox(Cholecalciferol), Termidor Foam(Fipronil), Termidor HE(Fipronil), Termidor SC(Fipronil), Terro Ant Liquid Bait Station(Sodium Tetraborate Decahydrate), Thermolock InCide(Othorboric Acid), Timbor(Disodium Octaborate Tetrahydrate), TREE-age G4(Emamectin Benzoate), Treeage R-10(Emamectin Benzoate), Trelona(Novaluron),ULD BP 100 II(Pyrethrin, PBO),ULD BP 300 II(Pyrethrins, PBO), Vikane(Sulfuryl Fluoride), Vital Oxide(Chlorine Dioxide, Alkyl dimethyl benzyl ammonium chloride, Alkyl dimethyl ethylbenzyl ammonium chloride), Wasp Freeze II(Prallethrin), WHY Trap(Heptyl Butyrate, 2-Methyl-1-butanol, Acetic Acid), Wilco Ground Squirrel Ag(Diphacinone), Wilco Ground Squirrel Bait(Diphacinone), Zenprox EC(Etofenprox),Zythor(Sulfuryl Fluoride).Termike Pest Controlwill not apply any compound not authorized for use in California. **Termike Pest Control will not apply any** compound not authorized for use in California.

If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately. Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. It's purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

Termike Pest Control, License Number 8832