

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT #: 20201239

BUILDING NO. 33255	STREET NANCY LANE	CITY MENEFEE	ZIP 92584	Date of Inspection 03/15/2024	NUMBER OF PAGES 1 of 6
-----------------------	----------------------	-----------------	--------------	----------------------------------	---------------------------

## ALL COUNTY TERMITE & CONST.

9821 Hawley Rd  
El Cajon, CA 92021  
619-561-1645  
PR 8486

[actconstruction2020@gmail.com](mailto:actconstruction2020@gmail.com)



Ordered by: <b>SHARON WITTMAYER</b>	Property Owner and/or Party of Interest	Report sent to:
--	---	-----------------

COMPLETE REPORT    
 LIMITED REPORT    
 SUPPLEMENTAL REPORT    
 REINSPECTION REPORT


GENERAL DESCRIPTION: This is a one story, stucco, single family residence. It has a detached garage and an attached patio. It has a composition roof and was occupied and furnished at the time of inspection.	Inspection Tag Posted: Attic.  Other Tags Posted:
---	--

An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites    
 Drywood Termites    
 Fungus/Dryrot    
 Other Findings    
 Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items

Key:    1 = Subterranean Termites    2 = Drywood Termites    3 = Fungus/Dryrot    4 = Other Findings    5 = Further Inspection

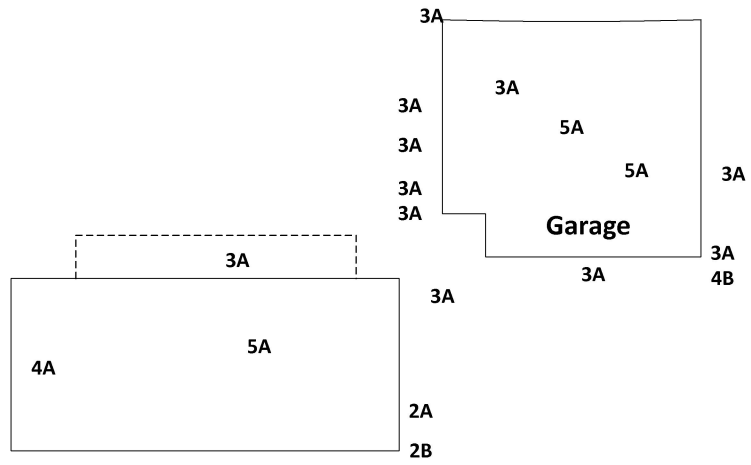

Inspected By           WAYNE K. LAYTON             
 License No.           OPR 13264             
 Signature           *Wayne K. Layton*          

You are entitled to obtain copies of all reports and completion notices on this property report to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815-3831.  
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov). (form t1a - 4/27/17) 43M-41 (Rev. 10/01)

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
33255	NANCY LANE	MENELEE	92584	03/15/2024	2 of 6

## NOTES, CAUTIONS AND DISCLAIMERS

\*\*\*\*\*  
 IT IS THE OWNER'S RESPONSIBILITY TO DISCLOSE ANY KNOWLEDGE OF CONDITIONS WHICH ARE NOT VISIBLE DURING THE COURSE OF A NORMAL INSPECTION!!  
 \*\*\*\*\*

THE PEST CONTROL INDUSTRY RECOGNIZES A STRUCTURE TO HAVE CERTAIN AREAS BOTH INACCESSIBLE AND NOT INSPECTED. THESE AREAS INCLUDE BUT ARE NOT LIMITED TO: INACCESSIBLE AND/OR INSULATED ATTICS OR PORTIONS THEREOF, ATTICS WITH LESS THAN 18" CLEAR CRAWL SPACE, THE INTERIOR OF HOLLOW WALLS; SPACES BETWEEN A FLOOR OR PORCH DECK AND THE CEILING BELOW; AREAS WHERE THERE IS NO ACCESS WITHOUT DEFACING OR TEARING LUMBER, MASONRY, OR FINISHED WORK; AREAS OR BELOW APPLIANCES OR BENEATH FLOOR COVERINGS, FURNISHINGS; AREAS WHERE BEHIND ENCUMBRANCES, STORAGE, CONDITIONS, OR LOCKS MAKE INSPECTION IMPRACTICAL; AND AREAS OR TIMBERS AROUND EAVES THAT WOULD REQUIRE USE OF AN EXTENSION LADDER.

SLAB FLOOR CONSTRUCTION HAS BECOME MORE PREVALENT IN RECENT YEARS. FLOOR COVERING MAY CONCEAL CRACKS IN THE SLAB THAT WILL ALLOW INFESTATIONS TO ENTER. INFESTATIONS MAY BE CONCEALED BY PLASTER, SHEETROCK OR OTHER WALL COVERINGS SO THAT A DILIGENT INSPECTION MAY NOT UNCOVER THE TRUE CONDITION. THE ROOF WAS NOT INSPECTED DUE TO LACK OF ACCESSIBILITY, QUALIFICATION AND LICENSING. THESE AREAS ARE NOT PRACTICAL TO INSPECT BECAUSE OF HEALTH HAZARDS, DAMAGE, OBSTRUCTION OR INCONVENIENCE AND UNLESS SPECIFIED OR DESCRIBED IN THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT. THIS COMPANY SHALL EXERCISE DUE CARE DURING INSPECTIONS AND TREATMENTS BUT ASSUMES NO LIABILITY FOR ANY DAMAGE TO TILES, SLATES, SHINGLES OR OTHER ROOFING MATERIALS, INCLUDING PATIO COVERS, ALUMINUM AWNINGS, SOLAR HEATING, PLANTS, SHRUBBERY OR PAINT DURING ANY TYPE OF TREATMENT. CUSTOMER AGREES TO HOLD COMPANY HARMLESS FOR ANY DAMAGE WHICH MAY OCCUR TO PLANT LIFE, WIRING, TREES, VINES, PETS, PLUMBING LEAKS OR CHANGES BEYOND CONTROL OF THE COMPANY WHICH MAY OCCUR DURING THE PERFORMANCE OF THIS WORK.

1993.1 THIS COMPANY WILL DO ONLY A VISUAL INSPECTION OF WORK DONE BY OTHERS AND IF INSPECTION OF CONCEALED AREAS IS DESIRED, INSPECTION OF WORK IN PROGRESS WILL BE NECESSARY. ANY GUARANTEES MUST BE RECEIVED FROM PARTIES PERFORMING REPAIRS.

THIS COMPANY SHALL RECOMMEND FURTHER INSPECTION IF THERE IS ANY QUESTION ABOUT NOTED AREAS. THIS COMPANY WILL NOT REINSPECT UNLESS A BUILDING PERMIT [WHERE APPLICABLE] IS POSTED AND SIGNED VIA: LOCAL BUILDING CODE INSPECTOR. IF A REINSPECTION IS EITHER REQUIRED OR REQUESTED IT MUST BE COMPLETED WITHIN FOUR MONTHS FROM THE DATE OF THE ORIGINAL INSPECTION. THE COST OF A REINSPECTION SHALL NOT EXCEED, AND WILL BE THE SAME AS, THE COST OF THE ORIGINAL INSPECTION. ANY RECONSTRUCTION TO THE STRUCTURE, AT AREAS THAT WERE INACCESSIBLE DURING THE ORIGINAL INSPECTION, SHALL BE REINSPECTED BY THIS COMPANY PRIOR TO ANY CLOSING OF AREA[S]. RE: STRUCTURAL PEST CONTROL ACT ARTICLE 6 SECTION 8516[B], PARAGRAPH 1990[J]. AMENDED MARCH 1, 1974. ALL COUNTY TERMITE AND CONSTRUCTION IS NOT RESPONSIBLE FOR THE CONDITION OF THE ORIGINALLY INACCESSIBLE AREA.

ANY WORK PERFORMED AGAINST AN EXISTING TITLE ESCROW WILL BE THE FINANCIAL RESPONSIBILITY OF THE PARTY ORDERING THE INSPECTION REPORT. IN CASE OF NON-PAYMENT BY THE OWNER, REASONABLE ATTORNEY'S FEES AND COSTS OF COLLECTION SHALL BE PAID BY THE OWNER, WHETHER SUIT BE FILED OR NOT. A SERVICE CHARGE OF 1 1/2 PERCENT PER MONTH (18 PERCENT PER ANNUM) WILL BE CHARGED ON ALL BALANCES OVER THIRTY (30) DAYS.

THE PURPOSE OF THIS REPORT IS TO DOCUMENT FINDINGS AND RECOMMENDATIONS WHICH PERTAIN TO THE ABSENCE OR PRESENCE OF WOOD DESTROYING ORGANISMS AND OR CONDUCIVE CONDITION[S] AT THE TIME OF INSPECTION. THIS REPORT SHOULD BE READ CAREFULLY AND IS NOT TO BE CONFUSED WITH A HOME MAINTENANCE SURVEY. THE CLIENT'S COOPERATION AND COMPLIANCE TO CORRECT AND OR COMPLETE THE RECOMMENDATIONS DOCUMENTED IN THIS REPORT ARE OBLIGATORY. WITHOUT A MUTUAL EFFORT, THIS COMPANY CAN NOT ASSURE EFFECTIVE OR SATISFACTORY RESULTS.

THE OWNER OF THIS STRUCTURE HAS CERTAIN OBLIGATIONS REGARDING MAINTENANCE PERTAINING TO THE DETERRENCE OF WOOD DESTROYING ORGANISMS. MAINTENANCE PROCEDURES INCLUDE; BUT ARE NOT LIMITED TO: REASONABLE CLEANING, UPKEEP OF ROOFS, GUTTERS AND DOWNSPOUTS; PAINTING AND SEALING OF EXPOSED SURFACES; CAULKING ABOUT DOORS AND WINDOWS OR GROUTING ABOUT COMMODOES, TUB AND SHOWER ENCLOSURES; STORING MATERIALS ONE FOOT AWAY FROM THE STRUCTURE'S FOUNDATIONS; PROVIDING ADEQUATE VENTILATION, MAINTAINING PROPER DRAINAGE AWAY FROM STRUCTURE (INCLUDING SPRINKLER SYSTEMS); KEEPING SOIL LEVELS BELOW THE TOP OF FOUNDATIONS AND PROHIBITING EARTH CONTACT WITH WOOD COMPONENTS OF THE STRUCTURE(S).

PREPARATION IS MANDATORY AND IT IS THE OWNER'S RESPONSIBILITY TO PROVIDE THE UTILITIES NECESSARY FOR TERMITE WORK. (IF RENTAL OF A GENERATOR SHALL BE NECESSARY, THE COST OF RENTAL, PICK UP AND RETURN WILL BE ADDED TO THE QUOTED COST), ALL SOIL SHALL BE SOAKED SIX INCHES DEEP AND TWELVE INCHES OUTWARD FROM EXTERIOR FOUNDATIONS ONE DAY PRIOR TO FUMIGATION. ALL PLANTS OR SHRUBBERY MUST BE TRIMMED BACK ONE FOOT FROM THE STRUCTURE PRIOR TO ANY FUMIGATION OR SUBTERRANEAN TERMITE TREATMENT. ANY STORED MATERIALS, FURNISHINGS, ETC., ON SLAB FLOORING MUST BE MOVED ONE FOOT AWAY FROM FOUNDATION AND PARTITION WALL DURING INSPECTING AND TREATMENT. THE OWNER MUST ALLOW ACCESS FOR ANY NECESSARY INSPECTION OR TREATMENT.

GUARANTEE POLICY:  
 THIS GUARANTEE EXCLUDES STRUCTURES WITH SUB SLAB HEATING/AIR CONDITIONING SYSTEMS, PLENUM CONSTRUCTION WITH AIR CONDITIONING AND HEATING DUCTS IN USE, A WELL OR CISTERN WITHIN FIFTY FEET AND AREAS THAT ARE INACCESSIBLE FOR TREATMENT. ADDITIONAL EXCLUSIONS INCLUDE STRUCTURES WITH DAMAGE TO OR FROM EXCESSIVE MOISTURE, INADEQUATE CONSTRUCTION, AREAS OF INACCESSIBILITY, DETERIORATING MATERIALS, MASONRY FAILURE, GRADE ALTERATION, PIPES AND CONDUITS BENEATH CONCRETE SLAB, FURNISHINGS OR CONTENTS, ETC. NO GUARANTEE WILL BE ISSUED FOR ANY WORK THAT IS A SECONDARY RECOMMENDATION OR WORK COMPLETED BY OTHERS. ALL REPAIRS PERFORMED BY OTHERS MUST BE REINSPECTED BY OUR COMPANY BEFORE A CERTIFICATION WILL BE ISSUED. ALSO, ALL REPAIRS COMPLETED BY OTHERS MUST BE GUARANTEED IN WRITING AND SUBMITTED TO OUR COMPANY BEFORE A CERTIFICATION WILL BE ISSUED. THIS FIRM DOES NOT MAKE STATEMENTS

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
33255	NANCY LANE	MENEFEE	92584	03/15/2024	3 of 6

*CONCERNING WORKMANSHIP. WORKMANSHIP IS ONLY DETERMINABLE BY THOSE PAYING FOR OR RECEIVING THOSE SERVICES. GUARANTEED FOR THIRTY DAYS ARE ANY PLUMBING, GROUTING, CAULKING AND RESETTING OF COMMODES, SINKS OR ENCLOSURES. ALL OTHER WORK PERFORMED BY THIS COMPANY SHALL BE GUARANTEED FOR THE DURATION OF ONE YEAR, INCLUDING TERMITE TREATMENTS, ALL COUNTY TERMITE AND CONSTRUCTION- ASSUMES NO LIABILITY OR RESPONSIBILITY FROM WORK DONE BY HOMEOWNER OR OTHERS., TENT FUMIGATION IS GUARANTEED FOR THE DURATION OF TWO YEARS, AND DOES NOT INCLUDE ANY TERMITE ISSUES FROM NEW TERMITES THAT MIGHT FLY INTO OR NEAR THE BUILDING.*

*THIS WOOD DESTROYING PEST & ORGANISM REPORT DOES NOT INCLUDE MOLD OR ANY MOLD LIKE CONDITIONS. NO REFERENCE WILL BE MADE TO MOLD OR MOLD LIKE CONDITION. MOLD IS NOT A WOOD DESTROYING ORGANISM AND IS OUTSIDE THE SCOPE OF THIS REPORT AS DEFINED BY THE STRUCTURAL PEST CONTROL ACT. IF YOU WISH YOUR PROPERTY TO BE INSPECTED FOR MOLD OR MOLD LIKE CONDITIONS, PLEASE CONTACT THE APPROPRIATE MOLD PROFESSIONAL.*

*THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT DOES NOT INCLUDE WORK WHICH REQUIRES CONTACT WITH MATERIALS CONTAINING ASBESTOS. TERMITE INSPECTORS HAVE NO EXPERTISE OR LICENSE IN ASBESTOS ANALYSIS. ASBESTOS IS A NATURAL OCCURRING MINERAL FIBER USED EXTENSIVELY IN CONSTRUCTION PRIOR TO 1978. THE OWNER, EMPLOYEE OR CONTRACTOR MUST DETERMINE THE ASBESTOS STATUS PRIOR TO THE COMMENCEMENT OF WORK ON A PROJECT. OCCUPANTS AND EMPLOYEES MUST BE PROTECTED FROM ASBESTOS FIBER RELEASE. SHOULD ASBESTOS BE OBSERVED DURING ANY CONSTRUCTION OR DEMOLITION, WORK MUST STOP. THE OWNER SHALL OBTAIN THE SERVICES OF AN ASBESTOS ABATEMENT CONTRACTOR TO EVALUATE THE SITUATION, PROVIDE THE NECESSARY SERVICES AND CERTIFY THE AREA SAFE BEFORE WORK MAY RESUME. ASBESTOS STATEMENT REF: AB2040, SB2572 AND GENERAL INDUSTRY SAFETY ORDER NUMBER 5208.*

*IF REMOVAL OF GUTTERS IS NECESSARY IN THE COURSE OF REPAIRS, ALL COUNTY TERMITE AND CONSTRUCTION, DOES NOT GUARANTEE THAT THESE WILL NOT LEAK WHEN REINSTALLED. WHEN STARTER BOARDS ARE REPAIRED OR REPLACED, ALL COUNTY TERMITE AND CONSTRUCTION, DOES NOT GUARANTEE THE WATERTIGHTNESS OF THE ROOF.*

**NOTE: THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS' STATE LICENSE BOARD.**

After fumigation, termites can swarm back into the attic through the vents and start the whole process over again. All County Termite & Const. Recommends a preventative treatment with Timbor. This is a complete Attic Treatment with a product that is 98% Boric acid, so people and pets can be safe at home during the treatment. See pricing below:

Homes under 2,000 sq ft \$400.00  
Homes more than 2000 sq ft \$700.00  
Multiple Attics-Price upon request

Protect your next biggest investment besides your family & pets.

Please let us know if you have any other questions and we will be happy to help.

NOTICE: THE STRUCTURAL PEST CONTROL BOARD ENCOURAGES COMPETITIVE BUSINESS PRACTICES AMONG REGISTERED COMPANIES. REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, ETC.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. THEREFORE, YOU MAY WISH TO SEEK A SECOND OPINION SINCE THERE MAY BE ALTERNATIVE METHODS OF CORRECTING THE FINDINGS LISTED ON THIS REPORT THAT MAY BE LESS COSTLY. OCCUPANTS FUMIGATION NOTICE ----REG. SECTION 1970.4 HAS BEEN AMENDED TO INCLUDE A STATEMENT TO THE OCCUPANT SUGGESTING THAT THEY NOTIFY THEIR NEIGHBORS OF THE DATE OF FUMIGATION, AND TO KEEP PETS AWAY DURING FUMIGATION AND TO CLOSE OFF ANY OPEN ACCESS TO SUB AREAS IN ORDER TO PREVENT PET ENTRY PRIOR TO FUMIGATION , EFF. MAY 1 2006 , PLEASE RELAY THIS INFORMATION TO ALL PARTIES INVOLVED IN THIS TRANSACTION / HOME.

#### SECTIONED REPORTING

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I OR SECTION II CONDITIONS EVIDENT ON THE DATE OF THIS INSPECTION. SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR SECTION II.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
33255	NANCY LANE	MENEFEE	92584	03/15/2024	4 of 6

## 2. DRYWOOD TERMITES

### ITEM NO. 2A

(Section 1)

FINDING AND  
RECOMMENDATION: 2A

FINDING: (SECTION 1)  
EVIDENCE OF DRYWOOD TERMITES AS INDICATED BY 2A ON THE DIAGRAM. EVIDENCE NOTED IN TRIM BOARDS.  
RECOMMENDATION :  
MASK PELLETS, DRILL AND TREAT LOCALLY WITH D-FOAM AND/OR TIMBOR, REGISTERED TERMITICIDES. FILL IN DAMAGED AREA AS NEEDED. NO GUARANTEES ON AREAS THAT ARE INACCESSIBLE OR NOT VISIBLE DURING THIS INSPECTION.

### ITEM NO. 2B

(Section 1)

FINDING AND  
RECOMMENDATION: 2B

FINDING: (SECTION 1)  
DRYWOOD TERMITE DAMAGE INDICATED BY 2B ON DIAGRAM. THE DAMAGE WAS NOTED IN TRIM BOARDS .  
RECOMMENDATION:  
REPAIR / REPLACE (TERMITE) DAMAGED WOOD MEMBERS AS NECESSARY;  
ALL WOOD REPLACEMENTS WILL BE COMPLETED IN TODAY'S AVAILABLE WIDTHS AND GRADES. ALL COUNTY TERMITE WILL PRIME COAT ONLY.

## 3. FUNGUS OR DRYROT

### ITEM NO. 3A

(Section 1)

FINDING AND  
RECOMMENDATION: 3A

FINDING: (SECTION 1)  
FUNGUS DAMAGE INDICATED BY 3A ON DIAGRAM. THE FUNGUS INFECTION WAS NOTED IN ROOF FASCIA BOARDS, TRIM, SIDING .  
RECOMMENDATION:REPAIR / REPLACE FUNGUS (DRY ROT) DAMAGED WOOD MEMBERS AS NECESSARY. IF FUNGUS (DRY ROT) INFECTION IS FOUND TO EXTEND INTO ENCLOSED AREAS, A SUPPLEMENTAL REPORT WILL BE ISSUED WITH A COST ESTIMATE FOR THOSE REPAIRS. ALL COUNTY TERMITE WILL PRIME COAT ONLY.

## 4. OTHER FINDINGS

### ITEM NO. 4A

(Section 2)

FINDING AND  
RECOMMENDATION: 4A

FINDING: (SECTION 2)  
CELLULOSE DEBRIS NOTED AS 4A ON THE DIAGRAM. THE CELLULOSE DEBRIS WAS LOCATED SUB AREA . THIS CELLULOSE DEBRIS MIGHT ATTRACT TERMITES.  
RECOMMENDATION:  
REMOVE CELLULOSE DEBRIS OF RAKE SIZE OR LARGER. \_.  
(FIREWOOD SHOULD BE STACKED 2-3' FROM HOUSE)

### ITEM NO. 4B

(Section 2)

FINDING AND  
RECOMMENDATION: 4B

FINDING: (SECTION 2)  
EARTH TO WOOD CONTACT/ CORRODED METAL FLASHING AS INDICATED BY 4B ON THE DIAGRAM. THE CONTACT WAS IN THE GARAGE WALL AREA  
RECOMMENDATION: CONTACT LANDSCAPING CONTRACTOR/ TERMITE TO LOWER SOIL.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
33255	NANCY LANE	MENEFEE	92584	03/15/2024	5 of 6

## 5. FURTHER INSPECTION

### ITEM NO. 5A

(Further Inspection)

#### FINDING AND

RECOMMENDATION: 5A

FINDING: (INFORMATION ONLY)

AN INACCESSIBLE AREA EXISTS AS INDICATED BY 5A ON THE DIAGRAM.

THE AREA ALL COUNTY TERMITE AND CONSTRUCTION WAS NOT ABLE TO

INSPECT WAS ATTICS IN HOUSE AND GARAGE HAVE NO ACCESS, AND MANY STORED ITEMS IN THE GARAGE . PLEASE LET US KNOW WHEN THE ITEMS HAVE BEEN REMOVED AND WE CAN COMPLETE THE INSPECTION.

RECOMMENDATION:

NO OPINION IS RENDERED CONCERNING THE CONDITION OF THE AREA

THAT WAS NOT VISIBLE OR ACCESSIBLE AT THE TIME OF THE INSPECTION. ALL COUNTY TERMITE AND CONSTRUCTION ASSUMES

NO

LIABILITY FOR THESE AREAS.

## COMMENTS AND OTHER INFORMATION

*CALIFORNIA STATE LAW REQUIRES THAT YOU BE GIVEN THE FOLLOWING INFORMATION: CATION PESTICIDES ARE TOXIC CHEMICALS". Structural pest control operators are licensed and regulated by the structural pest control board, and apply pesticides which are registered and approved for use by the california department of food and agriculture and the united states environmental protection agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.*

*IF WITHIN TWENTY-FOUR HOURS FOLLOWING APPLICATION YOU EXPERIENCE SYMPTOMS SIMILAR TO COMMON SEASONAL ILLNESS COMPARABLE TO THE FLU, CONTACT YOUR PHYSICIAN OR POISON CONTROL CENTER AT: 1-800-876-4766 AND YOUR PEST CONTROL OPERATOR IMMEDIATELY AT: 1-619-248-3426. FOR ADDITIONAL INFORMATION CONTACT THE SAN DIEGO COUNTY HEALTH DEPARTMENT AT: 619-692-8499; SAN DIEGO COUNTY AGRICULTURAL DEPARTMENT AT:858-694-8980 AND THE STRUCTURAL PEST CONTROL BOARD, 2005 EVERGREEN STREET., SACRAMENTO, CA. 95825-3280. 1-800-737-2005*

*IF WE HAVE RECOMMENDED THE USE OF A FUNGICIDE WE WILL USE OR:*

\*  
\* US BORAX TIMBOR - (A/I) DISODIUM OCTABORATE TETRAHYDRATE 98%

*IF WE HAVE RECOMMENDED THE TREATMENT OF SUBTERRANEAN TERMITES WE WILL USE:*

\* TERMIDOR SC TERMITICIDE/INSECTICIDE-(FIPRONIL) 9.1%

*IF WE HAVE RECOMMENDED THE TREATMENT OF WOOD BORING BEETLES WE WILL USE:*

\* CY-KICK CS (CYFLUTHRIN) 0.1%

*IF WE HAVE RECOMMENDED A LOCAL TREATMENT OF DRYWOOD TERMITES, WE WILL USE EITHER:*

\* TERMIDOR SC TERMITICIDE ,INSECTICIDE-(FIPRONIL) 9.1%  
\* US BORAX TIMBOR - (A/I) DISODIUM OCTABORATE TETRAHYDRATE 98%  
\* POWER PLANT - TERPENE HYDROCARBON, N.O.S., D-LIMONENE >90%,  
\* TAURUS SC - FIPRONIL 9.1%  
\* PREMISE FOAM - IMIDACLOPRID 6-CHLOR-3-PYRIDINY-METHYL-N-NITRO-2-IMIDAZOLIDINIMINE-5%

*FOR FURTHER INFORMATION CONTACT ANY OF THE FOLLOWING:*

*SAN DIEGO COUNTY HEALTH DEPARTMENT:(619)-692-8499*

*\*DEPARTMENT OF AGRICULTURE:858-694-8980*

*\*POISON CONTROL CENTER: 1-800-876-4766*

#### FUMIGATION NOTES:

*We schedule the gas shut off only! Up to owner or new buyer , or their agents, to call SDGE at 1-800-411-7343 for gas restoration after the fumigation, call in advance to book the appointment.*

*Please tell termite inspector if you have more than one structure that shares any gas or electrical lines/ pipes/conduits. When in doubt, contact SDGE.*

*California law states that some or all windows be LEFT open 3-6 inches- PLEASE, we recommend you install window locks for all windows. We need electricity and water left on during the fumigation process, all alarms off, and sprinklers that are close to house walls- turned off, and any light activated intruder lights.*

*if you or your neighbors have cats, please make sure they are not allowed near the fumigation tarps while the house is being covered.*


*Take your valuables with you before the fumigation process*

*If you have propane, please call your propane company and tell them your house is getting fumigated, ask them for directions on what to do .*

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
33255	NANCY LANE	MENEFEE	92584	03/15/2024	6 of 6

**ALL COUNTY TERMITE & CONST.**

9821 Hawley Rd  
El Cajon, CA 92021  
619-561-1645

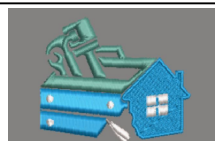

# INVOICE

**Invoice Number:**

20201239

**Invoice Date:**

03/15/2024

Bill To:

SHARON WITTMAYER

Address of Property Inspected:

33255 NANCY LANE  
MENEFEE, CA 92584

Invoice Description:

Date of Inspection: 03/15/2024

Termite Inspection Report Fee: \$ 75.00 (Termite work not included.)

Payments: \$ 0.00 Date: N/A

**TOTAL DUE: \$ 75.00**

PAYMENT DUE UPON RECEIPT OF INVOICE. (PLEASE GIVE CHECK TO THE TECHNICIAN UPON COMPLETION OF WORK).

IF PROPERTY IS IN ESCROW, PAYMENT DUE UPON CLOSING ESCROW OR THIRTY DAYS FROM COMPLETION OF WORK IF ESCROW HAS NOT CLOSED WITHIN THIRTY DAYS. INVOICES OVER 30 DAYS WILL BE ACCESSED A 10% LATE CHARGE, AND 18% FINANCE CHARGE FROM DATE OF COMPLETION.

### NOTICE TO OWNER

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.



# Work Authorization

Prepared by

**ALL COUNTY TERMITE & CONST.**


ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
33255	NANCY LANE	MENEFEE	92584	37	03/15/2024

Ordered by: SHARON WITTMAYER	Property Owner and/or Party of Interest	Report sent to:
---------------------------------	---	-----------------

An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

**NOTE: If diagram is not displayed here, please see the report.**

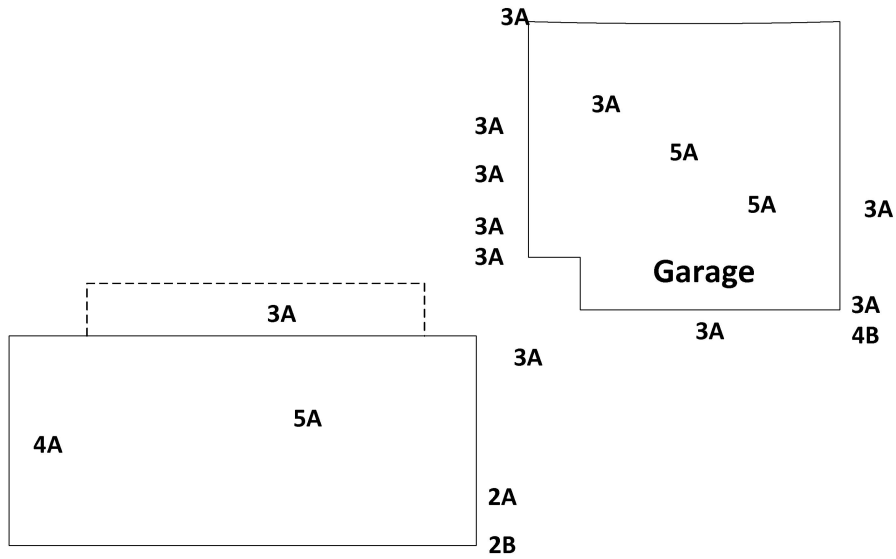





# Work Authorization

Prepared by

Report # : 20201239

## ALL COUNTY TERMITE & CONST.

### ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
33255	NANCY LANE	MENEFEE	92584	37	03/15/2024

### Section 1

2A	=	475.00	P
2B	=	200.00	P
3A	=	2605.00	P

### Section 1 Totals

<b>Total using primary recs</b>	<b>\$</b>	<b>3280.00</b>
---------------------------------	-----------	----------------

<b>Cost of all Primary Recommendations \$</b>	<b>3280.00</b>
---	----------------

**NOTE: Damage found in Inaccessible Areas may require a Supplemental report and/or Work Authorization, or may require amendments to this Work Authorization.**

### NOTICE TO OWNER

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.



# Work Authorization

Prepared by

Report # 20201239

## ALL COUNTY TERMITE & CONST.

### ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
33255	NANCY LANE	MENEFEE	92584	37	03/15/2024

Cost of all Primary Recommendations \$ 3280.00

**NOTE: Damage found in Inaccessible Areas may require a Supplemental report and/or Work Authorization, or may require amendments to this Work Authorization.**

1. If further inspection is recommended, if additional work is required by any government agency, or if additional damage is discovered while performing the repairs, this company reserves the right to increase prices. Any permit fees shall be paid by customer.
2. In the event that legal action is necessary to enforce the terms of this contract, reasonable attorney's fees may be awarded to the prevailing party.
3. This company will use due caution and diligence in their operations, but assume no responsibility for matching existing colors and styles, or for incidental damage to roof coverings, T.V. antennae, solar panels, rain gutters, plant life, or paint.
4. This report is limited to the accessible areas shown on the diagram. Please refer to the report for the areas not inspected.
5. If this contract is to be paid out of escrow impound, the buyers and sellers agree to provide this company with all escrow billing information required to collect the amount due. The persons signing this contract are responsible for payment, and if the escrow does not close within 30 days after the date of completion of the work, agree to pay in full the amount specified in this work authorization agreement. Balances over 30 days will be assessed a 10% late fee, and 18% finance charge from date of completion.
6. If this agreement includes a charge for opening an area for further inspection, it is for opening the area only and does not include making additional repairs, if needed, nor does it include replacing removed or damaged floor coverings, wall coverings, or painted exposed surfaces unless specifically stated.
7. ALL COUNTY TERMITE AND CONSTRUCTION will prime all bare wood that we replace in the course of our repairs. No painting of repaired or replaced wood is included unless specifically stated in the findings and recommendation section. However, if owner supplied paint is on premise at beginning of work, Termite will use owner's paint and apply one coat in place of primer. Termite will not be responsible for mismatched colors or quality of owner supplied paint.
8. Any work done with a charge of under \$150.00 is due at the time work is completed. This is not to be charged to escrow.
9. ALL COUNTY TERMITE AND CONSTRUCTION will neither remedy, replace nor pay for any unsatisfactory or insufficient work or materials provided by owner or any third party source. Guarantee applies only to services and goods provided by ALL COUNTY TERMITE AND CONSTRUCTION and not for effects on, or from any other person, source or thing. Any certification of work done by third parties shall be provided only after reinspection by ALL COUNTY TERMITE AND CONSTRUCTION, and written guarantee by providers. Said providers shall fully indemnify ALL COUNTY TERMITE AND CONSTRUCTION from any and all actions, suits, proceedings, liability, claims, demands for damages or injuries to any person or property and all claims which arise from or are directly connected to work completed by them or others. This also applies to work done pursuant to a secondary recommendation(s).

Cost of work authorized: \$

OWNER or OWNER's AGENT:	DATE:
X _____	_____
X _____	_____

ALL COUNTY TERMITE & CONST.
BY: _____
ESCROW CO: _____
ESCROW NO: _____