

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
45330	CIELITO DR	INDIAN WELLS	92210-8598	09/16/2022	1 of 7

<b>RUDY'S TERMITE AND PEST CONTROL</b> <b>43-639 Jackson St</b> <b>Indio, CA 92201</b> Tel 760-775-7216 Fax 760-775-7206 Registration #: PR2950	A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.  <b>Report #: 23055</b>
---	--

Ordered by: BERKSHIRE HATHAWAY MARIA MOLINA MARIAMOLINAREALTOR@GMAIL.COM 760-610-3428	Property Owner and/or Party of Interest: TERRY SCOTT 45330 CIELITO DR INDIAN WELLS, CA 92210-8598	Report sent to:
---	--	-----------------

COMPLETE REPORT <input checked="" type="checkbox"/>	LIMITED REPORT <input type="checkbox"/>	SUPPLEMENTAL REPORT <input type="checkbox"/>	REINSPECTION REPORT <input type="checkbox"/>
---	---	--	--

General Description: SINGLE STORY WOOD FRAMED OCCUPIED FURNISHED RESIDENCE ON SLAB FOUNDATION WITH ATTACHED GARAGE AND TILE ROOF	Inspection Tag Posted: Garage
	Other Tags Posted: None


  

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites <input type="checkbox"/>	Drywood Termites <input type="checkbox"/>	Fungus/Dryrot <input checked="" type="checkbox"/>	Other Findings <input checked="" type="checkbox"/>	Further Inspection <input type="checkbox"/>
--	---	---	--	---

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

Key: 1 = Subterranean Termites    2 = Drywood Termites    3 = Fungus/Dryrot    4 = Other Findings    5 = Unknown Further Inspection

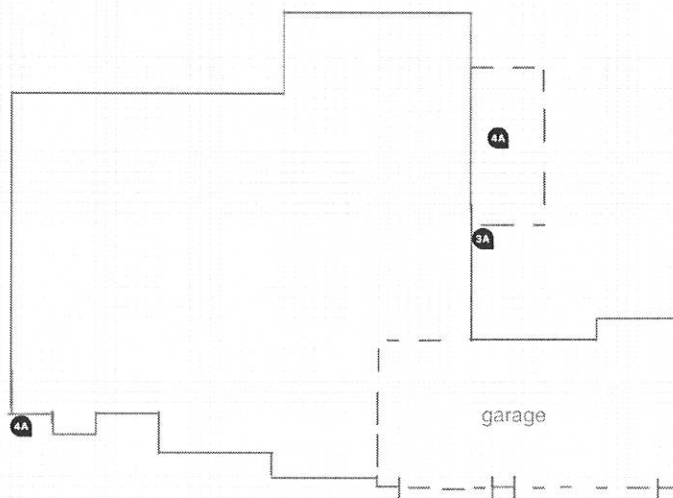

Inspected By: CHAN HOUSLEY State License No.: FR56475 Signature: *Charina Housley*

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services

performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov).

43M-41 (REV. 04/2015)

## General Comments

### WHAT IS A WOOD DESTROYING PEST AND ORGANISM INSPECTION REPORT?

READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF THE STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST AND ORGANISM INSPECTION REPORT.

A Wood Destroying Pest and Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood

Destroying Pest and Organism Inspection Reports are governed by the California Structural Pest Control Act rules and regulations, the Structural Pest Control Board and California Department of Consumer Affairs.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest and Organism Inspection Report do not contain information on such defects, if any, as they are not within the scope of the licenses of either this company or its employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at time of inspection. Some areas of the structure are not accessible for inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Some areas are not accessible for inspection due to locked doors, storage or heavy vegetation. Infestations, infections and/or damage may be active or present in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture, appliances or stored articles are not moved and windows are not opened during a routine visual inspection.

The exterior surface of the roof was not inspected. If you want the water tightness and integrity of the roof determined, you should engage the services of a roof contractor who is licensed by the California Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such areas after the date of inspection. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not our original bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. An original report must be used for escrow purposes within ninety (90) days of the date of the original inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior paint are excluded from our contract. New wood exposed to the elements will be prime painted and is normally an additional charge.

This company will re-inspect repairs done by others within four (4) months of the original inspection for a fee of \$65.00. The re-inspection must be done within ten (10) working days of request. The re-inspection is a visual inspection and if inspection of concealed area is desired, inspection of work in progress will be necessary. Any guarantee must be received from parties performing repairs.

**NOTICE:** This Wood Destroying Pest & Organism Inspection Report DOES NOT INCLUDE MOLD or any mold like/microbial growth conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact an appropriate mold professional.

NOTE: FURTHER INSPECTION: FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREAS WHICH DURING THE ORIGINAL INSPECTION, DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.

NOTE: SECTION 1 & 2: A SEPARATED REPORT IS DEFINED AS SECTION 1 (CORRECTIVE) AND SECTION 2 (PREVENTATIVE) CONDITIONS EVIDENT ON THE DATE AND TIME OF INSPECTION.

SECTION 1: CONTAINS ITEMS WHERE THERE IS EVIDENCE OF A WOOD DESTROYING ORGANISM INFECTION, INFESTATION AND/OR CONDITIONS THAT HAVE RESULTED FROM INFECTION AND/OR INFESTATION.

SECTION 2: CONTAINS ITEMS OF CONDITIONS THAT ARE DEEMED LIKELY TO LEAD TO FUTURE INFECTION AND/OR INFESTATION BUT WHERE NO VISIBLE EVIDENCE OF A WOOD DESTROYING ORGANISM IN THE VISIBLE AND ACCESSIBLE AREAS WAS FOUND.

## FUNGUS/DRYROT

### Description of Findings

Finding: 3A

FINDING 3A: DRY ROT DAMAGE NOTED TO 2x4 BASE FRAME ATTACHED TO COVERED PATIO ON RIGHT SIDE OF HOUSE AS INDICATED BY 3A ON DIAGRAM. (SECTION II)

Recommendation:

RECOM:3A: REMOVE AND REPLACE AS INDICATED BY 3A ON DIAGRAM. CONTACT A LICENSED GENERAL CONTRACTOR AND/OR QUALIFIED TRADESPERSON FOR FURTHER EVALUATION AND CORRECTIVE REPAIR(S). PAINT EXPOSED WOOD WITH BLENDING COLOR.

Price: \$0.00

## OTHER FINDINGS

Finding: 4A

FINDING:4A: EARTH TO WOOD CONTACT NOTED TO PLANTERBOX RIGHT SIDE OF HOUSE AND WOOD FRAME OF POND PUMP FRONT LEFT SIDE OF HOUSE AS INDICATED BY 4A ON DIAGRAM. THIS CONDITION IS CONDUCTIVE TO CAUSING WOOD DESTROYING ORGANISM PROBLEMS.

Recommendation:

RECOM:4A: REMOVE SOIL FROM PLANTER BOX TO A LEVEL BELOW THE TOP OF THE FOUNDATION. CLEAN WALL AND ALLOW TO DRY. INSTALL AN APPROPRIATE MOISTURE BARRIER (THOROUGH SEAL) AND ALLOW TO DRY AND REPLACE SOIL. REMOVE WOOD FRAME OF PUMP BOX TO ELIMINATE EARTH TO WOOD CONTACT

Price: \$0.00

---

## Disclaimer

No evidence of termite infestation or damage was noted in visible and accessible areas at time of this inspection.

This termite inspection pertains to accessible and visible areas only. This is not a structural damage report, a wood destroying organism inspector is not ordinarily a construction or building trades expert and therefore is not expected to possess any special qualifications which would enable him/her to detect the extent of structural damages. If damages or other evidence of wood destroying organisms is noted on this report, further investigation by a qualified expert of the building trade should be made to determine soundness of this property. This is not to be construed to constitute a guarantee of the absence of wood destroying organism.

**NOTICE TO OWNERS:** Under the California Mechanics Lien Law any structural pest control operator who contracts to do work for you, any contractor, subcontractor, laborer supplier or other person who helps to improve your property, but is not paid for his work or supplies has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the ineptness. This can happen even if you have paid your contractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property if they are not paid.

**TO INSURE EXTRA PROTECTION FOR YOURSELF AND YOUR PROPERTY YOU MAY WISH TO TAKE ONE OR MORE OF THE FOLLOWING STEPS:**

1. Require that your contractor supply you with a payment and performance bond (not a license bond), which provides a guarantee that all work and proper payments will be completed. This payment and performances bond as well as a copy of the construction contract may be filed with the county recorder for your further protection.
2. Before making payments on any completed phase of the project, require your contractors to provide you with unconditional release signed by each material supplier, subcontractors and laborer involved on that project phase. Anyone signing this release loses the right to file a claim against your property. To protect yourself under this option you must be certain that all material suppliers, subcontractors and laborers have signed.

### **ADDITIONAL NOTES OR REMARKS GUARANTEE:**

This estimate DOES NOT INCLUDE PAINT, wallpapering or carpet laying or floor covering(including Epoxy). This firm will not be responsible for possible damage to hidden pipes, conduits or ducts in the course of our work. This firm will not be responsible for possible damage to floor covering in the course of our work. If infestation(s) or infection(s) pertaining to damage caused by either extends into inaccessible areas a cost estimate will be provided with a supplemental report. A visual inspection was performed and the inspector did not deface nor probe into finished window or door frames, trim work, floor coverings, walls, ceilings or other finished surfaces.

The exterior areas of this structure were visually inspected from the ground level only. If any infestation, infection or damage is discovered in a concealed area during the course of performing any recommendation in this report, this company will file a supplemental report. This company is not responsible for controlling such infestations or infections or for repairing such damage.

This company makes no guarantee or warranty, express or implied, regarding future infections or adverse conditions or conditions present but not evident at the time of inspection.

The pest control industry recognizes a structure to have certain areas both accessible and not inspected. These areas include but are not limited to inaccessible and/or insulated attics or portions thereof. Attics with less than 18" clear crawl space, the interior of hollow walls; spaces between a floor or porch deck and the ceiling below; areas where there is no access without defacing or tearing lumber, masonry, or finished work; areas or below appliances or beneath floor coverings, furnishings; areas where behind encumbrances, storage, conditions, or locks make inspection impractical; and areas or timbers around eaves that would require use of an extension ladder. Please note that when termite infestation is noted, some form of hidden structural damage may exist.

This company shall recommend further inspection if there is any question about noted areas. If a re-inspection is either

required or requested it must be completed within four months from the date of the original inspection. The cost of a re-inspection shall not exceed the cost of the original report. Any reconstruction to the structure, at areas that were inaccessible during the original inspection shall be re-inspected by this company prior to any closing of area(s). RE: Structural Pest Control Act Article 6 Section 8516[B], Paragraph 1990 (J). Amended March 1, 1974.

With slab construction, floor covering may conceal cracks in the slab that will allow infestations to enter. Infestations may be concealed by plaster, sheetrock or other wall coverings so that a diligent inspection may not uncover the true condition. The roof was not inspected due to lack of accessibility, qualification and licensing. These areas are not practical to inspect because of health hazards, damage, obstruction or inconvenience and unless specified or described in this wood destroying pest and organism's inspection report. This company shall exercise due care during inspections and treatments but assumes no liability for any damage to tiles, slates, shingles or other roofing materials, including patio covers, aluminum awnings, solar heating, plants, shrubbery or paint during any type of treatment.

The purpose of this report is to document findings and recommendations which pertain to the absence or presence of wood destroying organisms and/or conducive condition(s) at the time of inspection. This report should be read carefully and is not to be confused with a Home Maintenance Survey. The client's cooperation and compliance to correct and/or complete the recommendations documented in this report are obligatory. Without a mutual effort this company cannot assure effective results.

The owner of this structure has certain obligations regarding maintenance and pertaining to the deterrence of wood destroying organisms. It is the responsibility of the owner or agent to inform our inspector regarding any knowledge of past or present termite infestation. Maintenance procedures include; but are not limited to reasonable cleaning, upkeep of roofs, gutters and downspouts; painting and sealing of exposed surfaces; caulking about doors and windows or grouting about commodes, tub and shower enclosures; storing materials, one foot away from the structures foundation; (providing adequate ventilation, maintaining proper drainage away from structure (including sprinkler systems); keeping soil levels below the top of foundations and prohibiting earth contact with wood components of the structure(s).

NOTE: This inspection does not include inspection of electrical, plumbing, heating and other mechanical systems of the structure. This inspection will not detect building code violations. We recommend the owner/agent engage the services of a reputable "Home Inspection" company. Some structures, on certain properties, may not comply with building code requirements or may have structural, plumbing, electrical, heating, air conditioning or other defects that do not pertain to wood destroying organisms and are outside the scope of this report, and outside the scope of our expertise.



NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, etc.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE A RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY. NOTICE: THE CHARGE FOR SERVICE THAT THIS COMPANY SUBCONTRACTS TO ANOTHER REGISTERED COMPANY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH PAYING THE SUBCONTRACTOR. YOU MAY ACCEPT RUDY'S TERMITE AND PEST CONTROL'S BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, RUDY'S TERMITE AND PEST CONTROL WILL NOT BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM.

Pesticides are the products RUDY'S TERMITE AND PEST CONTROL uses to control the target pests listed in your agreement. Pesticides make a better life for all by helping control disease carriers and wood destroying insects, thus protecting our health and property. When properly used, pesticides pose no problems to humans or the environment. Your Technician is a State certified applicator whose knowledge is constantly being upgraded through regularly scheduled training sessions. If you have any questions, please call us at: 760-775-7216 or write to: RUDY'S TERMITE AND PEST CONTROL, 43-639 Jackson St, Indio, CA 92201.

State Law Requires That We Provide You With The Following Information:  
PESTICIDE NOTICE (SECTION 8538)

State law requires that you be given the following information: CAUTION—PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. PESTICIDES: 20 Mule Team Tim-Bor Industrial(Disodium Octaborate Tetrahydrate), Advance Dual Choice(Sulfuramid), Advance Ant Bait(Abamectin), Agri-Fos(Mono-and di-potassium salts of Phosphorous Acid), Alette(Aluminum tris(O-ethylphosphonate), Archer(Pyriproxifen), Astro(Permethrin), Avert Roach Bait(Abamectin), Avitrol(4-Aminopyridine), Award Fire Ant Bait(Abamectin), Azatrol(Azadirachtin), Banner Maxx(Propiconazole), Barricade(Prodiamine), Bora-Care(Boron sodium oxide, tetrahydrate), Borid(Orthoboric Acid), 1-2-3 Cardinal(Pyrethrin & Piperonyl Butoxide), 3-6-10 Cardinal(Pyrethrin & Piperonyl Butoxide), 25-5 Cardinal(Pyrethrin & Piperonyl Butoxide), Citation(Cyromazine), Compass(Trifloxystrobin), Conquer(Esfenvalerate), Contrac Rodenticide(Bromadiolone), Cool Power(MCPA, Triclopyr, Dicamba), CyKick(Cyfluthrin), Deadline T&O(Metaldehyde), Deltaguard G(Deltamethrin), Demand(Lambda-cyhalothrin), Demize EC(Linalool), Demon(Cypermethrin), D-Force HPX-15(Deltamethrin), Dimension (Dithiopyr), Ditrac Rodenticide(Diphacinone), Diuron(Diuron), Dr Moss Liquid Ant Bait(Orthoboric Acid), Dragnet(Permethrin), Drax(Orthoboric Acid), Drione(Pyrethrins), Eco Exempt G(Eugenol Oil & Thyme Oil), Eco Exempt IC(Rosemary Oil), Ecofume(Phosphine), Eco Pco D(Eugenol Oil), Endeavor(Pymetrozine), Endure(Cyano), Envoy(Clethodim), FirstLine(Sulfuramid), Florel(Ethepon), Flourgard Ant Bait Stations(Sulfuramid), Flytek(Methomyl), Fumitoxin(Aluminum Phosphide), Fusilade II(Fluazifop-P-butyl), Gallery(Isoxaben), Garlon (Triclopyr), Generation Rodenticide(Difethialone), Gentrol(Hydroprene), Greyhound(Abamectin B1), Heritage(Azoxystrobin), Impelrods(Anhydrous Disodium Octaborate), Intruder HPX-20(Cufluthrin, Pyrethrins, Piperonyl Butoxide, Technical), Jecta(Disodium Octaborate Tetrahydrate), Kicker EC(Pyrethrin & Piperonyl Butoxide), Krovar(Bromacil, Diuron), Labyrinth(Diflubenzuron), Ligua-Tox II(Sodium Salt of Diphacinone), Maki Rodenticide(Bromadiolone), Manage(Halosulfuron-methyl), Maxforce(Fipronil,Hydramethylnon), Maxforce Granular Fly Bait(Imidacloprid), MCPP-4 Amine(Dimethylamine salt of 2 MCPP), Mecomec(Potassium salt of 2-MCPP), Medallion(Fluidioxnil), Merit(Imidacloprid), Microcare(Pyrethrins), Mop Up(Disodium Octaborate Tetrahydrate), Musca Cide Fly Baits(Methomyl), Niban Bait(Orthoboric Acid), OUST XP(Sulflometuron methyl), Outpost TBR(Diflubenzuron), PCQ Pellet Bait(Diphacinone), Pendulum (Pendimethalin), Pentra-Bark(Polyalkylene Modified Heptamethyltrisiloxane and nonionic surfactants), PermaDust(Boric Acid), Permethrin Pro(Permethrin), Phostoxin(Aluminum Phosphide), Pointer(Imidacloprid), Precore 1%(Methoprene), Precore 2000(Methoprene & Permethrin), Prelude(Permethrin), Premise(Imidacloprid), Premise Foam(Imidacloprid), Prevail FT (Cypermethrin), Prozap Fly Killer D(Dibrom), Prozap Insectrin X(Permethrin), PT Clear Zone Metered(Pyrethrin & Piperonyl Butoxide), Purge III(Pyrethrin & Piperonyl Butoxide), Pyrenone Crop Spray(Pyrethrin & Piperonyl Butoxide), Quell(R-metalaxy/mefenoxam), Quicksilver(Carfentrazone), Quick Strike(Nitiazine), Quintox Pellets(Cholecalciferol), Quintox Seeds(Cholecalciferol), Recruit(Hexaflumaron), Recruit III(Noviflumuron), Recruit IV(Noviflumuron), Rodeo(Glyphosate), Roundup Pro(Glyphosate), Saga WP(Tralomethrin), Shepard(Propiconazole), Siege(Hydramethylnon), Simazine 4L(Simazine), Sluggo(Iron Phosphate), Snapshot(Trifluralin+Isoxaben), Speed Zone(Carfentrazone, 2,4-D,2Ethylhexylester, Mecoprop-p acid, Dicamba acid) Subdue Maxx(methoxyacetylaminopropionic & methylester), Subterfuge(Hydramethylnon), Surflan(Oryzalin), Suspend(Deltamethrin), Talstar(Bifenthrin), Tempo(Cyfluthrin), Termidor(Fipronil), Terro Ant Bait(Sodium Tetraborate, Decahydrate), Tim-Bor (Disodium Octaborate Tetrahydrate), Transline(Clopyralid), Turflon Ester(Triclopyr), ULD BP(Pyrethrin & Piperonyl Butoxide), Victor Poison Free Ant & Roach(Mint Oil), Victor Poison Free Vikane(Sulfuryl fluoride), Poison Free Wasp(Mint Oil), Weed Whacker(2-4, D + MCPP + 2-4, DP), Weed-Hoe(Monosodium Acid Methanearsonate), Whitmire Wasp Freeze(Allethrins), Wilco Gopher Bait(Chlorophacinone-Liphadione), Wilco Ground Squirrel Bait(Diphacinone), Yardex(Tau-Fluvalinate), ZP Tracking Powder(Zinc Phosphide). RUDY'S TERMITE AND PEST CONTROL will not apply any compound not authorized for use in California.

If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately.

For further information, contact any of the following: Your Pest Control Company (760-775-7216); for Health Questions—the County Health Department (see list below); for Application Information—the County Agricultural Commissioner (see list below), and for Regulatory Information—the Structural Pest Control Board (916-561-8708; 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815).

County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.
IMPERIAL:	(442) 265-1444	(442) 265-1500	RIVERSIDE:	(951) 358-5000	(951) 955-3011	SAN DIEGO:	(619) 515-6770	(858) 694-2739
LOS ANGELES:	(818) 947-3070	(626) 575-5471	SAN BERNARDINO:	(909) 383-4777	(909) 387-2105			

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. It's purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

RUDY'S TERMITE AND PEST CONTROL, License Number PR2950