

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

#: 73710

BUILDING NO. 3771-75	STREET TEXAS ST	CITY SAN DIEGO	ZIP 92104	Date of Inspection 10/15/2024	NUMBER OF PAGES 1 of 8
-------------------------	--------------------	-------------------	--------------	----------------------------------	---------------------------

**Top Notch Termite Company, Inc.**  
 6041 Fairmont Ave  
 San Diego, CA 92120  
 (619)282-8771, (619)282-8741 fax  
 PR 3632

Ordered by: LISA WHELIHAN THE METROPOLITAN GROUP  PH.# 619-709-9045	Property Owner and/or Party of Interest	Report sent to:
---	---	-----------------

COMPLETE REPORT 
 LIMITED REPORT 
 SUPPLEMENTAL REPORT 
 REINSPECTION REPORT

**GENERAL DESCRIPTION:**

This is a one story, wood sided, single family residence and a two story duplex. It has an attached patio. It has a composition roof and was occupied and furnished at the time of inspection.

Inspection Tag Posted:  
**Attic.**


Other Tags Posted:

An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites 
 Drywood Termites 
 Fungus/Dryrot 
 Other Findings 
 Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items

Key: 1 = Subterranean Termites 2 = Drywood Termites 3 = Fungus/Dryrot 4 = Other Findings 5 = Further Inspection

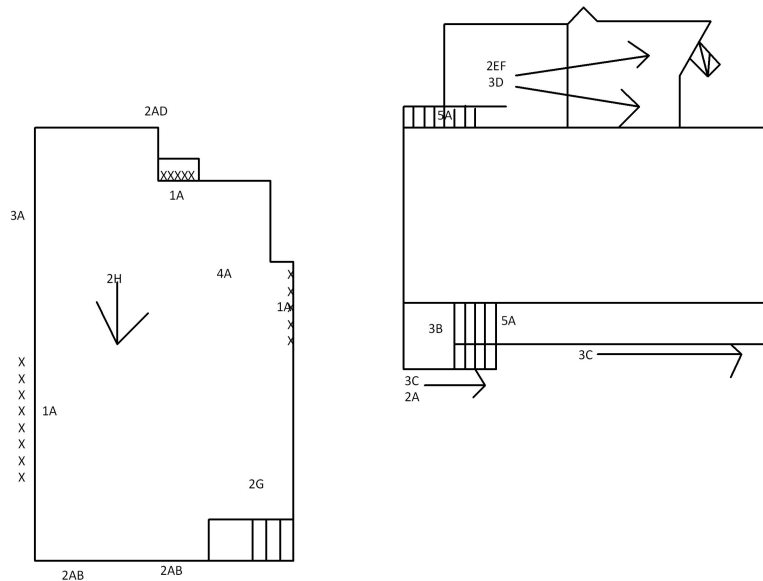

Inspected By TREVOR J KEIFER License No. FR 48983 Signature *T. J. Keifer*

You are entitled to obtain copies of all reports and completion notices on this property report to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov). (form t1a - 3/15/08) 43M-41 (Rev. 10/01)

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	2 of 8

## NOTES, CAUTIONS AND DISCLAIMERS

### NOTE:

**THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS STATE LICENSE BOARD.**

**NOTICE: THE STRUCTURAL PEST CONTROL BOARD ENCOURAGES COMPETITIVE BUSINESS PRACTICES AMONG REGISTERED COMPANIES. REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (ie. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, ETC.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. THEREFORE, YOU MAY WISH TO SEEK A SECOND OPINION SINCE THERE MAY BE ALTERNATIVE METHODS OF CORRECTING THE FINDINGS LISTED ON THIS REPORT THAT MAY BE LESS COSTLY.**

### NOTE:

**ALL PRICES INCLUDE THE LEAD SAFE PAINT RENOVATION PROCEDURE FEES AS REQUIRED BY FEDERAL E.P.A, WHERE APPLICABLE.**

### NOTE:

WALL PAPER, STAIN, OR INTERIOR PAINTING ARE EXCLUDED FROM OUR CONTRACT. NEW WOOD EXPOSED TO THE WEATHER WILL BE ONE COAT PRIME PAINTED ONLY, ONLY UPON REQUEST AND AT AN ADDITIONAL EXPENSE UNLESS OTHERWISE NOTED ON THE WORK AUTHORIZATION PAGE OF THIS REPORT. NOTE: ALL TERMITE REPORTS ARE VALID FOR 120 DAYS FROM DATE OF INSPECTION.

*THE PEST CONTROL INDUSTRY RECOGNIZES A STRUCTURE TO HAVE CERTAIN AREAS BOTH INACCESSIBLE AND NOT INSPECTED. THESE AREAS INCLUDE BUT ARE NOT LIMITED TO: INACCESSIBLE AND/OR INSULATED ATTICS OR PORTIONS THEREOF, ATTICS WITH LESS THAN 18" CLEAR CRAWL SPACE, THE INTERIOR OF HOLLOW WALLS; SPACES BETWEEN A FLOOR OR PORCH DECK AND THE CEILING BELOW; AREAS WHERE THERE IS NO ACCESS WITHOUT DEFACING OR TEARING LUMBER, MASONRY, OR FINISHED WORK; AREAS OR BELOW APPLIANCES OR BENEATH FLOOR COVERINGS OR FURNISHINGS; AREAS WHERE BEHIND ENCUMBRANCES, STORAGE, CONDITIONS, OR LOCKS MAKE INSPECTION IMPRACTICAL; AND AREAS OR TIMBERS AROUND EAVES THAT WOULD REQUIRE USE OF AN EXTENSION LADDER (ABOVE APPROXIMATELY 12 FT WHICH IS COMMON HEIGHT FOR 2ND STORY EAVES). INSPECTORS DO NOT CLIMB ON ROOFS (AS PART OF A NORMAL INSPECTION).*

*SLAB FLOOR CONSTRUCTION HAS BECOME MORE PREVALENT IN RECENT YEARS. FLOOR COVERING MAY CONCEAL CRACKS IN THE SLAB THAT WILL ALLOW INFESTATIONS TO ENTER. INFESTATIONS MAY BE CONCEALED BY PLASTER, SHEETROCK OR OTHER WALL COVERINGS SO THAT A DILIGENT INSPECTION MAY NOT UNCOVER THE TRUE CONDITION. THE ROOF WAS NOT INSPECTED DUE TO LACK OF ACCESSIBILITY, QUALIFICATION AND LICENSING. THESE AREAS ARE NOT PRACTICAL TO INSPECT BECAUSE OF HEALTH HAZARDS, DAMAGE, OBSTRUCTION OR INCONVENIENCE AND UNLESS SPECIFIED OR DESCRIBED IN THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT. THIS COMPANY SHALL EXERCISE DUE CARE DURING INSPECTIONS AND TREATMENTS BUT ASSUMES NO LIABILITY FOR ANY DAMAGE TO TILES, SLATES, SHINGLES OR OTHER ROOFING MATERIALS, INCLUDING PATIO COVERS, ALUMINUM AWNINGS, SOLAR HEATING, PLANTS, SHRUBBERY OR PAINT DURING ANY TYPE OF TREATMENT UNLESS OTHERWISE NOTED IN BODY OF REPORT.*

*THIS COMPANY SHALL RECOMMEND FURTHER INSPECTION IF THERE IS ANY QUESTION ABOUT NOTED AREAS. THIS COMPANY WILL NOT REINSPECT UNLESS A BUILDING PERMIT [WHERE APPLICABLE] IS POSTED AND SIGNED VIA : LOCAL BUILDING CODE INSPECTOR. "THIS COMPANY WILL REINSPECT REPAIRS DONE BY OTHERS WITHIN FOUR MONTHS OF THE ORIGINAL INSPECTION. A CHARGE, IF ANY, CAN BE NO GREATER THAN THE ORIGINAL INSPECTION FEE FOR EACH REINSPECTION. THE REINSPECTION MUST BE DONE WITHIN TEN (10) WORKING DAYS OF REQUEST. THE REINSPECTION IS A VISUAL INSPECTION AND IF INSPECTION OF CONCEALED AREAS IS DESIRED, INSPECTION OF WORK IN PROGRESS WILL BE NECESSARY. ANY GUARANTEES MUST BE RECEIVED FROM PARTIES PERFORMING REPAIRS". SECTION 8525 BUSINESS AND PROFESSIONS CODE AND SECTION 8516, BUSINESS AND PROFESSIONS CODE.*

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	3 of 8

*IF LOCAL BUILDING CODES REQUIRE PERMITS AND/OR BUILDING PLANS, OWNER IS RESPONSIBLE FOR OBTAINING PERMITS AND PLANS. NOTE ALSO THAT PRICES FOR REPAIRS MAY OR MAY NOT BE AFFECTED BY THESE PERMITS AND PLANS. IF THE PERMIT PROCESS CHANGES THE SCOPE OF THE WORK TO BE DONE, PRICES MAY CHANGE AND ARE THE RESPONSIBILITY OF THE HOME OWNER.*

*THE PURPOSE OF THIS REPORT IS TO DOCUMENT FINDINGS AND RECOMMENDATIONS WHICH PERTAIN TO THE ABSENCE OR PRESENCE OF WOOD DESTROYING ORGANISMS AND/OR CONDUCTIVE CONDITION[S] AT THE TIME OF INSPECTION. THIS REPORT SHOULD BE READ CAREFULLY AND IS NOT TO BE CONFUSED WITH A HOME MAINTENANCE SURVEY. THE CLIENT'S COOPERATION AND COMPLIANCE TO CORRECT AND OR COMPLETE THE RECOMMENDATIONS DOCUMENTED IN THIS REPORT ARE OBLIGATORY. WITHOUT A MUTUAL EFFORT THIS COMPANY CAN NOT ASSURE EFFECTIVE OR SATISFACTORY RESULTS.*

*THE OWNER OF THIS STRUCTURE HAS CERTAIN OBLIGATIONS REGARDING MAINTENANCE AND PERTAINING TO THE DETERRENCE OF WOOD DESTROYING ORGANISMS. MAINTENANCE PROCEDURES INCLUDE; BUT ARE NOT LIMITED TO : REASONABLE CLEANING, UPKEEP OF ROOFS, GUTTERS AND DOWNSPOUTS: PAINTING AND SEALING OF EXPOSED SURFACES; CAULKING ABOUT DOORS AND WINDOWS OR GROUTING ABOUT COMMODOES, TUB AND SHOWER ENCLOSURES; STORING MATERIALS ONE FOOT AWAY THE STRUCTURE'S FOUNDATIONS; PROVIDING ADEQUATE VENTILATION, MAINTAINING PROPER DRAINAGE AWAY FROM STRUCTURE (INCLUDING SPRINKLER SYSTEMS); KEEPING SOIL LEVELS BELOW THE TOP OF FOUNDATIONS AND PROHIBITING EARTH CONTACT WITH WOOD COMPONENTS OF THE STRUCTURE(S).*

*NOTICE: THE CHARGE FOR SERVICE THAT THIS COMPANY SUBCONTRACTS TO ANOTHER REGISTERED COMPANY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH PAYING THE SUB CONTRACTOR. YOU MAY ACCEPT TOP NOTCH TERMITE COMPANYS BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, TOP NOTCH TERMITE COMPANY WILL NOT IN ANY WAY BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM.*

*PREPARATION IS MANDATORY AND IT IS THE OWNER RESPONSIBILITY TO PROVIDE THE UTILITIES NECESSARY FOR TERMITE WORK. ALL SOIL SHALL BE SOAKED SIX INCHES DEEP AND TWELVE INCHES OUTWARD FROM EXTERIOR FOUNDATIONS ONE DAY PRIOR TO FUMIGATION. ALL PLANTS OR SHRUBBERY MUST BE TRIMMED BACK ONE FOOT FROM STRUCTURE PRIOR TO ANY FUMIGATION OR SUBTERRANEAN TERMITE TREATMENT. ANY STORED MATERIALS, FURNISHINGS, ETC., ON SLAB FLOORING MUST BE MOVED ONE FOOT AWAY FROM FOUNDATION AND PARTITION WALL INSPECTING AND TREATMENT. THE OWNER MUST ALLOW ACCESS FOR ANY NECESSARY INSPECTION OR TREATMENT.*

**GUARANTEE POLICY:**

*THIS GUARANTEE EXCLUDES STRUCTURES WITH SUB SLAB HEATING/AIR CONDITIONING SYSTEMS, PLENUM CONSTRUCTION WITH AIR CONDITIONING AND HEATING DUCT IN USE, A WELL OR CISTERN WITHIN FIFTY FEET AND AREAS THAT ARE INACCESSIBLE FOR TREATMENT. ADDITIONAL EXCLUSIONS INCLUDE STRUCTURES WITH DAMAGE TO OR FROM EXCESSIVE MOISTURE, INADEQUATE CONSTRUCTION, AREAS OF INACCESSIBILITY, DETERIORATING MATERIALS, MASONRY FAILURE, GRADE ALTERATION, PIPES AND CONDUITS BENEATH CONCRETE SLAB, FURNISHINGS OR CONTENTS, ETC. NO GUARANTEE WILL BE ISSUED FOR ANY WORK THAT IS A SECONDARY RECOMMENDATION OR WORK COMPLETED BY OTHERS. NO GUARANTEE WILL BE ISSUED FOR ANY TREATMENTS FOR FAMOSAN TERMITES, OR FOR FUTURE DAMAGE CREATED BY FAMOSAN TERMITES. GUARANTEED FOR THIRTY DAYS ARE ANY PLUMBING, GROUTING, CAULKING AND RESETTING OF COMMODOES, SINKS OR ENCLOSURES. WARRANTIES FOR CHEMICAL LOCAL TREATMENT ARE LIMITED TO AREAS TREATED ONLY FOR ONE YEAR ONLY FROM DATE OF WORK COMPLETED. FUMIGATIONS ARE WARRANTIED FOR TWO YEARS FROM DATE OF COMPLETION. TOP NOTCH TERMITE COMPANY IS NOT LIABLE FOR HOUSING OR OTHER EXPENSES INCURRED DURING FUMIGATION. ALL OTHER WORK PERFORMED BY THIS COMPANY SHALL BE GUARANTEED FOR THE DURATION OF ONE YEAR UNLESS OTHERWISE NOTED IN BODY OF REPORT. THIS COMPANY MAKES NO GUARANTEE OR WARRANTY, EXPRESS OR IMPLIED, REGARDING FUTURE INFECTIONS OR ADVERSE CONDITIONS OR CONDITIONS PRESENT BUT NOT EVIDENT AT THE TIME OF INSPECTION. SEE ALSO NOTE REGARDING ROOFING WARRANTY.*

*THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT DOES NOT INCLUDE WORK WHICH REQUIRES CONTACT WITH MATERIALS CONTAINING ASBESTOS. TERMITE INSPECTORS HAVE NO EXPERTISE OR LICENSE IN ASBESTOS ANALYSIS. ASBESTOS IS A NATURAL OCCURRING MINERAL FIBER USED EXTENSIVELY IN CONSTRUCTION PRIOR TO 1978. THE OWNER, EMPLOYEE OR CONTRACTOR MUST DETERMINE THE ASBESTOS STATUS PRIOR TO THE COMMENCEMENT OF WORK ON A PROJECT.*

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	4 of 8

*OCCUPANTS AND EMPLOYEES MUST BE PROTECTED FROM ASBESTOS FIBER RELEASE. SHOULD ASBESTOS BE OBSERVED DURING ANY CONSTRUCTION OR DEMOLITION, WORK MUST STOP. THE OWNER SHALL OBTAIN THE SERVICES OF AN ASBESTOS ABATEMENT CONTRACTOR TO EVALUATE THE SITUATION, PROVIDE THE NECESSARY SERVICES AND CERTIFY THE AREA SAFE BEFORE WORK MAY RESUME. ASBESTOS STATEMENT REF: AB2040, SB2572 AND GENERAL INDUSTRY SAFETY ORDER NUMBER 5208.*

Note: This Wood Destroying Pests and Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

\*\*\*\*\*SECTIONED REPORTING\*\*\*\*\*

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I OR SECTION II CONDITIONS EVIDENT ON THE DATE OF THIS INSPECTION. SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR SECTION II.

**1. SUBTERRANEAN TERMITES**

**ITEM NO. 1A** (Section 1)  
 FINDING AND RECOMMENDATION: 1A  
 FINDING: (SECTION 1)  
 EVIDENCE OF SUBTERRANEAN TERMITES AS INDICATED BY 1A ON THE DIAGRAM. EVIDENCE NOTED IN OR AT SUB AREA.  
 RECOMMENDATION:  
 DRILL THROUGH THE CONCRETE SLAB AND/OR TRENCH AND TREAT THE SOIL WITH A TERMITICIDE, APPROXIMATELY WHERE INDICATED BY XXXX ON DIAGRAM. ANY HOLES DRILLED THROUGH CONCRETE WILL BE FILLED WITH MORTAR. ALL ACCESSIBLE TERMITE TUBING WILL BE REMOVED OR KNOCKED DOWN. WHILE WE WILL BE UTILIZING A GROUNDED STOP DEVICE, WE CANNOT BE RESPONSIBLE FOR ANY DAMAGE WE MAY CAUSE TO UNDERGROUND PLUMBING.

**2. DRYWOOD TERMITES**

**ITEM NO. 2A** (Section 1)  
 FINDING AND RECOMMENDATION: 2A  
 FINDING: (SECTION 1)  
 EVIDENCE OF DRYWOOD TERMITES AS INDICATED BY 2A ON THE DIAGRAM. EVIDENCE NOTED AT WINDOWS, FENCE AND PORCH.  
 RECOMMENDATION:  
 FUMIGATE THE STRUCTURE WITH A FUMIGANT LETHAL TO DRYWOOD TERMITES. TOP NOTCH TERMITE COMPANY WILL MASK/COVER REMOVE PELLETS IN AREAS FOUND IF ACCESS IS AVAILABLE AFTER FUMIGATION. SEE THE OCCUPANTS FUMIGATION NOTICE FOR FURTHER DETAILS. THIS COMPANY IS NOT RESPONSIBLE FOR DELAYS OR SCHEDULE CHANGES DUE TO INCLEMENT WEATHER OR OTHER AGENCIES, NOR IS IT RESPONSIBLE FOR DAMAGE TO ROOF OR PLANTS AS A RESULT OF THE FUMIGATION. REFER TO THE OCCUPANT'S FUMIGATION NOTICE/PREPARATION SHEET (SENT SEPARATELY) FOR ADDITIONAL INFORMATION. TOP NOTCH TERMITE COMPANY USES SUB CONTRACTORS TO PERFORM FUMIGATIONS. PLEASE SEE THE OCCUPANT'S FUMIGATION NOTICE (SEPARATE DOCUMENT) FOR ADDITIONAL INFORMATION REGARDING THIS SUB CONTRACTOR. TOP

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	5 of 8

(Section 1)

NOTCH TERMITE COMPANY IS NOT LIABLE FOR HOUSING OR OTHER EXPENSES THAT OCCUR DOING FUMIGATION.

**ITEM NO. 2B**

(Section 1)

FINDING AND  
RECOMMENDATION: 2B

FINDING: (SECTION 1)

DRYWOOD TERMITE DAMAGE INDICATED BY 2B ON DIAGRAM. THE DAMAGE WAS NOTED IN WINDOW FRAMES.

RECOMMENDATION:

REPAIR OR REINFORCE WOOD AS NECESSARY IN TODAY'S AVAILABLE WIDTHS AND GRADES. WOOD WITH MINOR, SUPERFICIAL, DAMAGE WILL BE FILLED WITH WOOD FILLER (BONDO).

**ITEM NO. 2C**

(Section 1)

FINDING AND  
RECOMMENDATION: 2C

FINDING: (SECTION 1)

DRYWOOD TERMITE DAMAGE INDICATED BY 2C ON DIAGRAM. THE DAMAGE WAS NOTED IN WINDOW LEDGE.

RECOMMENDATION:

REPAIR OR REINFORCE WOOD AS NECESSARY IN TODAY'S AVAILABLE WIDTHS AND GRADES. WOOD WITH MINOR, SUPERFICIAL, DAMAGE WILL BE FILLED WITH WOOD FILLER (BONDO).

**ITEM NO. 2D**

(Section 1)

FINDING AND  
RECOMMENDATION: 2D

FINDING: (SECTION 1)

DRYWOOD TERMITE DAMAGE INDICATED BY 2D ON DIAGRAM. THE DAMAGE WAS NOTED IN FENCE POST, RAILING AND PANELING.

RECOMMENDATION:

REPAIR OR REINFORCE WOOD AS NECESSARY IN TODAY'S AVAILABLE WIDTHS AND GRADES. WOOD WITH MINOR, SUPERFICIAL, DAMAGE WILL BE FILLED WITH WOOD FILLER (BONDO).

**ITEM NO. 2E**

(Section 1)

FINDING AND  
RECOMMENDATION: 2E

FINDING: (SECTION 1)

EVIDENCE OF DRYWOOD TERMITES AS INDICATED BY 2E ON THE DIAGRAM. EVIDENCE NOTED AT BALCONIES.

RECOMMENDATION:

FUMIGATE THE STRUCTURE WITH A FUMIGANT LETHAL TO DRYWOOD TERMITES. TOP NOTCH TERMITE COMPANY WILL MASK/COVER REMOVE PELLETS IN AREAS FOUND IF ACCESS IS AVAILABLE AFTER FUMIGATION. SEE THE OCCUPANTS FUMIGATION NOTICE FOR FURTHER DETAILS. THIS COMPANY IS NOT RESPONSIBLE FOR DELAYS OR SCHEDULE CHANGES DUE TO INCLEMENT WEATHER OR OTHER AGENCIES, NOR IS IT RESPONSIBLE FOR DAMAGE TO ROOF OR PLANTS AS A RESULT OF THE FUMIGATION. REFER TO THE OCCUPANT'S FUMIGATION NOTICE/PREPARATION SHEET (SENT SEPARATELY) FOR ADDITIONAL INFORMATION. TOP NOTCH TERMITE COMPANY USES SUB CONTRACTORS TO PERFORM FUMIGATIONS. PLEASE SEE THE OCCUPANT'S FUMIGATION NOTICE (SEPARATE DOCUMENT) FOR ADDITIONAL INFORMATION REGARDING THIS SUB CONTRACTOR. TOP NOTCH TERMITE COMPANY IS NOT LIABLE FOR HOUSING OR OTHER EXPENSES THAT OCCUR DOING FUMIGATION.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	6 of 8

**ITEM NO. 2F**

(Section 1)

FINDING AND  
RECOMMENDATION: 2F

FINDING: (SECTION 1)  
 DRYWOOD TERMITE DAMAGE INDICATED BY 2F ON DIAGRAM.  
 THE DAMAGE WAS NOTED IN BALCONY FRAMING, DECKING STAIRS.  
 RECOMMENDATION:  
 OWNER TO CONTACT A LICENSED CONTRACTOR TO REPAIR THIS  
 AREA.

**ITEM NO. 2G**

(Section 1)

FINDING AND  
RECOMMENDATION: 2G

FINDING: (SECTION 1)  
 EVIDENCE OF DRYWOOD TERMITES AS INDICATED BY 2G ON THE  
 DIAGRAM. EVIDENCE NOTED AT INTERIOR OF 3773.  
 RECOMMENDATION:  
 FUMIGATE THE STRUCTURE WITH A FUMIGANT LETHAL TO  
 DRYWOOD TERMITES. TOP NOTCH TERMITE COMPANY WILL  
 MASK/COVER REMOVE PELLETS IN AREAS FOUND IF ACCESS IS  
 AVAILABLE AFTER FUMIGATION. SEE THE OCCUPANTS FUMIGATION  
 NOTICE FOR FURTHER DETAILS. THIS COMPANY IS NOT RESPONSIBLE  
 FOR DELAYS OR SCHEDULE CHANGES DUE TO INCLEMENT WEATHER OR  
 OTHER AGENCIES, NOR IS IT RESPONSIBLE FOR DAMAGE TO ROOF OR  
 PLANTS AS A RESULT OF THE FUMIGATION. REFER TO THE OCCUPANT'S  
 FUMIGATION NOTICE/PREPARATION SHEET (SENT SEPARATELY) FOR  
 ADDITIONAL INFORMATION. TOP NOTCH TERMITE COMPANY USES SUB  
 CONTRACTORS TO PERFORM FUMIGATIONS. PLEASE SEE THE  
 OCCUPANT'S FUMIGATION NOTICE (SEPARATE DOCUMENT) FOR  
 ADDITIONAL INFORMATION REGARDING THIS SUB CONTRACTOR. TOP  
 NOTCH TERMITE COMPANY IS NOT LIABLE FOR HOUSING OR OTHER  
 EXPENSES THAT OCCUR DOING FUMIGATION.

**ITEM NO. 2H**

(Section 1)

FINDING AND  
RECOMMENDATION: 2H

FINDING: (SECTION 1)  
 EVIDENCE OF DRYWOOD TERMITES AS INDICATED BY 2H ON THE  
 DIAGRAM. EVIDENCE NOTED AT ATTIC OF 3773.  
 RECOMMENDATION:  
 FUMIGATE THE STRUCTURE WITH A FUMIGANT LETHAL TO  
 DRYWOOD TERMITES. TOP NOTCH TERMITE COMPANY WILL  
 MASK/COVER REMOVE PELLETS IN AREAS FOUND IF ACCESS IS  
 AVAILABLE AFTER FUMIGATION. SEE THE OCCUPANTS FUMIGATION  
 NOTICE FOR FURTHER DETAILS. THIS COMPANY IS NOT RESPONSIBLE  
 FOR DELAYS OR SCHEDULE CHANGES DUE TO INCLEMENT WEATHER OR  
 OTHER AGENCIES, NOR IS IT RESPONSIBLE FOR DAMAGE TO ROOF OR  
 PLANTS AS A RESULT OF THE FUMIGATION. REFER TO THE OCCUPANT'S  
 FUMIGATION NOTICE/PREPARATION SHEET (SENT SEPARATELY) FOR  
 ADDITIONAL INFORMATION. TOP NOTCH TERMITE COMPANY USES SUB  
 CONTRACTORS TO PERFORM FUMIGATIONS. PLEASE SEE THE  
 OCCUPANT'S FUMIGATION NOTICE (SEPARATE DOCUMENT) FOR  
 ADDITIONAL INFORMATION REGARDING THIS SUB CONTRACTOR. TOP  
 NOTCH TERMITE COMPANY IS NOT LIABLE FOR HOUSING OR OTHER  
 EXPENSES THAT OCCUR DOING FUMIGATION.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	7 of 8

### 3. FUNGUS OR DRYROT

**ITEM NO. 3A** (Section 1)  
 FINDING AND RECOMMENDATION: 3A  
 FINDING: (SECTION 1)  
 FUNGUS DAMAGE INDICATED BY 3A ON DIAGRAM. THE FUNGUS INFECTION WAS NOTED IN SOFFIT.  
 RECOMMENDATION:  
 REMOVE DAMAGED WOOD AND REPLACE WITH NEW WOOD IN TODAY'S AVAILABLE WIDTHS AND GRADES.

**ITEM NO. 3B** (Section 1)  
 FINDING AND RECOMMENDATION: 3B  
 FINDING: (SECTION 1)  
 FUNGUS DAMAGE INDICATED BY 3B ON DIAGRAM. THE FUNGUS INFECTION WAS NOTED IN 2ND STORY STARTER BOARDS.  
 RECOMMENDATION:  
 REMOVE DAMAGED WOOD AND REPLACE WITH NEW WOOD IN TODAY'S AVAILABLE WIDTHS AND GRADES.

**ITEM NO. 3C** (Section 1)  
 FINDING AND RECOMMENDATION: 3C  
 FINDING: (SECTION 1)  
 FUNGUS DAMAGE INDICATED BY 3C ON DIAGRAM. THE FUNGUS INFECTION WAS NOTED IN PORCH RAILING.  
 RECOMMENDATION:  
 OWNER IS ADVISED TO CONTACT A LICENSED CONTRACTOR TO REPAIR DAMAGE.

**ITEM NO. 3D** (Section 1)  
 FINDING AND RECOMMENDATION: 3D  
 FINDING: (SECTION 1)  
 FUNGUS DAMAGE INDICATED BY 3D ON DIAGRAM. THE FUNGUS INFECTION WAS NOTED IN BALCONY FRAMING, DECKING, STAIRS AND PANELING.  
 RECOMMENDATION:  
 OWNER IS ADVISED TO CONTACT A LICENSED CONTRACTOR TO REPAIR DAMAGE.

### 4. OTHER FINDINGS

**ITEM NO. 4A** (Section 2)  
 FINDING AND RECOMMENDATION: 4A  
 FINDING: (SECTION 2)  
 CELLULOSE DEBRIS AND/OR VEGETATION NOTED AS 4A ON THE DIAGRAM. THE CELLULOSE DEBRIS WAS LOCATED IN THE SUB FLOOR  
 RECOMMENDATION:  
 REMOVE CELLULOSE DEBRIS OF RAKE SIZE OR LARGER.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
3771-75	TEXAS ST	SAN DIEGO	92104	10/15/2024	8 of 8

## 5. FURTHER INSPECTION

### ITEM NO. 5A

(Section Not Determined)

#### FINDING AND

RECOMMENDATION: 5A

FINDING: (SECTION NOT DETERMINED)

AN INACCESSIBLE AREA EXISTS AS INDICATED BY 5A ON THE DIAGRAM. THE SHED WAS INACCESSIBLE DUE TO BEING SECURED.

RECOMMENDATION:

UNSECURE DOORS TO MAKE THIS AREA ACCESSIBLE FOR FURTHER INSPECTION.

## COMMENTS AND OTHER INFORMATION

CALIFORNIA STATE LAW REQUIRES THAT YOU BE GIVEN THE FOLLOWING INFORMATION: "CAUTION PESTICIDES ARE TOXIC CHEMICALS". STRUCTURAL PEST CONTROL OPERATORS ARE LICENSED AND REGULATED BY THE STRUCTURAL PEST CONTROL BOARD, AND APPLY PESTICIDES WHICH ARE REGISTERED AND APPROVED FOR USE BY THE CALIFORNIA DEPARTMENT OF PESTICIDE REGULATION AND THE UNITED STATES ENVIRONMENTAL PROTECTION AGENCY. REGISTRATION IS GRANTED WHEN THE STATE FINDS THAT BASED ON EXISTING SCIENTIFIC EVIDENCE THERE ARE NO APPRECIABLE RISKS IF PROPER USE CONDITIONS ARE FOLLOWED OR THAT RISKS ARE OUTWEIGHED BY THE BENEFITS. THE DEGREE OF RISK DEPENDS UPON THE DEGREE OF EXPOSURE, SO EXPOSURE SHOULD BE MINIMIZED.

IF WITHIN TWENTY-FOUR HOURS FOLLOWING APPLICATION YOU EXPERIENCE SYMPTOMS SIMILAR TO COMMON SEASONAL ILLNESS COMPARABLE TO THE FLU,( IN CASE OF VIKANE USE; SYMPTOMS MAY INCLUDE DIZZINESS, HEADACHE, NAUSEA, REDUCED AWARENESS, SLOWED MOVEMENT, GARBLED SPEECH OR DIFFICULTY IN BREATHING) CONTACT YOUR PHYSICIAN OR POISON CONTROL CENTER AT: [(800) 876-4766] AND YOUR PEST CONTROL OPERATOR IMMEDIATELY. FOR ADDITIONAL INFORMATION CONTACT THE COUNTY HEALTH DEPARTMENT (619) 338-2222; COUNTY AGRICULTURAL DEPARTMENT (858) 694-2739 AND THE STRUCTURAL PEST CONTROL BOARD, 2005 EVERGREEN ST #1500, SACRAMENTO, CA. 95815-3831, (916) 516-8708.

FOR FURTHER INFORMATION, CONTACT ANY OF THE FOLLOWING:

TOP NOTCH TERMITE COMPANY.....(619) 282-8771  
 HEALTH QUESTION :SAN DIEGO COUNTY HEALTH DEPARTMENT.....(619) 338-2222 OR  
 CALIFORNIA POISON CONTROL CENTER.....(800) 876-4766  
 APPLICATION INFORMATION: COUNTY AGRICULTURAL COMMISSIONER.....(858) 694-2739  
 REGULATORY INFORMATION: STRUCTURAL PEST CONTROL BOARD.....(916) 561-8708  
 2005 Evergreen St #1500, Sacramento, California 95815-3831

\* IF WE HAVE RECOMMENDED THE USE OF A FUNGICIDE WE WILL USE:

TIM-BOR (Active Ingredient: Disodium Octaborate Tetrahydrate)

\* IF WE HAVE RECOMMENDED THE TREATMENT OF SUBTERRANEAN TERMITES WE WILL USE:

TERMIDOR SC TERMITICIDE (Active Ingredient:Fipronil)

\* IF WE HAVE RECOMMENDED THE LOCAL TREATMENT OF DRYWOOD TERMITES, WOOD BORING BEETLES OR CARPENTER ANTS WE WILL USE:

TERMIDOR SC TERMITICIDE (ACTIVE Ingredient: Fipronil) OR

CB-80 (Active Ingredient: Pyrethrins, Piperonyl Butoxide)OR

Z Pro 44(Active Ingredient: Esfenvalerate)

\* IF WE HAVE RECOMMENDED THE FUMIGATION OF DRYWOOD TERMITES WE WILL USE:

VIKANE (Active Ingredient: Sulfural Flouride),

Zythor (active ingredient: Sulfural Flouride)



# Work Authorization

Prepared by

Report # : 73710

## Top Notch Termite Company, Inc.


### ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
3771-75	TEXAS ST	SAN DIEGO	92104	37	10/15/2024

Ordered by: LISA WHELIHAN THE METROPOLITAN GROUP	Property Owner and/or Party of Interest	Report sent to:
--	---	-----------------

An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

NOTE: If diagram is not displayed here, please see the report.

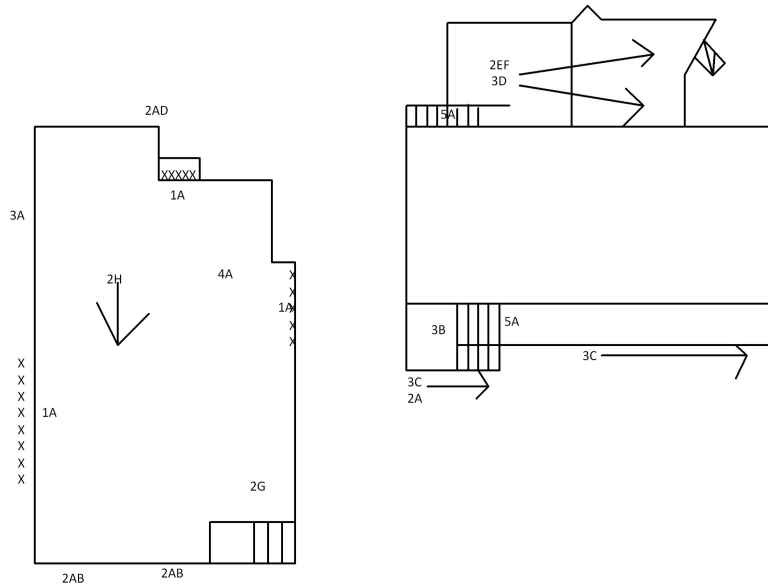

# Work Authorization

Prepared by

Report #: 73710

## Top Notch Termite Company, Inc.

### ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
3771-75	TEXAS ST	SAN DIEGO	92104	37	10/15/2024

#### Section 1

1A	=	475.00 P
2A	=	2350.00 P
2B	=	675.00 P
2C	=	200.00 P
2D	=	400.00 P
2E	=	Included 2A
2F	=	No Bid
2G	=	Included 2A
2H	=	Included 2A
3A	=	500.00 P
3B	=	Included 3A
3C	=	No Bid
3D	=	No Bid

#### Further Inspection

5A = No Bid

#### Further Inspection Totals

Total using primary recs \$ 0.00

#### Section 1 Totals

Total using primary recs \$ 4600.00

#### Section 2

4A = 150.00 P

#### Section 2 Totals

Total using primary recs \$ 150.00

#### Further Inspection

Cost of all Primary Recommendations \$ 4750.00

**NOTE: Damage found in Inaccessible Areas may require a Supplemental report and/or Work Authorization, or may require amendments to this Work Authorization.**

### NOTICE TO OWNER

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

# Work Authorization

Prepared by

Report # : 73710

## Top Notch Termite Company, Inc.

### ADDRESS OF PROPERTY INSPECTED

BUILDING NO.	STREET	CITY	ZIP	COUNTY CODE	DATE OF INSPECTION
3771-75	TEXAS ST	SAN DIEGO	92104	37	10/15/2024

Cost of all Primary Recommendations \$ 4750.00

**NOTE: Damage found in Inaccessible Areas may require a Supplemental report and/or Work Authorization, or may require amendments to this Work Authorization.**

1. If further inspection is recommended, if additional work is required by any government agency, or if additional damage is discovered while performing the repairs, this company reserves the right to increase prices.
2. In the event that legal action is necessary to enforce the terms of this contract, reasonable attorney's fees may be awarded to the prevailing party.
3. This company will use due caution and diligence in their operations but assume no responsibility for matching existing colors and styles, or for incidental damage to roof coverings, T.V. antennae, solar panels, rain gutters, plant life, or paint.
4. This report is limited to the accessible areas shown on the diagram. Please refer to the report for the areas not inspected.
5. IF THIS CONTRACT IS TO BE PAID OUT OF ESCROW IMPOUND THE BUYERS AND SELLERS AGREE TO PROVIDE THIS COMPANY WITH ALL ESCROW BILLING INFORMATION REQUIRED TO COLLECT THE AMOUNT DUE. THE PERSONS SIGNING THIS CONTRACT ARE RESPONSIBLE FOR PAYMENT, AND IF THE ESCROW DOES NOT CLOSE WITHIN 10 DAYS AFTER THE DATE OF COMPLETION OF THE WORK, THE SIGNER AGREES TO PAY IN FULL THE AMOUNT SPECIFIED IN THIS WORK AUTHORIZATION AGREEMENT. IT IS SIGNERS RESPONSIBILITY TO CONTACT TOP NOTCH TERMITE COMPANY IF PROPERTY FALLS OUT OF ESCROW TO MAKE PAYMENT ARRANGEMENTS. IN CASE OF NON PAYMENT BY THE OWNER, REASONABLE ATTORNEY FEES AND COSTS OF COLLECTION SHALL BE PAID BY OWNER WHETHER SUIT BE FILED OR NOT.
6. If this agreement includes a charge for opening an area for further inspection, it is for opening the area only and does not include making additional repairs, if needed, nor does it include replacing removed or damaged floor coverings, wall coverings, or painted exposed surfaces unless specifically stated.
7. It is owners responsibility to remove valuables away from area that is being worked on. For example if work is being done on exterior wall please make sure valuables have been properly secured or removed on opposite interior wall in order to prevent accidental damage. Top Notch termite Company will not reimburse owners for accidental damage that may occur during repairs.

Print Full Name \_\_\_\_\_ Email address \_\_\_\_\_

Phone Number \_\_\_\_\_

This company is authorized to perform items: \_\_\_\_\_

Cost of work authorized: \$ \_\_\_\_\_

OWNER or OWNER's AGENT:	DATE:
X _____	_____
X _____	_____

Top Notch Termite Company, Inc.
BY: _____
ESCROW CO: _____
ESCROW NO: _____