
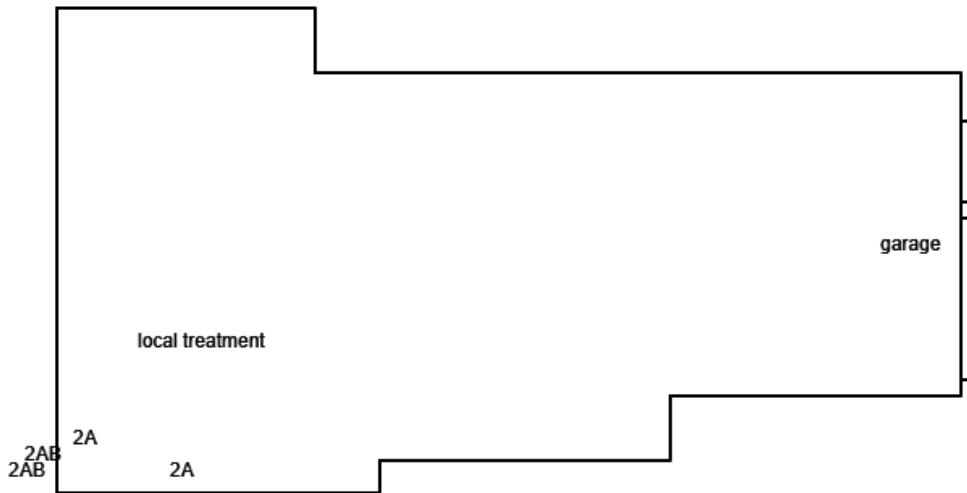


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 308	Street La Cresta Heights Rd.	City El Cajon	ZIP 92021	Date of Inspection 06/17/2026	Number of Pages 5
		The Works Termite Inc. 119 Kearney St. Chula Vista CA 91910 (619) 987-2504 theworkstermite@yahoo.com		Report # : 18826 Registration # : PR7066 Escrow # : ☐ CORRECTED REPORT	
Ordered by: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com		Property Owner and Party of Interest: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com		Report sent to: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com	
COMPLETE REPORT ☒		LIMITED REPORT ☐		SUPPLEMENTAL REPORT ☐	
REINSPECTION REPORT ☐		GENERAL DESCRIPTION: 1 Story single family residence furnished and occupied with attached garage.			
		Inspection Tag Posted: Attic			
		Other Tags Posted: none			
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites ☐ Drywood Termites ☒ Fungus / Dryrot ☐ Other Findings ☐ Further Inspection ☐					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Diagram Not To Scale

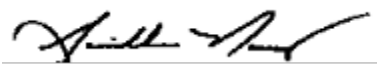

Inspected By: Guillermo Nunez State License No. OPR10701 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (Rev. 04/2015)

THE WORKS TERMITE INC.

Page 2 of 5 inspection report

308 La Cresta Heights Rd.

El Cajon

CA

92021

Address of Property Inspected

City

State

ZIP

06/17/2026

18826

Date of Inspection

Corresponding Report No.

Escrow No.

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture

PORTIONS OF THE ATTIC CONCEALED OR MADE INACCESSIBLE BY INSULATION PORTIONS OF THE ATTIC CONCEALED OR MADE INACCESSIBLE BY DUCTING, PORTIONS OF THE ATTIC OR ROOF CAVITY CONCEALED DUE TO

AN INADEQUATE CRAWL SPACE, THE INTERIORS OF BOXED EAVES, EAVES CONCEALED BY PATIO COVERS OR OTHER ABUTMENTS PORTIONS OF THE SUBAREA CONCEALED OR MADE INACCESSIBLE BY INSULATION, DUCTING OR INSUFFICIENT CLEARANCE, PORTE COCHERES, INCLOSED BAY WINDOWS, AREAS BENEATH WOOD FLOORS OVER CONCRETE, AREAS CONCEALED BY

BUILT-IN CABINET WORK OR BUILT-IN APPLIANCES, AREAS CONCEALED BY FLOOR COVERINGS SUCH AS WALL-TO-WALL CARPETING, LINOLEUM, CERAMIC TILE, AREA RUGS, THROW RUGS, BATH AND KITCHEN MATS ETC. AND AREAS CONCEALED BY BUILT-IN APPLIANCES. WE DO NOT OPEN ANY WINDOWS OR REMOVE WINDOW SCREENS DURING THE COURSE OF OUR

INSPECTIONS, UNLESS OTHERWISE SPECIFIED IN THIS REPORT. ADDITIONALLY, WE DO NOT INSPECT ATTACHED/DETACHED FENCES, GATES, SHEDS, DOG HOUSES, RETAINING WALLS WOOD PLANTERS OR WALKWAYS OR AREAS CONCEALED BY HEAVY VEGETATION AND AREAS WHERE LOCKS PREVENTED ACCESS.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional. A limited report is the report on only part of a structure. Such a report shall

THE WORKS TERMITE INC.

Page 3 of 5 inspection report

308	La Cresta Heights Rd.	El Cajon	CA	92021
Address of Property Inspected		City	State	ZIP
06/17/2026	18826			
Date of Inspection	Corresponding Report No.		Escrow No.	

have a diagram of the area inspected and shall specifically indicate which portions of the structure were inspected with recommendation for further inspection of the entire structure and the name of the person or agency requesting a limited report.

FUMIGATION INFO-CHECK LIST

***PLEASE GO TO YOUTUBE: FUMIGATION PREPARATION

***DO NOT REMOVE THE FUMIGATION TAG ON THE GAS METER, SDGE NEEDS TO SEE THAT TAG FOR GAS TURN ON SERVICE, GAS METER NEEDS TO HAVE 2' ACCESS AROUND GAS METER. SDGE 1800 411-7343.

***FUMIGATION NOTICE IS ALSO A CHECK LIST PLEASE READ ENTIRE NOTICE AND ANY QUESTIONS CALL ME: WILLIE 619 458-5148

***WE WILL NEED A LOCKBOX CODE WITH KEY SO AS TO HAVE ACCESS TO THE PROPERTY ON THE DAY OF FUMIGATION OR SOMEONE PRESENT TO GIVE ACCESS.

***FUMIGATION IS SUB CONTRACTED AND THE FUMIGATION COMPANY ONLY GIVES A TIME FRAME ONE DAY BEFORE THE FUMIGATION GOES UP AND ONE DAY BEFORE TENT DOWN.

1. REMOVE ALL PERSONS, ANIMALS, PETS, FISH. WATER IN THE TANK DOES NOT HAVE TO BE DRAINED. UNPLUG ALL FILTERS, REMOVE ALL ANIMALS FROM THE YARD.

2. REMOVE ALL PLANTS.

3. REMOVE BABY MATTRESSES AND PILLOWS COMPLETELY ENVELOPED IN WATERPROOF PLASTIC OR LINERS.

4. REMOVE ALL FOOD, FEED AND MEDICINE NOT FACTORY SEALED IN GLASS OR METAL CONTAINERS. INCLUDING GUM, CANDY, ALL FOOD IN FREEZERS AND REFRIGERATORS BAGGED UP WITH NYLOFUME BAGS ONLY, OR YOU WILL BE CHARGED \$30 PER BAG IF FUME COMPANY BAGS UP FOR YOU. \$30 PER BAG

5. OPEN ALL DOORS TO ROOMS, CLOSETS, CABINETS, DRAWERS AND APPLIANCES.

6. WE MUST HAVE ACCESS TO ALL AREAS WITHIN THE STRUCTURE, VEHICLES LEFT WITHIN STRUCTURE MUST HAVE WINDOWS ROLLED DOWN AND TRUCK UNLOCKED/OPEN.

7. CUT ALL TREES, BUSHES, PLANTS BACK A MINIMUM OF ONE FOOT FROM THE BUILDING PERIMETER, PULL BACK ALL DECORATIVE BARK, GRAVEL, ROCK A MINIMUM OF ONE FOOT FROM THE BUILDING PERIMETER.

8. IT IS RECOMMENDED THAT THE OWNER WARM THE HOUSE TO 65-70 DEGREE. TURN OFF ANY AIR CONDITIONING UNITS.

9. WE WILL TURN OFF GAS BUT IT YOUR RESPONSIBILITY TO CALL SDGE TO SCHEDULE A GAS TURN ON SERVICE 1800 411-7343. ELECTRICITY STAYS ON.

THE WORKS TERMITE INC.

Page 4 of 5 inspection report

308	La Cresta Heights Rd.	El Cajon	CA	92021
Address of Property Inspected		City	State	ZIP
06/17/2026	18826			
Date of Inspection	Corresponding Report No.	Escrow No.		

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION OF SUBTERRANEAN TERMITE/DRYWOOD TERMITE & FUNGUS/DRYROT SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II. WE ARE LICENSED TO INSPECT, SUBTERRANEAN TERMITE/DRYWOOD TERMITE & FUNGUS/DRYROT INFESTATION ONLY. NO OPINION, RECOMENDATION OR IDENTIFICATION ON ANY OTHER PEST INFESTATION. THE WORKS TERMITE CO. TO WARRANTY ALL REPAIRS AND OR TREATMENTS FOR ONE YEAR FROM DATE OF COMPLETION EXCEPT FOR CAULKING,GROUTING OR PLUMBING, WHICH IS GUARANTEED FOR A PERIOD OF NINETY(90) DAYS. WE ASSUME NO RESPONSIBILITY FOR WORK PERFORMED BY OTHERS, TO BE BOUND TO PERFORM THIS WORK FOR THE PRICE QUOTED IN OUR COST BREAKDOWN FOR A PERIOD NOT TO EXCEED 30 DAYS, TO USE REASONABLE CARE IN THE PERFORMANCE OF OUR WORK BUT TO ASSUME NO RESPONSIBILITY FOR DAMAGE TO ANY HIDDEN PIPES, WIRING, OR OTHER FACILITIES OR TO ANY SHRUBS, PLANTS OR ROOF. (THE SECOND/OR MORE STORY EAVE IS CONSIDERED INACCESSIBLE DUE TO HEIGHT)

"This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II."

2. DRYWOOD TERMITES:

2A - Section I

FINDING - Evidence of Drywood termite infestation noted at Attic.

RECOMMENDATION - Locally treat for the control of drywood termites, Remove or cover the drywood termite fecal pellets in accessible areas, drill and treatment maybe introduced to infested areas, This treatment will not control/ prevent infestation of drywood termites in non treated areas. Local treatment is not intended to be an entire structure treatment method. If infestations of wood destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated. Local treatment will be warranty for ONE YEAR FROM DATE OF COMPLETION (LOCAL TREATMENT IS AN APPORVED TERMITICIDE THAT WE INJECT TO ALL ACCESSIBLE INFESTED AREAS ONLY), HOLE MAYBE FILLED WITH WHITE CAULKING.

2B - Section I

FINDING - Evidence of Drywood termite damage noted at Exterior of house.

ANY ATTACHED FENCING/GATES WILL NOT BE INCLUDED NOR ANY ESTIMATE. (WE DO NOT INSPECT ATTACHED/DETACHED FENCES, GATES, SHEDS, DOG HOUSES, RETAINING WALLS WOOD PLANTERS OR WALKWAYS OR AREAS CONCEALED BY HEAVY VEGETATION AND AREAS WHERE LOCKS PREVENTED ACCESS.)

RECOMMENDATION - Remove and replace drywood termite infested/damaged wood members with today standard industry sizes, Cosmetic damage will be patched with BONDO as needed (Paint to color all repaired areas, NO warranty on color match, 1 paint coat only to exposed exterior repairs.) (No Roofing repairs included with this bid and may required an additional cost). If Damage or infestations are found to extend into interior of wall void or other inaccessible areas it will be reported on a supplemental report. Estimate on additional repairs/treatment will be given. No opinion rendered at this time. Treat for the control of drywood termites as needed per this report. ALL REPAIR/TREATMENT WILL BE WARRANTY FOR ONE YEAR FROM DATE OF COMPLETION.

THE WORKS TERMITE INC.

Page 5 of 5 inspection report

308	La Cresta Heights Rd.	El Cajon	CA	92021
Address of Property Inspected		City	State	ZIP
06/17/2026	18826			
Date of Inspection	Corresponding Report No.	Escrow No.		

"Thank you for selecting our company to perform a structural SUBTERRANEAN TERMITE/DRYWOOD TERMITE & FUNGUS/DRYROT control inspection on your property. Our inspectors have determined that your property will benefit from the safe application of a chemical commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property. Please take a few moments to read and become familiar with the content.

*****OCCUPANTS CHEMICAL NOTICE***** The Works Termite Inc. will use pesticide chemical(s) specified below for the control of wood destroying pests or organisms in locations identified in the Structural Pest Control report as indicated above. (1) The pest(s) to be controlled: ☐ SUBTERRANEAN TERMITE ☐ DRYWOOD TERMITE ☐ FUNGUS/DRY ROT . ☐ OTHER (2) The pesticide(s) proposed to be used and the active ingredient(s): ☐ A. TERMIDOR (FIPRONIL 9.1% INERT INGREDIENTS 90.9%) ☐ B. TIMBOR (DISODIUM OCTABORATE TETRAHYDRATE) ☐ C. COPPER (NAPHTHENATE (COPPER SALTS OF NAPHTHENIC ACIDS) ☐ D. PREMISE (IMIDACLOPRID 0.5% INERT INGREDIENTS 99.5) ☐ E. VIKANE (SULFURYL FLUORIDE 99.8% INERT INGREDIENTS 0.2%) Persons with respiratory or allergic conditions, or others who may be concerned about their health relative to this chemical treatment, should contact their physician concerning occupancy during and after chemical treatment prior to signing this NOTICE. NO CHEMICAL APPLICATION WILL BE PERFORMED UNTIL SUCH TIME THAT THIS NOTICE IS RETURNED. HAVING READ THE INSTRUCTIONS, I, THE UNDERSIGNED, WILL ACCEPT RESPONSIBILITY FOR ALL THE AFOREMENTIONED.

_____ owner/occupant date
_____ owner/occupant date

"STATE law requires that you be given the following information: CAUTION—PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (telephone number) and your pest control company immediately." (This statement shall be modified to include any other symptoms of overexposure which are not typical of influenza.)

"For further information, contact any of the following: Your Pest Control Company (telephone number); for Health Questions—the County Health Department (telephone number); for Application Information—the County Agricultural Commissioner (telephone number), and for Regulatory Information—the Structural Pest Control Board (telephone number and address).

The Works Termite Inc. 619-987-2504 County Health Department 619-338-2222 County Poison Control Center 800-222-1222 County Agricultural Commissioner 858-694-2738 Structural Pest Control Board 916-561-8700 or 800-737-8188 (2005 Structural Pest Control Board: EVERGREEN ST, SUITE 1500, SACRAMENTO, CALIFORNIA 95815.)

Poison Control Center	(800) 222-1222
Agricultural Department	(858) 694-2739
Health Department	(866) 358-2966
Structural Pest Control Board	(916) 561-8700
2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815	



The Works Termite Inc.

119 Kearney St.
Chula Vista CA 91910
(619) 987-2504
theworkstermite@yahoo.com

Page 1 of 1

WORK AUTHORIZATION

Report #: 18826

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 308 La Cresta Heights Rd.

City: El Cajon

State/ZIP: CA 92021

The inspection report of the company dated, **06/17/2026** is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____. This total amount is due and payable within **days** from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of **ninety (90) days**. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof.

THE OWNER OR OWNER'S AGENT AGREES

To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

ITEMS

	Prefix	Section I	Section II	Further Inspection	Other
2A	local treatment	425.00	0.00	0.00	0.00
2B	termite repairs	280.00	0.00	0.00	0.00
Total:		705.00	0.00	0.00	0.00
Grand Total:		705.00			

Property Owner:

Date:

Inspected By: Guillermo Nunez

Date: 06/18/2026

Ordered By:

Date:

STANDARD NOTICE OF WORK COMPLETED AND NOT COMPLETED

NOTICE - All recommendations may not have been completed - See below - Recommendations not completed.

This form is prescribed by the Structural Pest Control Board.

Building No. 308	Street La Cresta Heights Rd.	City El Cajon	ZIP 92021	Date of Completion 07/08/2026
---------------------	---------------------------------	------------------	--------------	----------------------------------



The Works Termite Inc.

119 Kearney St.
Chula Vista CA 91910
(619) 987-2504
theworkstermite@yahoo.com

Report # : 18826 - 1

Registration # : PR7066

Escrow # :

☐ CORRECTED REPORT

Ordered By: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com	Property Owner and/or Party of Interest: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com	Completion Sent To: Scott Schimpf 4309 Merritt blvd La Mesa CA 91941 United States MOBILE: (619) 825-6726 schimpf3787@gmail.com
---	--	---

The following recommendations on the above designated property, as outlined in Wood Destroying Pests and Organisms Inspection Report dated 06/17/2026 have been and/or have not been completed.

Recommendations completed by this firm that are in accordance with the Structural Pest Control Board's Rules and Regulations:
2A, 2B

The Works Termite Inc. has Re inspected the property on the day of completion and has Locally treated for the control of drywood termite with a one-year warranty and repaired and or replaced termite/fungus with a one-year warranty from date of comple

Recommendations completed by this firm that are considered secondary and substandard measures under Section 1992 of the Structural Pest Control Board's Rules and Regulations including person requesting secondary measure:

Cost of work completed:

Cost: \$	705.00
Inspection Fee: \$	0.00
Other: \$	0.00
Total: \$	705.00

Recommendations not completed by this firm:

Estimated Cost: \$ _____

Remarks:

This is to certify that the property described herein is now free of evidence of active infestation or infection in the visible and accessible areas.

This is to certify that the above property is clear and free of evidence of active infestations of wood destroying organisms in the visible and accessible areas to include Section 1 and 2 and is in compliance with the Structural Pest Control Act, The Works Termite Inc. to honor a (1) year warranty.

Inspected By: Guillermo Nunez State License No. OPR10701 Signature: _____

You are entitled to obtain copies of all reports and completion notices on this property reported to the Board during the preceding two years upon payment of a search fee to: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of this company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-44 (Rev.10/01)



INVOICE / STATEMENT

The Works Termite Inc.

119 Kearney St.
Chula Vista CA 91910
(619) 987-2504
theworkstermite@yahoo.com

Date: 07/08/2026

Report Number: 18826

Invoice Number: 18826-1

Escrow Number:

Property 308 La Cresta Heights Rd.
Inspected: El Cajon, CA 92021

Bill To: Scott Schimpf
4309 Merritt blvd
La Mesa, CA 91941
United States

MOBILE: (619) 825-6726
schimpf3787@gmail.com

Contract: \$	705.00
Invoice Total: \$	705.00
Payments: \$	705.00
Total Due: \$	0.00

Description of Service

The Works Termite Inc. has locally treated for drywood termite and repaired termite damage as per report.

RETAIN THIS COPY FOR YOUR RECORDS
THANK YOU FOR YOUR BUSINESS

CUT HERE

CUT HERE

CUT HERE



INVOICE / STATEMENT

The Works Termite Inc.

119 Kearney St.
Chula Vista CA 91910
(619) 987-2504
theworkstermite@yahoo.com

Date: 07/08/2026

Report Number: 18826

Invoice Number: 18826-1

Escrow Number:

Property 308 La Cresta Heights Rd.
Inspected: El Cajon, CA 92021

Bill To: Scott Schimpf
4309 Merritt blvd
La Mesa, CA 91941
United States

MOBILE: (619) 825-6726
schimpf3787@gmail.com

Contract: \$	705.00
Invoice Total: \$	705.00
Payments: \$	705.00
Total Due: \$	0.00

Description of Service

The Works Termite Inc. has locally treated for drywood termite and repaired termite damage as per report.

RETURN THIS COPY WITH REMITTANCE
THANK YOU FOR YOUR BUSINESS