Excavating and Septic Service
530-524-4432
steve@eliteexcavatingandseptic.com

SEPTIC SYSTEM EVALUATION REPORT

Owners Name: [redacted] Phone #: [redacted]
Property Address: 9420 Dwyer Court
City, State, Zip: Durham, CA 95938
e-Mailing Address:
Evaluator: Francisco G. Date of inspection: 8/6/2026

Septic Tank Observations

Access Riser(s) in place ..... [ ] Yes [✓] No
Sanitary Tee Inlet ..... [✓] Yes [ ] No — Two: 3" ABS & 4" SDR
Scum depth inlet compartment ..... 4 inches
Sludge Depth Inlet Compartment ..... 12 inches
Structural Tank Condition ..... [✓] Good [ ] Fair [ ] Poor
Liquid Operating Level ..... [✓] High [ ] Normal [ ] Low (")
Baffle Condition ..... [✓] Good [ ] Fair [ ] Poor
Septic Tank Volume ..... 1200 Gallons
Addl. Tank Volume ..... ____ Gallons
Riser Condition ..... [ ] Good [ ] Fair [ ] Poor
Sanitary Tee Outlet ..... [✓] Yes [ ] No — 4" SDR
Scum Depth Outlet Compartment ..... 0 inches
Sludge Depth Outlet Compartment ..... 0 inches
Tank Material ..... [✓] Concrete [ ] Poly/Fiberglass [ ] Other
Septic Tank Pumping Required ..... [✓] Yes [ ] No
Was Septic Tank Pumped ..... [✓] Yes [ ] No
Date Septic Tank(s) Previously Pumped ..... today
Depth to Access Lids ..... 30 inches
Effluent Pump ..... [ ] Yes [✓] No

Absorption Field Observations

Effluent Line Diverter Valve ..... [ ] Yes [✓] No
Well On Property ..... [ ] Yes [✓] No
Common Area Absorption Field ..... [ ] Yes [✓] No
Absorption Field Type ..... [✓] Standard [ ] Alternative
Surfacing Effluent ..... [ ] Yes [✓] No
Hydraulic Load Test ..... [✓] Yes [ ] No
Hydraulic Load Test Results ..... [✓] Excellent [ ] Good [ ] Satisfactory [ ] Marginal
..... [ ] Poor [ ] FAILURE
Down Slope Seepage ..... [ ] Yes [✓] No
Saturated Absorption Field ..... [ ] Yes [✓] No
Multiple Systems ..... [ ] Yes [✓] No
Graywater Discharge ..... [ ] Yes [✓] No

Repairs or Upgrades Required.....[ ] Yes [✓] No (If yes describe below)

Comments/Recommendations:

Map:

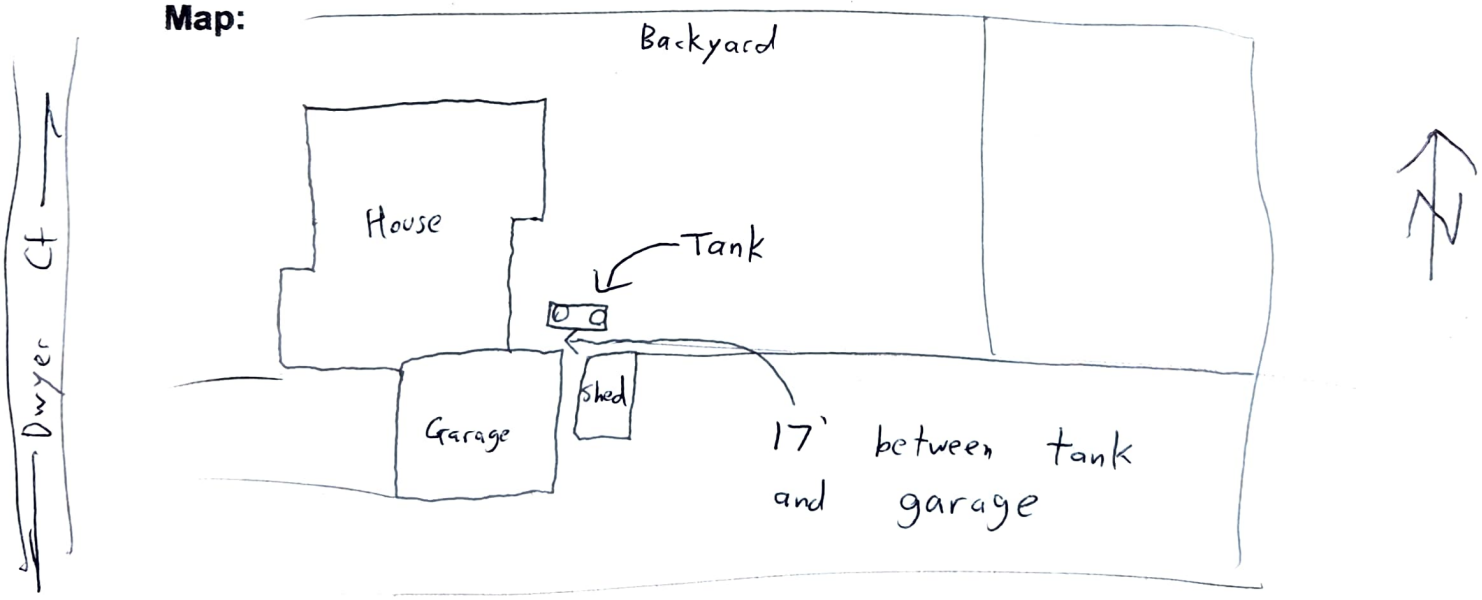

[✓] PASS **[ ] FAILED**

Evaluators Signature: [signature] **Date:** 8/6/2026

Company License # 1100571

This onsite wastewater treatment and disposal system evaluation report is a true and complete record of the onsite wastewater treatment and disposal system on the date of the evaluation. No warranty is given or implied regarding the remaining life of the system. I certify that this onsite wastewater treatment and disposal system reflects conditions observed on the above property(s) during the routine inspection of the onsite wastewater treatment and disposal system.


water level stayed at 7"
after hydro load test


12" of sludge on the
inlet side
2
1


3" abs inlet t


4" sdr inlet t


no sludge


concrete baffel


4" sdr outlet t


water level at 7" before
hydro load test


08/06/2026 10:13:54 AM
-6°
9'11"
dbox looks good


1/4" pick test