

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. <b>3844</b>	STREET, CITY, STATE, ZIP <b>E. 15th Street, Long Beach CA 90804</b>	Date of Inspection <b>2/29/2024</b>	No. of Pages <b>16</b>
 <b>Service... We Haven't Forgotten</b> <b>1115 E. Kimberly Avenue</b> <b>Anaheim, CA 92801</b> <b>Ph: (714) 632-3600</b> <b>Fax: (714) 238-0384</b> <b>Toll Free: (800) 585-5424</b>			
Firm Registration No. <b>PR 0474</b>		Report No. <b>2240344</b>	
Ordered By: Pacifica Properties Group 3201 Manhattan Ave. Hermosa Beach, CA 90254 Attn: Jessica Swarbrick 818-826-9440		Property Owner/Party of Interest Pacifica Properties Group 3201 Manhattan Ave. Hermosa Beach, CA 90254 Attn: Jessica Swarbrick 818-826-9440	
COMPLETE REPORT <input checked="" type="checkbox"/>		LIMITED REPORT <input type="checkbox"/>	
General Description: One story single family residence, flat roof, slab foundation, detached garage, vacant		Inspection Tag Posted: Garage	
		Other Tags Posted: None noted	
An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.			
Subterranean Termites <input checked="" type="checkbox"/> Drywood Termites <input checked="" type="checkbox"/> Fungus/Dryrot <input checked="" type="checkbox"/> Other Findings <input type="checkbox"/> Further Inspection <input type="checkbox"/>			
If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.			

NOTE: DIAGRAM IS DISPLAYED ON PAGE 2

Inspected by Fuia Poat State License No. OPR 11921 Signature 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

3844

E. 15th Street, Long Beach CA 90804

2/29/2024


2240344

BUILDING NO.


STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

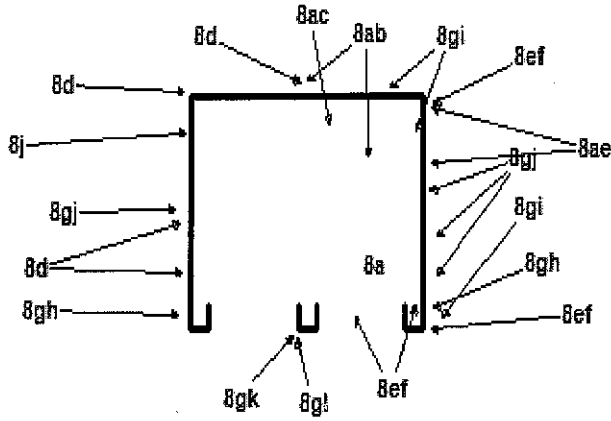

**DIAGRAM NOT TO SCALE**

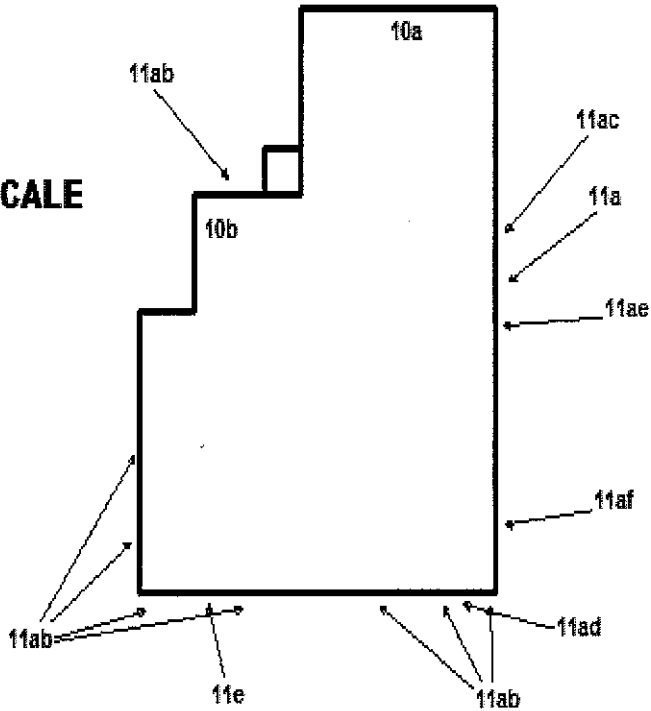

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

A. Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These include but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than 18" clear crawl space, the interior of hollow walls; spaces between a floor or porch deck and the ceiling below; area where there is no access without defacing or tearing out lumber, masonry or finished work; areas behind stoves, refrigerators or beneath floor coverings, furnishings; areas where encumbrances and storage, conditions or locks make inspection impractical, portions of the subarea concealed or made inaccessible by ducting or insulation, area beneath wood floors over concrete, and areas concealed by heavy vegetation. Exterior wood members are probed to inspect for signs of damage. Areas above 10' are visually inspected (unless additional inspection is requested at a cost). Although we make a visual inspection to interior, we do not probe or deface interior areas, unless visible signs of damage are noticed. This inspection is for main structure only and does not include fencing, gates, sheds, any detached structure, wood retaining walls, wood walkways, unless requested.

We assume no responsibility for work done by anyone else, for damage to structure or contents during our inspection, or for infestation, infection, adverse conditions or damage undetected due to inaccessibility or non-disclosure by owner/agent/tenant.

a) Second Story Note: This applies to all areas over 10 feet in height. Due to height restrictions, and safety concerns, all areas over 10' will be visually inspected from ground level for damage wood members. If probing of wood members over 12 feet is requested additional inspection fee's will apply, and be assessed on a case by case basis. Suncrest Exterminating assumes no liability for damages over 10 feet if found at a later date.

B. Slab floor construction has become more prevalent in recent years. Floor covering may conceal cracks in the slab that will allow infestation to enter. Infestations in the walls may be concealed by plaster so that a diligent inspection may not disclose the true condition. These areas are not practical to inspect because of health hazards, damage to the structure; or inconvenience. They were not inspected unless described in this report. We recommend further inspection if there is any question about the above noted areas. Ref: Structural Pest Control Act, Article 6, Section 8516(b), paragraph 1990(i). Amended effective March 1, 1974. Inspection is limited to disclosure of wood destroying pests or organisms as set forth in the Structural Pest Control Act, Article 6, Section 8516(b), Paragraph 1990-1991.

C. A re-inspection will be performed, if requested within four (4) months from date of original inspection, on any corrective work that we are regularly in the business of performing. If CERTIFICATION is required, then any work performed by others must be CERTIFIED by them. There is a \$ 95.00 re-inspection fee.

D. This company is not responsible for work completed by others, recommended or not, including by Owner. Contractor bills should be submitted to Escrow as certification of work completed by others.

E. This report includes findings related to the presence/non-presence of wood destroying organisms and/or visible signs of leaks in the accessible portions of the roof. The inspector did not go onto the roof surface due to possible physical damage to the roof, or personal injury. No opinion is rendered nor guarantee implied concerning the water-tight integrity of the roof or the condition of the roof and roofing materials. If interested parties desire further information on the condition of the roof, we recommend that they engage the services of a licensed roofing contractor.

F. Second story stall showers are inspected but not water tested unless there is evidence of leaks in ceiling below. Ref: Structural Pest Control Rules and Regulations, Sec. 8516G. Sunken or below grade showers or tubs are not water tested due to their construction.

G. During the course of/ or after opening walls or any previously concealed areas, should any further damage or infestation be found, a supplementary report will be issued. Any work completed in these areas would be at Owner's direction and additional expense.

H. During the process of subterranean slab treatment or replacement it may be necessary to drill holes through ceramic tiles or other floor coverings; These holes will then be sealed with concrete. We will exercise due care but assume no responsibility for cracks, chipping or other damage to floor coverings. We do not re-lay carpeting.

I. We assume no responsibility for damage to any Plumbing, Gas or Electrical lines, etc., in the process of pressure treatment of concrete slabs or replacement of concrete or structural timbers.

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

J. When a fumigation is recommended we will exercise all due care but assume no responsibility for damage to Shrubbery, Trees, Plants, TV Antennas or Roofs. A FUMIGATION NOTICE will be left with, or mailed to the Owner of this property, or his designated Agent. Occupant must comply with instructions contained in Fumigation Notice. During fumigation and aeration, the possibility of burglary exists as it does any time you leave your home. Therefore, we recommend that you take any steps that you feel necessary to prevent any damage to your property. We also recommend that you contact your insurance agent and verify that you have insurance coverage to protect against any loss, damage or vandalism to your property. The company does not provide any onsite security except as required by state or local ordinance and does not assume any responsibility for care and custody of the property in case of vandalism, breaking or entering.

K. Your termite report and clearance will cover EXISTING infestation or infection which is outlined in this report. If Owner of property desires coverage of any new infestation it would be advisable to obtain a Control Service Policy which would cover any new infestation for the coming year.

L. If you should have any questions regarding this report, please call or come by our office any weekday between 8:00 a.m. and 5:00 p.m. We also provide information about additional services for the control of Household Pests such as Ants and Fleas, etc.

M. Owner/agent/tenant acknowledges and agrees that inspection of the premises will not include any type of inspection for the presence or non-presence of asbestos and that this report will not include any findings or opinions regarding the presence or non-presence of asbestos in, upon or about the premises, we recommend that you contact a contractor specifically licensed to engage in asbestos related work. Further, should we discover the presence of asbestos during our inspection of the premises or should our inspection of the premises cause a release of asbestos dust or particles, owner/agent/tenant shall be solely responsible for the cleanup, removal and disposal of the asbestos and the cost thereof. Owner/agent/tenant hereby agrees to waive any and all claims against this Company which are in any way related to the presence of asbestos on the premises and further agrees to indemnify and hold this company harmless from any and all claims of any nature asserted by any third party, including this Company's employees, which is in any way related to the presence of asbestos on the premises.

N. This wood destroying Pests and Organisms Report DOES NOT INCLUDE MOLD or any mold like condition. No reference will be made to mold or mold like condition. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

O. NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Suncrest Exterminating's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, Suncrest Exterminating will not in any way be responsible for any act or omission in the performance of work that you directly contract with another or perform.

P. IMPORTANT NOTE: Under no circumstances should this "Wood Destroying Pest and Organisms Inspection Report" be construed in any way as a guarantee or warranty of the structure. Inspection reports are intended to represent a list of infestations, infections or adverse conditions found after the date of this inspection report by any party will require an additional inspection report with additional findings, recommendations and estimates, if any.

Q. NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

"State law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved by use by the California Department of Pesticides Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimize. If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 764 - 7661, (800) 876 - 4766 and your pest control company immediately. For further information, contact any of the following: Suncrest Exterminating (714) 632 -

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.	STREET, CITY, STATE, ZIP	INSPECTION DATE	REPORT NO.
--------------	--------------------------	-----------------	------------

3600, for health questions - County Health Dept: Orange (714) 834 - 7700; Los Angeles (800) 427 - 8700; San Diego (619) 515 - 6700; Riverside (951) 955 - 3045; San Bernardino (909) 387 - 6280; for application information - County Agricultural Commissioner: Orange (714) 955 -0100; Los Angeles (626) 575 - 5471; San Diego (858) 694 - 8980; Riverside (951) 955 - 3000; San Bernardino (909) 387 - 2105 and for Regulatory Information - The Structural Pest Control Board, 2005 Evergreen St #1500, Sacramento CA 95815 - 3831 (916) 561 - 8708."

**R. LIMITED ACCESS ATTICS DEFINITION:** Attic was only inspected from access cover, and not accessible, without possibility of causing damage to ceiling below. This includes low pitch roofs with less than 36" of clearance and/or heavily insulated attics making placement of footing difficult. We will not crawl an attic with possibility of breaking through. Items found at later date are not warranty/guaranteed by Suncrest Exterminating.

In accordance with the laws and regulations of the State of California, we are required to provide you with the following information prior to application of termiticides to your property:

For fumigation process, the following fumigant will be used:

Vikane – active ingredients: (99.8% sulfuryl fluoride and chloropicrin)

For treatment process, one of the following chemicals will be used:

Cy-Kick – active ingredients: (Cyfluthrin)

Bora-Care – active ingredients: (Disodium Octaborate Tetrahydrate 40% D.O.T.)

Termidor SC – active ingredients: (Fipronil 9.1%)

Timbor – active ingredients: (Disodium Octaborate Tetrahydrate 98%)

**NOTICE:** The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the sub-contractor. You may accept Suncrest Exterminating bid or you may contract directly with another registered company. If you choose to contract directly with another registered company Suncrest Exterminating will not in any way be responsible for any act or omission in the performance of work you directly contract with another company to perform.

**GUARANTEES:** Unless otherwise stated in your WDO report, the guarantees are as follows: Structural fumigations for the control of Drywood termites is guaranteed for four (4) years from the date of completion. Excluding boats, wood piles, patios, gazebos, recreational vehicles, sheds, and any other detached structure not part of the primary residence/building/structure. All excludes items are guaranteed for one year from date of completion. Guarantee applies to current targeted infestations and does not apply to any future infestation. Structural fumigation with a preventative treatment will be guaranteed for five (5) years from date of completion. Includes new infestations. Localized treatments/secondary treatment for the control of drywood/subterranean termites are guaranteed for one (1) year from date of completion, and is limited to areas of original treatment/infestation. Excludes all other areas not treated. Full perimeter subterranean termite treatments are guaranteed for five (5) years from the date of completion. In the event a re-fumigation is required, no compensation will be given for lodging/food/roof repair/plant damage. Wood replacement is guaranteed for one (1) year (excludes cracking/splitting/warping, as these are natural occurrences in wood).

**PAYMENTS:** All payments are due and payable upon completion of work performed. Invoices past 30 days are subject to a 1 1/2% interest per month (18% annual). In the event a mechanics lien is filed on the property, a \$ 600.00 fee will apply to the outstanding balance as well as the 1 1/2% per month interest. Escrow transaction will be given a 60 day grace period to settle any outstanding balances. In the event the property falls out of escrow or exceeds the 60-day grace period, the balance is due and payable immediately. **PAYMENT IS THE RESPONSIBILITY OF THE HOMEOWNER/AGENT/PROPERTY MANAGER ORDERING THE WORK, IF NOT PAID THROUGH ESCROW. WE WILL ENFORCE ALL COLLECTIONS.**

By your contracting Suncrest Exterminating you agree to pay reasonable attorney's fees and the \$ 175.00 mechanics lien fee in the event a suit/mechanics lien is required by this company to enforce any terms of this contract, together with the costs of such action, whether or not suit proceeds to judgement.

**PAINTING:** One coat of primer will be applied. If paint is provided by others/owner ON DAY OF REPAIRS (paint must be supplied on day of repairs), one coat will be applied. We do not guarantee painting. We are not a painting contractor. You should contact a licensed painter within 12 months to professionally paint.

**WOOD repair/replacement:** All bids for replacement are based on current mill sizes of wood. Mill sizes change over the years.

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

WE DO NOT GUARANTEE exact matches of lumber sizes. We will install lumber at the current mill sizes. If you would like an exact match, we can special order you lumber AT ADDITIONAL COST. All lumber (unless special ordered at additional cost) will/can have knots. Longer runs of replacement will have to be seamed together and seams will be filled. SEAMS MAY BE VISIBLE. All wood can split/cracck/warp over time AND NO WARRANTY is given regarding these events. Wood repair bid is for visible and accessible damage. If during the course of repairs additional damage is found, a supplemental report will be issued with additional findings and costs.

**TILE ROOF REPAIRS:** Upon completion of fumigation, there may be damaged roof tiles. We charge a \$ 95.00 fee (this will be applied to any roof repair) to inspect the roof and provide an estimate to repair/replace damaged roof tiles. Our minimum for any tile roof repair is \$ 550.00. Tiles used for repair may not be an exact match. Tile roof repair **DOES NOT GUARANTEED ROOF AGAINST LEAKAGE.**

**PERMITS:** Not all repairs require a building permit. All cities are different in their requirements. Due to this, your bid **DOES NOT INCLUDE a building permit.** In the event the city does require a permit, all work must stop until the permit is obtained. Suncrest Ext Construction & Repair will go to the city to obtain a permit. The homeowner is responsible for ALL costs of permits, and/or any additional requirements the city may require. This includes drafting/structural engineering/building code requirements. There will be a flat fee of \$ 750.00 by Suncrest to manage the permit process.

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**IF A SEPARATED REPORT HAS BEEN REQUESTED, IT IS DEFINED AS SECTION 1 & SECTION 2 CONDITIONS EVIDENT ON THE DATE OF INSPECTION. SECTION 1 CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION 2 ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION, BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREAS WHICH DURING THE ORIGINAL INSPECTION, DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.**

1. Subterranean Areas:

**SLAB/ABOVE GRADE**

2. Stall Shower:

**NOT TESTED**

3. Foundations:

**CONCRETE**

4. Porches - Steps:

**CONCRETE**

5. Ventilation:

**NONE**

6. Abutments:

**NONE**

7. Attic Spaces:

**NONE**

8. Garages:

**DETACHED 2 CAR GARAGE**

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**8. Garages:**

ITEM 8A Evidence of drywood termites noted in/at interior of garage as marked 8a on the diagram.

**RECOMMENDATION:** Fumigation of structure using Vikane\* (sulfuryl fluoride) gas fumigant (Made in the U.S.A), in conjunction with chloropicrin (warning agent). **While all due care will be taken we cannot be responsible for any roof/plant/antennas/ satellite damage during the course of fumigation.** Please consult with your inspector to see what possible damage may occur. All fumigations are guaranteed for FOUR years from date of completion. (See page 4 for additional details)

All visible drywood termite pellets noted during the time of a complete inspection will be removed via mask/cover. If inspection was limited/fumigation estimate only, no removal of pellets is included. A complete inspection will be needed and an additional costs will apply.

**\*\*\* A SIGNED "OCCUPANTS FUMIGATION NOTICE", ACCESS TO PROPERTY, AND ACCESS TO ELECTRICAL POWER MUST BE AVAILABLE BEFORE FUMIGATION CAN BE PERFORMED. \*\*\***

**\*\*\* NOTICE: IT'S THE HOMEOWNERS RESPONSIBILITY TO CONTACT THEIR LOCAL GAS COMPANY TO HAVE GAS TURNED BACK ON AFTER FUMIGATION HAS BEEN COMPLETED. \*\*\***

**\*\*\* FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. \*\*\***

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8B Evidence of drywood termite damage noted to 1x6 bracing as marked 8b on the diagram.

**RECOMMENDATION:** Replace/reinforce and/or wood fill damaged wood as needed to correct this item. Painting not included. **NOTE:** While all due care will be exercised, this company cannot warrant/guarantee condition of roofing upon removal/replacement of wood members. (I.e roofing of 2-3 or more layers may not lay flat upon completion.) Repair of this item does not constitute roof repairs and/or certification of condition of roof (refer to roof notation on page 3). **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges (if any).

**NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN ON CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*



3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**8. Garages:**

ITEM 8C Evidence of subterranean & drywood termite damage noted to 2x4 framing as marked See 8c on the diagram.

**RECOMMENDATION:** Replace/reinforce and/or wood fill damaged wood as needed to correct this item. Painting not included. **NOTE:** While all due care will be exercised, this company cannot warrant/guarantee condition of roofing upon removal/replacement of wood members. (I.e roofing of 2-3 or more layers may not lay flat upon completion.) Repair of this item does not constitute roof repairs and/or certification of condition of roof (refer to roof notation on page 3). **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges (if any).

**NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN ON CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8D Subterranean termites were noted at/in \_\_\_\_\_ as marked \_\_\_\_\_ on the diagram.

**RECOMMENDATION: Rod and trench exterior** and pressure inject TERMIDOR\* into the soil below. Drill interior approximately 30' Remove/mask/cover all accessible subterranean termite evidence. **WE ARE NOT RESPONSIBLE FOR DAMAGE THAT WILL OCCUR TO FLOOR COVERINGS, PLASTIC/PVC PIPES BELOW SLAB, AND RE-STRETCHING OF CARPET.** Note: This is a local treatment method and local treatments are not intended to be an entire structure treatment method. If infestations of subterranean termites extend or exist beyond the area of local treatment, they may not be exterminated. **LOCALIZED TREATMENTS ARE GUARANTEED FOR A PERIOD OF ONE YEAR FROM THE DATE OF COMPLETION. GUARANTEED APPLIES TO AREAS OF TREATMENT ONLY, AND DOES NOT ENCOMPASS THE ENTIRE STRUCTURE.**

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**8. Garages:**

ITEM 8E Evidence of drywood termites noted in/at storage area as marked 8e on the diagram.

**RECOMMENDATION:** Fumigation of structure using Vikane\* (sulfuryl flouride) gas fumigant (Made in the U.S.A), in conjunction with chloropicrin (warning agent). **While all due care will be taken we cannot be responsible for any roof/plant/antennas/ satellite damage during the course of fumigation.** Please consult with your inspector to see what possible damage may occur. All fumigations are guaranteed for FOUR years from date of completion. (See page 4 for additional details)

All visible drywood termite pellets noted during the time of a complete inspection will be removed via mask/cover. If inspection was limited/fumigation estimate only, no removal of pellets is included. A complete inspection will be needed and an additional costs will apply.

**\*\*\* A SIGNED "OCCUPANTS FUMIGATION NOTICE", ACCESS TO PROPERTY, AND ACCESS TO ELECTRICAL POWER MUST BE AVAILABLE BEFORE FUMIGATION CAN BE PERFORMED. \*\*\***

**\*\*\* NOTICE: IT'S THE HOMEOWNERS RESPONSIBILITY TO CONTACT THEIR LOCAL GAS COMPANY TO HAVE GAS TURNED BACK ON AFTER FUMIGATION HAS BEEN COMPLETED. \*\*\***

**\*\*\* FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. \*\*\***

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8F Evidence of drywood termite damage noted to framing as marked 8f on the diagram.

**RECOMMENDATION:** Replace/reinforce and/or wood fill damaged wood as needed to correct this item. Painting not included. **NOTE:** While all due care will be exercised, this company cannot warrant/guarantee condition of roofing upon removal/replacement of wood members. (I.e roofing of 2-3 or more layers may not lay flat upon completion.) Repair of this item does not constitute roof repairs and/or certification of condition of roof (refer to roof notation on page 3). **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges (if any).

**NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN ON CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**8. Garages:**

ITEM 8G Evidence of drywood termites noted in/at garage as marked 8g on the diagram.

**RECOMMENDATION:** Fumigation of structure using Vikane\* (sulfuryl fluoride) gas fumigant (Made in the U.S.A), in conjunction with chloropicrin (warning agent). **While all due care will be taken we cannot be responsible for any roof/plant/antennas/ satellite damage during the course of fumigation.** Please consult with your inspector to see what possible damage may occur. All fumigations are guaranteed for FOUR years from date of completion. (See page 4 for additional details)

All visible drywood termite pellets noted during the time of a complete inspection will be removed via mask/cover. If inspection was limited/fumigation estimate only, no removal of pellets is included. A complete inspection will be needed and an additional costs will apply.

**\*\*\* A SIGNED "OCCUPANTS FUMIGATION NOTICE", ACCESS TO PROPERTY, AND ACCESS TO ELECTRICAL POWER MUST BE AVAILABLE BEFORE FUMIGATION CAN BE PERFORMED. \*\*\***

**\*\*\* NOTICE: IT'S THE HOMEOWNERS RESPONSIBILITY TO CONTACT THEIR LOCAL GAS COMPANY TO HAVE GAS TURNED BACK ON AFTER FUMIGATION HAS BEEN COMPLETED. \*\*\***

**\*\*\* FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. \*\*\***

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8H Evidence of drywood termite damage noted to fascia as marked 8h on the diagram.

**RECOMMENDATION:** Replace/reinforce and/or wood fill damaged wood as needed to correct this item. Painting not included. **NOTE:** While all due care will be exercised, this company cannot warrant/guarantee condition of roofing upon removal/replacement of wood members. (I.e roofing of 2-3 or more layers may not lay flat upon completion.) Repair of this item does not constitute roof repairs and/or certification of condition of roof (refer to roof notation on page 3). **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges (if any).

**NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN ON CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**8. Garages:**

ITEM 8I Evidence of drywood termite damage noted to siding as marked 8i on the diagram.

**RECOMMENDATION:** Remove and replace (7) rows of 1x8 & (18) rows of 4x6 as needed to correct this item. No painting included. **NOTE:** Upon removal of damaged wood/materials, if infestation is extending into inaccessible areas, a supplemental report will then be issued, outlining findings, recommendations and additional charges (if any). **NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN TO CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8J Evidence of dryrot & drywood termite damage noted to rafter as marked 8j on the diagram.

**RECOMMENDATION:** Replace/reinforce and/or wood fill damaged wood as needed to correct this item. Painting not included. **NOTE:** While all due care will be exercised, this company cannot warrant/guarantee condition of roofing upon removal/replacement of wood members. (I.e roofing of 2-3 or more layers may not lay flat upon completion.) Repair of this item does not constitute roof repairs and/or certification of condition of roof (refer to roof notation on page 3). **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges (if any).

**NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN ON CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8K Evidence of drywood termite damage noted to stucco molding as marked 8k on the diagram.

**RECOMMENDATION:** Remove and replace 3 sides as needed to correct this item. No painting included. **NOTE:** Upon removal of damaged wood/materials, if infestation is extending into inaccessible areas, a supplemental report will then be issued, outlining findings, recommendations and additional charges (if any). **NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN TO CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 8L Evidence of minor drywood termite damage noted to jamb as marked 8l on the diagram.

**RECOMMENDATION:** Chisel out minor damage and wood fill damaged areas as needed to correct. No painting is included. **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges, (if any.) **NOTE:** If complete replacement is requested, a new estimate will be issued and/or we recommend contacting a licensed contractor for replacement.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

**9. Decks - Patios:**

**NONE**

**10. Other - Interiors:**

**INSPECTED**

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**10. Other - Interiors:**

ITEM 10A Evidence of drywood termites noted in/at interior as marked 10a on the diagram.

**RECOMMENDATION:** Fumigation of structure using Vikane\* (sulfuryl flouride) gas fumigant (Made in the U.S.A), in conjunction with chloropicrin (warning agent). **While all due care will be taken we cannot be responsible for any roof/plant/antennas/ satellite damage during the course of fumigation.** Please consult with your inspector to see what possible damage may occur. All fumigations are guaranteed for FOUR years from date of completion. (See page 4 for additional details)

All visible drywood termite pellets noted during the time of a complete inspection will be removed via mask/cover. If inspection was limited/fumigation estimate only, no removal of pellets is included. A complete inspection will be needed and an additional costs will apply.

**\*\*\* A SIGNED "OCCUPANTS FUMIGATION NOTICE", ACCESS TO PROPERTY, AND ACCESS TO ELECTRICAL POWER MUST BE AVAILABLE BEFORE FUMIGATION CAN BE PERFORMED. \*\*\***

**\*\*\* NOTICE: IT'S THE HOMEOWNERS RESPONSIBILITY TO CONTACT THEIR LOCAL GAS COMPANY TO HAVE GAS TURNED BACK ON AFTER FUMIGATION HAS BEEN COMPLETED. \*\*\***

**\*\*\* FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. \*\*\***

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 10B Evidence of subterranean termites noted as marked 10b on the diagram.

**RECOMMENDATION:** Treat wall voids with termidor foam approximately 05'-10' of wall. **NOTE:** IN ORDER FOR THIS COMPANY TO PERFORM FOAM TREATMENT TO WALL VOIDS, 1/8 INCH HOLES MUST BE OPENED 6 INCHES FROM FLOORING EVERY 18 INCHES. THIS COMPANY WILL FILL ALL HOLES WITH DRYWALL PATCH. THIS COMPANY WILL TEXTURE AREAS OF PATCHING. PAINT MUST BE PROVIDED BY OWNERS. **NOTE: LOCAL TREATMENT IS NOT INTENDED TO BE AN ENTIRE STRUCTURE TREATMENT METHOD. IF INFESTATIONS OF WOOD-DESTROYING PESTS EXTEND OR EXIST BEYOND THE AREA(S) OF LOCAL TREATMENT, THEY MAY NOT BE EXTERMINATED.**

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

**11. Other - Exteriors:**

**INSPECTED**

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**11. Other - Exteriors:**

ITEM 11A Evidence of drywood termites noted in/at exterior as marked 11a on the diagram.

**RECOMMENDATION:** Fumigation of structure using Vikane\* (sulfuryl flouride) gas fumigant (Made in the U.S.A), in conjunction with chloropicrin (warning agent). **While all due care will be taken we cannot be responsible for any roof/plant/antennas/ satellite damage during the course of fumigation.** Please consult with your inspector to see what possible damage may occur. All fumigations are guaranteed for FOUR years from date of completion. (**See page 4 for additional details**)

All visible drywood termite pellets noted during the time of a complete inspection will be removed via mask/cover. If inspection was limited/fumigation estimate only, no removal of pellets is included. A complete inspection will be needed and an additional costs will apply.

**\*\*\* A SIGNED "OCCUPANTS FUMIGATION NOTICE", ACCESS TO PROPERTY, AND ACCESS TO ELECTRICAL POWER MUST BE AVAILABLE BEFORE FUMIGATION CAN BE PERFORMED. \*\*\***

**\*\*\* NOTICE: IT'S THE HOMEOWNERS RESPONSIBILITY TO CONTACT THEIR LOCAL GAS COMPANY TO HAVE GAS TURNED BACK ON AFTER FUMIGATION HAS BEEN COMPLETED. \*\*\***

**\*\*\* FUMIGATION PRICE INCLUDES 30 FUMIGATION BAGS (15 ONCE DOUBLED AS REQUIRED) FOR FOOD/MEDICINES. IF ADDITIONAL BAGS ARE NEEDED, WE CHARGE \$ 25.00 PER 30 BAGS. \*\*\***

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 11B Evidence of dryrot & drywood termite damage noted to fascia as marked 11b on the diagram.

**RECOMMENDATION:** Remove and replace 56' of fascia as needed to correct this item. No painting included. **NOTE:** Upon removal of damaged wood/materials, if infestation is extending into inaccessible areas, a supplemental report will then be issued, outlining findings, recommendations and additional charges (if any). **NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN TO CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 11C Evidence of minor drywood termite damage noted to fascia as marked 11c on the diagram.

**RECOMMENDATION:** Chisel out minor damage and wood fill damaged areas as needed to correct. No painting is included. **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges, (if any.) **NOTE:** If complete replacement is requested, a new estimate will be issued and/or we recommend contacting a licensed contractor for replacement.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**11. Other - Exteriors:**

ITEM 11D Evidence of drywood termite damage noted to siding as marked 11d on the diagram.

**RECOMMENDATION:** Remove and replace (2) 1x8x10 s/l as needed to correct this item. No painting included. **NOTE:** Upon removal of damaged wood/materials, if infestation is extending into inaccessible areas, a supplemental report will then be issued, outlining findings, recommendations and additional charges (if any). **NOTE:** IF RAIN GUTTERS ARE REMOVED IN ORDER TO PERFORM REPAIRS, NO GUARANTEE IS GIVEN TO CONDITION OF RAIN GUTTERS UPON RE-INSTALLATION BY SUNCREST EXTERMINATING.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 11E Evidence of minor dryrot & drywood termite damage noted to eaves as marked 11e on the diagram.

**RECOMMENDATION:** Chisel out minor damage and wood fill damaged areas as needed to correct. No painting is included. **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges, (if any.) **NOTE:** If complete replacement is requested, a new estimate will be issued and/or we recommend contacting a licensed contractor for replacement.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 11F Evidence of minor drywood termite damage noted to rafter as marked 11f on the diagram.

**RECOMMENDATION:** Chisel out minor damage and wood fill damaged areas as needed to correct. No painting is included. **NOTE:** Upon removal of damaged wood, if infection is extending into inaccessible areas, a supplemental report will be issued, outlining findings, recommendations and additional charges, (if any.) **NOTE:** If complete replacement is requested, a new estimate will be issued and/or we recommend contacting a licensed contractor for replacement.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

3844

E. 15th Street, Long Beach CA 90804

2/29/2024

2240344

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

OCCUPANTS CHEMICAL NOTICE

Suncrest Exterminating will use pesticide chemical(s) specified below for the control of wood destroying pests or organisms in locations identified in the Structural Pest Control report as indicated above.

(1) The pest(s) to be controlled:

- SUBTERRANEAN TERMITES
- BEETLES
- DRY-WOOD TERMITES
- FUNGUS or DRY ROT
- OTHER

(2) The pesticide(s) proposed to be used and the active ingredient(s).

- A. VIKANE: Sulfuryl Flouride (99.8%) in conjunction with Chloropicrin
- B. CY-KICK: Cyflunthrin
- C. PT - 221L - Cyhalothrin
- D. BORA-CARE: Disodium Octaborate Tetrahydrate (40%) (D.O.T.)
- E. TERMIDOR SC: Fipronil 9.1%
- F. TIMBOR: Disodium Octaborate Tetrahydrate (98%)
- G. ALPINE: Dinotefuran, N-methyl-N'-nitro-N-[(tetrahydro-3-furanyl)methyl]guanidine (0.025%)

(3) "State Law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operators are licensed and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (213) 484 -5151 and your pest operator immediately. (714) 632 - 3600/(800) 585 - 5424 or Med-Net "Hot Line" 1-800-655-7262.

"For further information, contact any of the following: Suncrest Exterminating (714-632-3600 or 1-800-585-5424); for Health Questions - the County Health Department (Orange Co. 714-456-0603, L.A. Co. 800-427-8700, San Bernardino (800) 782-4264, or Riverside (951) 358 -5200; for Application Information - the County Agricultural Commissioner Orange County - 714-955-0100, L.A. County - 626-575-5471, San Bernardino (909) 387 - 2105, and Riverside (951) 955 -3011 and for Regulatory Information - the Structural Pest Control Board 916-561-8700; 2005 Evergreen Street, Suite 1500, Sacramento, California 95815-3831.

NOTICE TO OWNER

Under the California Mechanics' Lien Law any structural pest control company which contracts to do work for you, any contractor, sub-contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pestcontrol company in full if the subcontractor, laborers, or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your Property if they are not paid. (2/88)

Persons with respiratory or allergic conditions, or others who may be concerned about their health relative to this chemical treatment, should contact their physician concerning occupancy during and after chemical treatment prior to signing this NOTICE.

NO CHEMICAL APPLICATION WILL BE PERFORMED UNTIL SUCH TIME THAT THIS NOTICE IS RETURNED. HAVING READ THE INSTRUCTIONS, I, THE UNDERSIGNED, WILL ACCEPT RESPONSIBILITY FOR ALL THE AFOREMENTIONED.

OWNER/OCCUPANT \_\_\_\_\_ DATE \_\_\_\_\_

OWNER/OCCUPANT \_\_\_\_\_ DATE \_\_\_\_\_





1115 E. Kimberly Avenue  
 Anaheim, CA 92801  
 Ph: (714) 632-3600  
 Fax: (714) 238-0384  
 Toll Free: (800) 585-5424



## WORK AUTHORIZATION CONTRACT

Address of Property: 3844 E. 15th Street, Long Beach CA 90804  
 Inspection Date: 2/29/2024  
 Report #: 2240344  
 Title Co. & Escrow #:

SECTION 1	SECTION 2	FURTHER INSPECTION
8A \$ 1735.00	11B \$ 3655.00	
8B \$ 6335.00	11C See 11b	
8C See 8b	11D See 11b	
8D \$ 1250.00	11E See 11b	
8E See 8a	11F See 11b	
8F See 8b		
8G See 8a		
8H See 8b		
8I See 8b		
8J See 8b		
8K See 8b		
8L See 8b		
10A See 8a		
10B See 8d		
11A See 8a		

We Authorized the Following Section 1 Items to be Performed.

8A, 8B, 8C, 8D, 8E, 8F, 8G, 8H, 8I, 8J  
 8K, 8L, 10A, 10B, 11A, 11B, 11C, 11D  
 11E, 11F

We Authorized the Following Section 2 Items to be Performed.

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

We Authorized the Following Items for Further Inspection.

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

Proposed Cost Section 1: \$12,975.00

Proposed Cost Section 2: \$0.00  
**Total:** \$12,975.00

Proposed Cost Fur.Insp.: \$0.00

**NOTE: ALL PRICING IS VALID FOR 30 DAYS ONLY. ALL JOBS OVER \$5000 WILL REQUIRE A \$500 DEPOSIT. ALL WOOD REPAIR JOBS WILL REQUIRE A 50% DEPOSIT DUE ON/BEFORE THE FIRST DAY OF REPAIRS. BALANCE IS DUE ON COMPLETION. (DOES NOT APPLY TO ESCROW BILLED REPAIRS)**

**NOTICE TO OWNERS/AGENTS:** Under California Mechanics Lien Law, any structural pest control company which contracts to do work for you, and the contractor, subcontractor, laborer, supplier, or other person(s) who helps to improve your property, but is not paid for his/her work/supplies has a right to enforce a claim against your property. This means that, after a court hearing, your property could be sold by the court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full, if the subcontractor, laborer, or supplier remains unpaid. To preserve their right to file a claim or lien against your property certain claimants such as contractors or material suppliers are required to provide you a document entitled "Preliminary Notice." A preliminary notice is not a lien against your property. Its purpose is to notify you of persons who may have the right to file a lien against your property if they are not paid.

The total amount of this contract is due and payable upon completion of work, unless otherwise specified. A finance charge computed at a monthly rate of 1.5% of the unpaid balance (annual rate of 18%) will be added to all accounts 30 days past due.

**BY YOUR SIGNATURE BELOW:** You agree to all of the terms, conditions, and disclaimers of your WDO report (please read your report in its entirety), and agree to pay the amount stated on this work authorization contract: We will enforce all of the terms and conditions.

APPROVED AND READ BY: \_\_\_\_\_

DATE \_\_\_\_\_

ACCEPTED FOR: \_\_\_\_\_

SUNCREST EXTERMINATING

DATE \_\_\_\_\_



1115 E. Kimberly Avenue  
Anaheim, CA 92801  
Ph: (714) 632-3600  
Fax: (714) 238-0384  
Toll Free: (800) 585-5424



## WORK AUTHORIZATION CONTRACT

Address of Property: 3844 E. 15th Street, Long Beach CA 90804  
Inspection Date: 2/29/2024  
Report #: 2240344  
Title Co. & Escrow #:

### IMPORTANT CUSTOMER INFORMATION - TERMS AND CONDITIONS

**NOTICE TO OWNERS/AGENTS:** Under California Mechanics Lien Law, any structural pest control company which contracts to do work for you, and the contractor, subcontractor, laborer, supplier, or other person(s) who helps to improve your property, but is not paid for his/her work/supplies has a right to enforce a claim against your property. This means that, after a court hearing, the court officer could sell your property and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full, if the subcontractor, laborer, or supplier remains unpaid. To preserve their right to file a claim or lien against your property certain claimants such as contractors or material suppliers are required to provide you a document entitled "**Preliminary Notice.**" A preliminary notice is not a lien against your property. Its purpose is to notify you of persons who may have the right to file a lien against your property if they are not paid.

**INTEREST:** The total amount of this contract is due and payable upon completion of work, unless otherwise specified. A finance charge computed at a monthly rate of 1.5% of the unpaid balance (annual rate of 18%) will be added to all accounts 30 days past due.

**ESCROW:** Only the work specified on this contract is being done at this time due to owner/agents wishes. **Any work performed against an existing title escrow will be the financial responsibility of the party ordering the inspection report, in the event of a cancelled title escrow.** In case of non-payment by owner, reasonable attorney's fees and cost of collections shall be paid by the owner, whether a suit is filed or not.

**BILLING:** As a courtesy the title escrow company will be sent a bill upon completion of work that has been authorized by the owner/agent. Escrow transactions will received a 60 day grace period from time of billing. In the event Escrow has not close within the 60 days grace period, the total amount will be due and payable by the person(s) authorizing the work to be performed. **ALL OTHER TRANSACTIONS ARE DUE AND PAYABLE UPON COMPLETION.**

**BY YOUR SIGNATURE BELOW:** You agree to all of the terms, conditions, and disclaimers of your WDO report (**please read your report in its entirety**), and agree to pay the amount stated on this work authorization contract. We will enforce **all** of the terms and conditions.

I herby authorize Suncrest Exterminating to perform the following items:

Item #(s)/Section I/SectionII/Optional Bid \_\_\_\_\_ Total Estimate of item(s): \_\_\_\_\_

Authorization by Owner/Agent/Management \_\_\_\_\_ Date \_\_\_\_\_

Title \_\_\_\_\_ P.O/Escrow # \_\_\_\_\_

Phone (Residence) \_\_\_\_\_ Business \_\_\_\_\_

Suncrest Exterminating (714) 632 - 3600 Fax (714) 238 - 0384

# INVOICE



1115 E. Kimberly Avenue  
Anaheim, CA 92801  
Ph: (714) 632-3600  
Fax: (714) 238-0384  
Toll Free: (800) 585-5424



DATE REPORT # ESCROW #  
03/01/2024 2240344

PROPERTY LOCATION  
3844 E. 15th Street, Long Beach CA 90804

TO: Pacifica Properties Group  
3201 Manhattan Ave.  
Hermosa Beach, CA 90254  
ATTN: Jessica Swarbrick

Copy To: Pacifica Properties Group  
3201 Manhattan Ave.  
Hermosa Beach, CA 90254  
ATTN: Jessica Swarbrick

02/29/2024	Inspection	\$95.00
<b>Balance Due:</b>		<b>\$95.00</b>

RETAIN THIS COPY FOR YOUR RECORDS

#### DUE AND PAYABLE WITHIN RECEIPT

1.5% per month charged on all past due accounts. This is an annual percentage rate of 18%

(Interest charged pursuant to the Robinson-Patman Act)

NOTICE: "Under the Mechanics'Lien law, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property but is not paid for his work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your own contractor in full, if the subcontractor, laborer, or supplier remains unpaid."

**THANK YOU FOR YOUR BUSINESS**