
WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
4170	Whispering Oak	Paso Robles	93446	06/21/17	5
	ARCHIE'	S ALOHA PEST M	IANAGEMENT	Report #:1	7740
		P.O. BOX 2337		Registration	#: PR 4934
		ATASCADERO CA 9	3423	Escrow #:	
		Tel 805-461-5352 Fax 805-23	33-6648	CORRE	CTED REPORT
Ordered by: Nancy Fifke Keller William (805)268-2576 nancyfsk97@gma		Property Owner and/or Party of I		entto: x on hose bib	
COMPLETE REPO	ORT X LIMITED REPO	ORT SUPPLEMENTAL R		CTION REPORT	
GENERAL DESCRIPTION: Single Family, Single Story, occupied, furnished, wood siding, slab, attached Inspection Tag Posted: GARAGE					
	garage, comp. 1	coof	Other Tags Posted	:	
		own on the diagram in accordance von the diagram were not inspected.	with the Structural Pest Control	Act. Detached porches	detached
Subterranean Termites Drywood Termites Fungus / Dryrot X Other Findings X Further Inspection If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked					

Diagram Not To Scale

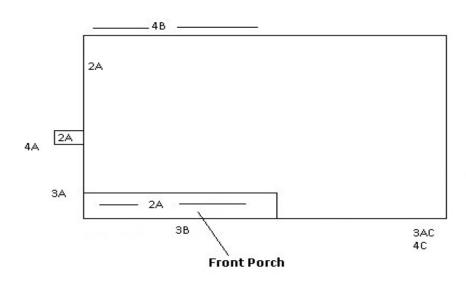

Inspected By: ALISON MELENDEZ

State License No. FR 50938

Signature: alison Melendey

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 10/01)

Page 2 of inspection report

4170	Whispering Oak	Paso Robles	CA	93446
Address of Propert	ty Inspected	City	State	Zip
	06/21/17	17740		
Stamp No.	Date of Inspection	Co. Report No.	Escrow No).

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

"NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company."

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

Page 3 of 5 of Standard Inspection Report

4170	Whispering Oak	Paso Robles	CA 93446
Address of Property	Inspected	City	State Zip
	06/21/17	17740	
Stamp No.	Date of Inspection	Co. Report No.	Escrow No.

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(s) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

2. DRYWOOD TERMITES:

2A - FINDING - Evidence of drywood termites noted in the wall framing. This evidence appears to extend into inaccessible areas.

RECOMMENDATION - Fumigation with VIKANE (SULFURYL FLORIDE)/CHLOROPICRIN for the control of drywood termites. There is a 5-YEAR GUARANTEE for control of original infestation in structure at time of fumigation. Eleven months after the fumigation, this company will re-inspect these areas to ensure the guarantee at NO ADDITIONAL CHARGE. At the time, if any new infestations are found, we will chemically treat these infestations at no additional charge. Covering or removal of all pellets is INCLUDED in all fumigation bids and will be scheduled after fumigation has been completed. This Company will NOT be responsible for damage to roofing or plant life adjacent to the structure. See attached Occupants Fumigation Notice, Fact Sheet, Food Preparation and Bagging Sheet as to property preparation (Owner's copy only). These papers will all be reviewed with the owner or tenant at a pre-fumigation appointment, arranged prior to fumigation date, to ensure all conditions are understood.

Please allow a MINIMUM of 15 days for fumigation scheduling so these requirements can be performed. If Fumigation Notice Work Is Not Completed By Arrival of Fumigation Company, fumigation will be re-scheduled at 10% of the job cost, or occupants may be charged \$35.00 per man hour for preparation work.

Fumigation is performed by sub-contractor - SECTION 1

Page 4 of 5 of Standard Inspection Report

4170	Whispering Oak	Paso Robles	CA 93446
Address of Propert	y Inspected	City	State Zip
	06/21/17	17740	
Stamp No.	Date of Inspection	Co. Report No.	Escrow No.

3. FUNGUS / DRYROT:

3A - RECOMMENDATION - Remove and replace the damaged portions of the trim as needed.

RECOMMENDATION - Remove and replace/resupport the damaged and infected material with new material. SECTION 1

3B - FINDING - Fungus damage and infection, infestation noted to fascia.

RECOMMENDATION - Remove and replace/resupport the damaged and infected material with new material. SECTION 1

3C - FINDING - Fungus damage and infection, infestation noted to siding .

RECOMMENDATION - Remove and replace/resupport the damaged and infected material with new material. SECTION 1

4. OTHER FINDINGS:

4A - FINDING - Earth to wood contact with wood member(s) dog house framing attached to structure.

RECOMMENDATION - Re-grade the soil level to break the earth wood contact. SECTION 2

4B - FINDING - Earth to wood contact with wood member(s) siding attached to structure.

RECOMMENDATION - Re-grade the soil level to break the earth wood contact. SECTION 2

4C - FINDING - Moisture condition noted to siding embedded in concrete.

RECOMMENDATION: Cut the base of the wood member and remove the embedded portion of wood. Fill the void with concrete patch if necessary. SECTION 2

"Thank you for selecting our company to perform a structural pest control inspection on your property. Our inspectors have determined that your property will benefit from the safe application of a chemical commonly used for structural pest control. In accordance with the laws and

Page 5 of 5 of Standard Inspection Report

4170	Whispering Oak	Paso Robles	CA 93446
Address of Property	Inspected	City	State Zip
	06/21/17	17740	
Stamp No.	Date of Inspection	Co. Report No.	Escrow No.

regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property. Please take a few moments to read and become familiar with the content.

State Law requires that you be given the following information:

""CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operators are licensed and regulated by the Structural Pest control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.""

""If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.""

For further information contact any of the following:
Archie's Aloha Pest Mgmt.- 805-461-5352
County Health Department- 805-781-5500
County Poison Control Center - 800-222-1222
County Agricultural Commissioner - 805-781-5910
Structural Pest Control Board - 916-561-8700

P.O. BOX 2337

ATASCADERO CA 93423

Tel 805-461-5352 Fax 805-233-6648

AGREEMENT

Report #: 17740 No work will be performed until a signed copy of this agreement has been received. 4170 Whispering Oak Address of Property: Paso Robles City: CA 93446 State/Zip: 06/21/17 The inspection report of the company dated, is incorporated herein by reference as though fully set forth. The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _ _____ . This total amount is due and payable within Ten (10) days from completion repair work and/or chemical application. THE COMPANY AGREES To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting or plumbing, which is guaranteed for a period of Ninety (90) days. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants or roof. THE OWNER OR OWNER'S AGENT AGREES To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The Owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not. **ALL PARTIES AGREE** If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above: NOTICE TO OWNER Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid. **ITEMS** Further Prefix Section 1 Section 2 Inspection Others 2a 2,158.00 3a 225.00 3b 278.00 Зс 232.00 4 a 4b 4c Total: 2,893.00 Grand: 2,893.00 Property Owner: Date: Inspected By: Date:

Date:

Owner's Agent:

INVOICE / STATEMENT

ARCHIE'S ALOHA PEST MANAGEMENT

P.O. BOX 2337 ATASCADERO CA 93423 Tel 805-461-5352 Fax 805-233-6648 Date: 06/21/17 Report Number: 17740 Invoice Number: 17740

Escrow Number:

Property

Inspected: 4170 Whispering Oak

Paso Robles, CA 93446

Bill To: Nancy Fifke

Keller Williams (805)268-2576

nancyfsk97@gmail.com

Description of Service

Termite Inspection Complete

Inspection Amount:	\$85.00
Contract:	\$0.00
Labor/Materials:	\$0.00
Miscellaneous:	\$0.00
Interest:	\$0.00
Invoice Total:	\$85.00
Payments:	\$0.00
Additional Charge:	\$0.00

\$85.00

Total Due:

RETAIN THIS COPY FOR YOUR RECORDS

THANK YOU FOR YOUR BUSINESS

CUT HERE CUT HERE CUT HERE

INVOICE / STATEMENT

ARCHIE'S ALOHA PEST MANAGEMENT

P.O. BOX 2337 ATASCADERO CA 93423

Tel 805-461-5352 Fax 805-233-6648

Property

Inspected: 4170 Whispering Oak

Paso Robles, CA 93446

Bill To: Nancy Fifke

Keller Williams (805)268-2576

nancyfsk97@gmail.com

Description of Service

Termite Inspection Complete

Date: 06/21/17
Report Number: 17740
Invoice Number: 17740
Escrow Number:

Total Due:	\$85.00
Payments:	\$0.00
Additional Charge:	\$0.00
Invoice Total:	\$85.00
Inspection Amount:	\$85.00
Contract:	\$0.00
Labor/Materials:	\$0.00
Miscellaneous:	\$0.00
Interest:	\$0.00

RETURN THIS COPY WITH REMITTANCE

THANK YOU FOR YOUR BUSINESS