

Abalone Coast Analytical, Inc.

141 Suburban Rd, Ste C-1 San Luis Obispo CA, 93401
Phone: 595-1080 Fax: 595-1075

Order #: 24-3709
Date/Time Rec'd: 8/29/24 1134

Filipponi & Thompson Drilling
P.O. Box 845
Atascadero, CA 93423

Contact: Ned Thompson
Phone: 805-466-1271
Sampler: Robert Thompson

Project:

Sample #	Sample Description	Date / Time	Analysis	Method	Result	Units	RL	Completed
-1	1375 Nacimiento Lake	8/28/24 1000	MPN Total Coliform	SM 9223 B.	ND.	MPN/100mL	1	08/30/24
	Road		MPN E-coli	IDEXX	ND.	MPN/100mL	1	08/30/24

This sample passes water quality standards for Total Coliform and E. Coli Bacteria.

Report Completion Date: 8/30/24

Reviewed By: 

Priyanka Singh, Technical Director

Definitions:

MPN = Most Probable Number

RL = Reporting Limit

ND = Analyte NOT DETECTED at or above MDL

State of California CDPH ELAP 2661

Coliform are bacteria that are naturally present in the environment and are used as an indicator that other, potentially-harmful, bacteria may be present.

The presence of Fecal coliforms and/or *E. coli* indicates that the water may be contaminated with human or animal wastes. Microbes in these wastes can cause short-term effects, such as diarrhea, cramps, nausea, headaches, or other symptoms. They may pose a special health risk for infants, young children, some of the elderly, and people with severely compromised immune systems.



State License No. C57 432680
 P.O. BOX 845
 ATASCADERO, CA 93423
 805-466-1271

Name DENIS DeCLERCQ
 Mailing Address 1375 NACIMIENTO LAKE DR - PASO ROBLES, CA 93446
 Job Location 1375 NACIMIENTO LAKE DR - PASO ROBLES, CA 93446
 Well Size 8" Depth 24.1'
 Tested by R. THOMPSON Rate of Flow (gpm) 15

Date 8/29/2024
 Phone _____
 APN 026-261-058
 Duration 4 HOUR + RECOVERY
 Static Level 7.7'

Well Test Report

<u>Date</u>	<u>Time</u>	<u>Water Level (FT)</u>	<u>G.P.M.</u>	<u>Drawdown</u>
8/28/2024	9:15AM	7.7	15.0	
	9:20	8.4	15.0	-0.7
	9:25	8.5	15.0	-0.8
	9:30	8.5	15.0	-0.8
	9:35	8.6	15.0	-0.9
	9:40	8.6	15.0	-0.9
	9:45	8.7	15.0	-1.0
	10:00	8.7	15.0	-1.0
	10:15	8.8	15.0	-1.1
	10:30	8.8	15.0	-1.1
	10:45	8.8	15.0	-1.1
	11:15	8.8	15.0	-1.1
	11:45	8.9	15.0	-1.2
	12:15PM	8.9	15.0	-1.2
	12:45	9.0	15.0	-1.3
	1:15	9.1	15.0	-1.4


Recovery

<u>Date</u>	<u>Time</u>	<u>Water Level (FT)</u>
8/28/2024	1:15PM	9.1
	1:20	8.0
	1:25	7.9
	1:30	7.8

Additional Comments:
 WELL PUMP WAS SET AT 20'

Thank you,


 Ned M. Thompson

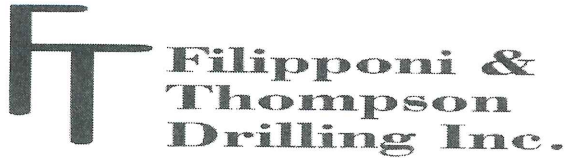

State License No. C57 432680
 P.O. BOX 845
 ATASCADERO, CA 93423
 805-466-1271

PUMP INSTALLATION REPORT

Name DENIS DeCLERCQ Date 10/9/2020
 Address 1375 NACIMIENTO LAKE DR - PASO ROBLES, CA 93446 Code 29/69/24/34
 Location 1375 NACIMIENTO LAKE DRIVE Well # 1 Phone 805-471-1132
 APN 026-261-058

PUMP

Make GRUNDFOS Model # 10S05-9
 H.P. 1/2 Serial # 5700390279592 Voltage 230 VOLT / SINGLE PHASE
 Pipe size 1 1/4" Type PVC SCH 80 Wire size #10 Type #10/4 FLAT JACKET
 Depth Setting 20' Well Seal 1 1/4" X 8" Check Valve IN PUMP
 Motor Date P2-2025 Motor Model # MS402CSIR
 Motor Serial # 79453102 Safety Rope _____
 Booster Pump Make GOULDS Model # 1 1/2 HP GH15 (EXISTING)
 Misc. _____

CONTROL

Control box 1/2 HP Make FRANKLIN
 Pressure Switch SQUARE D (5/20/23) On 40 Lbs. Off 60 Lbs.
 Liquid Level INSIDER 231 (7/1/16) Low X (7/1/16) High X (7/1/16)
 Relief Valve _____ Make _____ Setting _____
 Pump Panel Make _____ Voltage _____ Mag Size _____
 Heater/Overload _____ Fuses _____
 Misc. LOW LIGHT ALARM (03/16/22)

STORAGE

Size 3,000 GALLON (7/1/16) Galv Poly Fiberglass
 Pressure Tank Make CHALLENGER Size 82 GALLON Model (6/30/16)
 Pressure Tank Make CHALLENGER Size 85 GALLON Model (7/1/16)
 Misc. _____

WELL

Casing Size 8" Type PVC
 Depth To Water 7.7' (8/28/24) To Bottom 24.1' (10/9/20)
 G.P.M. @ Ft. Tested By _____
 Misc. _____